


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 9579	Main Street: BANCROFT_ST	Cross Street: FRANKLIN_AV	Location:	S
ADA ID: F3025811C90A	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 7.5
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

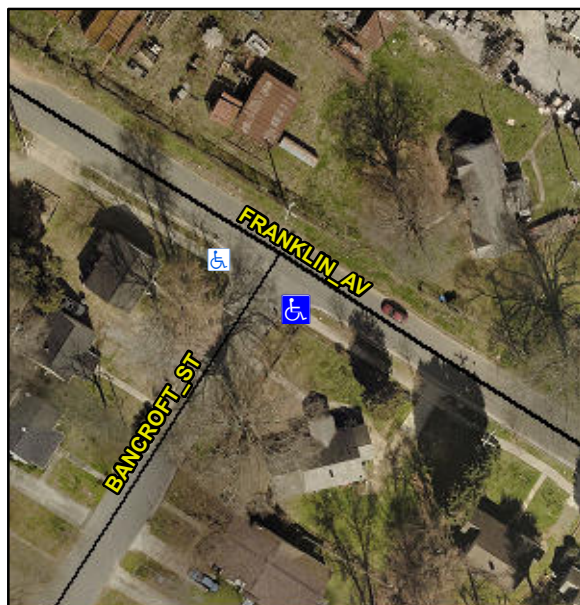

Possible Solutions:

Remove & Replace Entire Ramp.
Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.1, R304.5.3, R305.1.4, R305.2, R304.5.4

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	123.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	59.0	No	Grade Break Slope (%)	7.7
Yes	Ramp Slope (%)	6.8	Yes	Grade Break XSlope (%)	1.2
Yes	Ramp XSlope (%)	1.4			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
No	Landing Length (in)	44.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.2	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.1	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	No	DWS Offset LT (in)	4.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	45.0
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.3
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	3.0
N/A	Painted X Walk1?	No		Road Slope (%)	1.4
	X Walk 1 Direction	To NW		Road X Slope (%)	2.8
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	1.4	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.8	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	N/A

Total Cost: \$ 2350.00

