

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 16745 Main Street: MARYLAND_AV Cross Street: PRINCETON_AV Location: NW

ADA ID: F82BDBE34DA2 Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

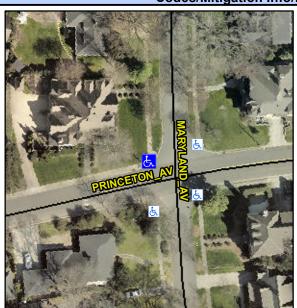

Street 1 Name
Stop Condition-Street 2
Street 2 Name
Stop Condition-Street 1

PRINCETON AV

None

MARYLAND AV

StopSign

Possible Solutions:

Remove & Replace Curb Ramp With
Two New Directional Ramps or
Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2, R304.5.3

Total Cost: \$ 3200.00

Compliance Description		Data	Compliance Description		Data
N/A	Ramp Length (in)	86.0	No	Ramp Slope (%)	9.2
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.1
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To S		X Walk 2 Direction	To E
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.7		X Walk 2 Slope (%)	4.3
	X Walk 1 X Slope (%)	4.1		X Walk 2 X Slope (%)	1.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.9	N/A	Clear Space?	N/A
	Road X Slope (%)	2.8	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good





