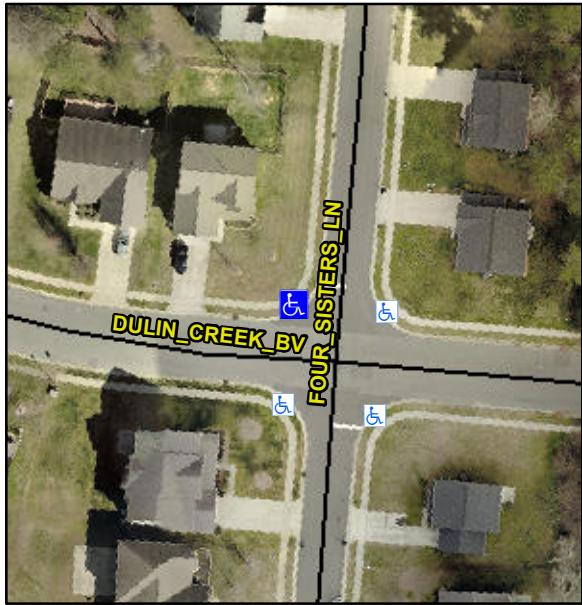


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 30336	Main Street: DULIN_CREEK_BV	Cross Street: FOUR_SISTERS_LN	Location: NW
ADA ID: FD31D3ACEF55	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
 <div>Street 1 Name<div>DULIN CREEK BV</div></div> <div>Stop Condition-Street 2<div>None</div></div> <div>Street 2 Name<div>FOUR SISTERS LN</div></div> <div>Stop Condition-Street 1<div>StopSign</div></div>	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	45.5	No	Ramp Slope (%)	9.6
			No	Ramp Width (in)	46.5	Yes	Ramp XSlope (%)	1.7
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
		N/A	Shared Landing?	N/A				
		N/A	Gutter Ponding?	N/A	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No	N/A	N/A	Painted X Walk2?	No
			X Walk 1 Direction	To E			X Walk 2 Direction	To S
		N/A	X Walk 1 Width (in)	N/A	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	3.4			X Walk 2 Slope (%)	1.3
			X Walk 1 X Slope (%)	1.4			X Walk 2 X Slope (%)	2.7
		N/A	Ramp inside XWalk1?	N/A	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	2.3	N/A	N/A	Clear Space?	N/A
			Road X Slope (%)	1.3	N/A	N/A	Clear Space to XWalk (in)	N/A
		N/A	Any Obstructions?	N/A	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			Obstruction Type				Storm Grate/Utility Type	
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good
Surveyor Notes:								
N/A								
PROW/ADA:								
Not Found, R304.5.1, R304.2.2								
Total Cost:		\$	3200.00					

