


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 53493 Main Street: PROVIDENCE_COUNTRY_CLUBE_ross Street: MCGILL_HEIGHTS_RD Location: SE

Overall Compliance: No ADA ID: FE75BE1A096E Ramp Type: Perp Initial Pass/Fail: Fail **Severity Score:** 12.5

Codes/Mitigation Info/Possible Solutio

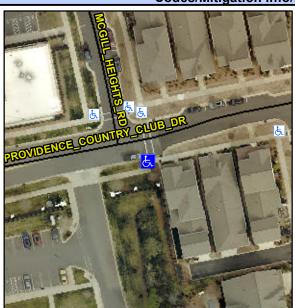

The second secon	
Street 1 Name	PROVIDENCE COUNTRY CLUB DR
Stop Condition-Stre	et 2 None
Street 2 Name	N/A
Stop Condition-Stre	et 1 N/A

/Possible Solution		Field Measurements/Component Compliance					
Possible Solutions:		Comp	liance Description	Data	Compli	ance Description	Data
Remove & Replace Entire Ra	amp.	N/A	Ramp Length (in)	67.0	Yes	Ramp Slope (%)	6.8
	-	Yes	Ramp Width (in)	79.0	No	Ramp XSlope (%)	5.8
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
1		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
Surveyor Notes:		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	N/A			
PROW/ADA:		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
R304.5.3		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
			X Walk 1 Direction	To N		X Walk 2 Direction	N/A
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	1.5		X Walk 2 Slope (%)	N/A
			X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	N/A
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	N/A	N/A	Clear Space?	N/A
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
Total Cost: \$	1850.00		Obstruction Type			Storm Grate/Utility Type	
				N/A			N/A
					Yes	Surface Condition? (G/P)	Good





