# Access Compliance Report
# Public Rights-of-Way
# (Curb Ramps)

| | | | |
|---|---|---|---|
| **Intersection ID: 21514** | **Main Street: E_ARROWOOD_RD** | **Cross Street: NATIONS_FORD_RD** | **Location: NW** |
| **ADA ID: 075485FD92CD** | **Ramp Type: BlendTrans1** | **Initial Pass/Fail: Pass** | **Overall Compliance: No** **Severity Score: 5** |

## Codes/Mitigation Info/Possible Solution

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R305.2, R304.5.4**

| | |
|---|---|
| Street 1 Name | **E ARROWOOD RD** |
| Stop Condition-Street 1 | **Signal** |
| Street 2 Name | **N/A** |
| Stop Condition-Street 2 | **N/A** |

Total Cost: **$ 3950.00**

## Field Measurements/Component Compliance
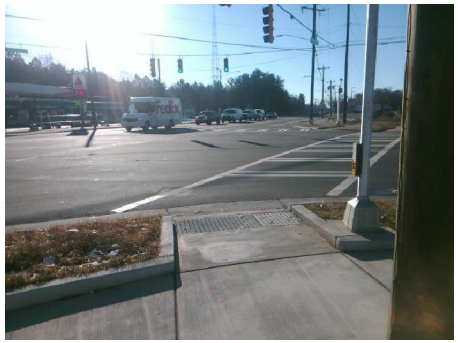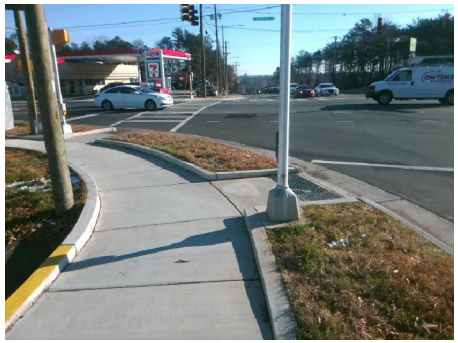
| Compliance | Description | Data | Compliance | Description | Data |
|---|---|---|---|---|---|
| N/A | Ramp Length (in) | 66.0 | Yes | BlendTrans Slope (%) | 3.6 |
| Yes | Ramp Width (in) | 71.0 | Yes | BlendTrans XSlope (%) | 0.7 |
| Yes | Flare Type LT | Curbed_NoWalkSurface | Yes | Flare Type RT | Curbed_NoWalkSurface |
| N/A | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A |
| N/A | Flare Traversable LT? | No | N/A | Flare Traversable RT? | No |
| Yes | Landing Length (in) | 72.0 | Yes | DWS Provided? | Yes |
| Yes | Landing Width (in) | 71.0 | Yes | DWS Contrast? | Yes |
| Yes | Landing Slope (%) | 1.7 | Yes | DWS Length (in) | 24.0 |
| Yes | Landing X Slope (%) | 1.4 | Yes | DWS Full Width? | Yes |
| N/A | Landing Curb? (Y/N) | Yes | No | DWS Offset (in) | 2.5 |
| N/A | Shared Landing? | No | | | |
| Yes | Gutter Ponding? | No | No | Gutter Slope (%) | 5.1 |
| Yes | Gutter Lip Ht (in) | 0.0 | Yes | Gutter X Slope (%) | 0.5 |
| N/A | Painted X Walk1? | Yes | N/A | Painted X Walk2? | N/A |
| | X Walk 1 Direction | To S | | X Walk 2 Direction | N/A |
| | X Walk 1 Width (in) | 104.0 | | X Walk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 1.5 | | X Walk 2 Slope (%) | N/A |
| | X Walk 1 X Slope (%) | 0.9 | | X Walk 2 X Slope (%) | N/A |
| Yes | Ramp inside XWalk1? | Yes | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | 0.9 | | Clear Space? | Yes |
| | Road X Slope (%) | 1.5 | N/A | Clear Space to XWalk (in) | N/A |
| Yes | Any Obstructions? | No | Yes | Storm Grate/Utility Hazard? | No |
| | Obstruction Type | | | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |
| | | | No | Curb Slope (%) | 8.4 |