Access Compliance Report
Public Rights-of-Way
(Curb Ramps)

Intersection ID: 5264 | **Main Street:** BEATTIES_FORD_RD | **Cross Street:** MCINTYRE_AV | **Location:** NW

ADA ID: F6DF44C0611A | **Ramp Type:** Directional1 | **Initial Pass/Fail:** Pass | **Overall Compliance:** No | **Severity Score:** 7.75

Codes/Mitigation Info/Possible Solution

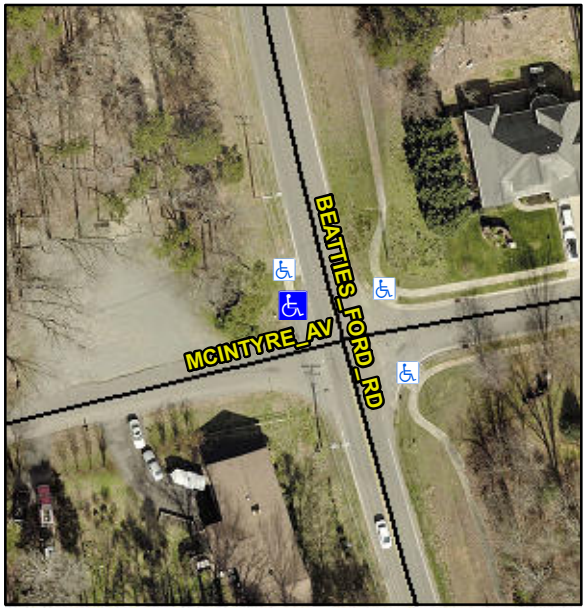

Possible Solutions:

Remove & Replace Entire Ramp.
Remove & Replace Gutter.

Surveyor Notes:

NO CURB

PROW/ADA:

R304.5.3, R305.1.4, R305.2, R304.5.4

Street 1 Name	MCINTYRE AV
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: $ 2350.00

Field Measurements/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	207.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	59.5	No	Grade Break Slope (%)	5.5
Yes	Ramp Slope (%)	5.1	No	Grade Break XSlope (%)	5.0
No	Ramp XSlope (%)	3.3			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	59.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.7	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.1	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	45.0
N/A	Shared Landing?	No	No	DWS Offset RT (in)	9.0
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.8
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	8.0
N/A	Painted X Walk1?	No		Road Slope (%)	3.6
	X Walk 1 Direction	N/A		Road X Slope (%)	8.5
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	3.6	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	8.5	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
		N/A	N/A	Curb Slope (%)	2.7