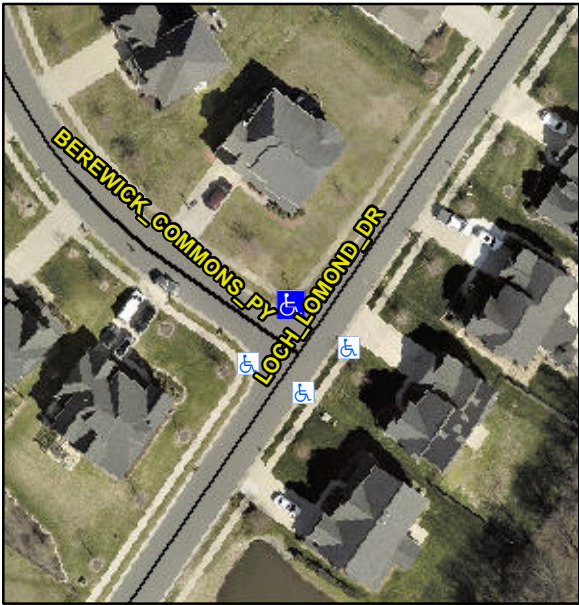


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 48495	Main Street: LOCH_LOMOND_DR	Cross Street: BEREWICK_COMMONS_PY	Location:	N
ADA ID: 61109E034CA9	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 8.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	46.0	Yes	Ramp Slope (%)	5.3
			No	Ramp Width (in)	47.0	Yes	Ramp XSlope (%)	0.2
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A			
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	0.6		X Walk 2 Slope (%)	2.4
				X Walk 1 X Slope (%)	0.4		X Walk 2 X Slope (%)	1.1
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	0.2	N/A	Clear Space?	N/A	
			Road X Slope (%)	0.9	N/A	Clear Space to XWalk (in)	N/A	
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
			Obstruction Type			Storm Grate/Utility Type		
					N/A		N/A	
						Yes	Surface Condition? (G/P)	Good
Surveyor Notes:								
N/A								
PROW/ADA:								
R304.5.1								
Total Cost:		\$	3200.00					
Street 1 Name		BEREWICK COMMONS PY						
Stop Condition-Street 2		StopSign						
Street 2 Name		LOCH LOMOND DR						
Stop Condition-Street 1		None						

Total Cost: \$ 3200.00

