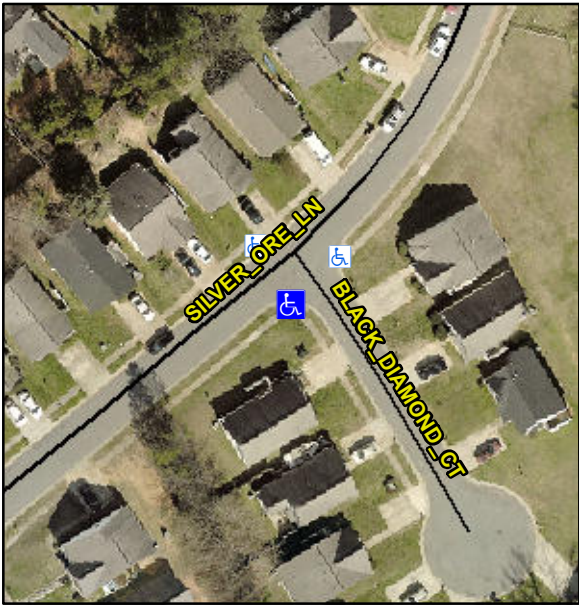


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 30237	Main Street: BLACK_DIAMOND_CT	Cross Street: SILVER_ORE_LN	Location: SW
ADA ID: 96B99F29D740	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
 <div>Street 1 Name<div>BLACK DIAMOND CT</div></div> <div>Stop Condition-Street 2<div>StopSign</div></div> <div>Street 2 Name<div>SILVER ORE LN</div></div> <div>Stop Condition-Street 1<div>None</div></div>	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	48.0	No	Ramp Slope (%)	8.4
			Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.2
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
PROW/ADA:		Not Found, R304.2.2	N/A	Shared Landing?	N/A			
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	4.7		X Walk 2 Slope (%)	5.2
				X Walk 1 X Slope (%)	1.8		X Walk 2 X Slope (%)	5.1
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	1.2	N/A	Clear Space?	N/A
				Road X Slope (%)	6.4	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
				Obstruction Type			Storm Grate/Utility Type	
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good
Total Cost:		\$ 3200.00						

Total Cost: \$ 3200.00

