
Access Compliance Report - Public Rights-of-Way (Corridor: Sidewalk & Intersection Items)

Corridor ID: CAPPS-HILL-MINE-RD-062



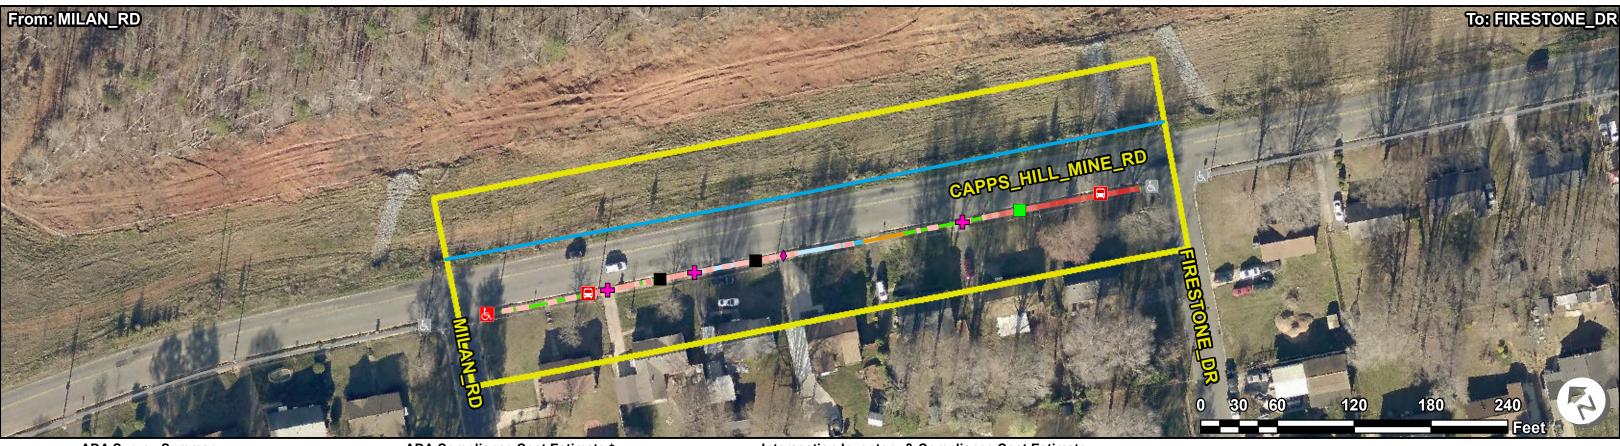

ADA Survey Summary					
Item Description	Quantity				
1 Heavings less than 1"	11 EA				
2 Heavings 1" or greater	0 EA				
3 Uneven Heavings	0 EA				
4 Heaving Clusters	3.552 SY				
5 Sidewalk Joint Gaps 0					
6 Miscellaneous Obstruction	0 EA				
7 Missing Sidewalk Obstruction	0 EA				
8 Other Obstruction	0 EA				
9 Pole Post Hydrant Obstruction	0 EA				
10 Ponding Obstruction	0 EA				
11 Sidewalk Joint Obstruction	0 EA				
12 Sign Obstruction	0 EA				
13 Storm Grate Obstruction	0 EA				
14 Transit Obstruction	0 EA				
15 Traffic Obstruction	0 EA				
16 Tree Obstruction	0 EA				
17 Utility Obstruction	2 EA				
18 Vegetation Obstruction - Low	1 EA				
19 Vegetation Obstruction - Overhead	d 0 EA				
20 Commercial Entrance	0 EA				
21 Residential Entrance	4 EA				
22 Total Sidewalk Length Assessed	469.195 LF				
23 Average Sidewalk Width	48 IN				
24 No Sidewalk on Block (Approx.)	570.309 LF				
25 Missing Sidewalk Gaps (Approx.)	0 LF				
26 Poor Surface Condition (Approx.)	0 LF				
27 Buried Sidewalk (Approx.)	35.287 LF				

ADA Co	mpliance	Cost	Estimate *
--------	----------	------	------------

Item Description		Qua	ntity	Unit Price	lt	em Cost
1_	Heavings less than 1"		6 EA	\$ 100.00	\$	600.00
2	Heavings 1" or greater		0 EA	\$ 400.00	\$	0.00
3	Uneven Heavings		0 EA	\$ 400.00	\$	0.00
4	Heaving Clusters		0 SY	\$ 75.00	\$	0.00
5	Sidewalk Joint Gaps		0 EA	\$ 200.00	\$	0.00
6	Miscellaneous Obstruction		0 EA	\$ 1500.00	\$	0.00
7	Missing Sidewalk Obstruction		0 EA	\$ 200.00	\$	0.00
8	Other Obstruction		0 EA	\$ 500.00	\$	0.00
9	Pole Post Hydrant Obstruction		0 EA	\$ 5000.00	\$	0.00
10	Ponding Obstruction		0 EA	\$ 400.00	\$	0.00
11	Sidewalk Joint Obstruction		0 EA	\$ 100.00	\$	0.00
12	Sign Obstruction		0 EA	\$ 150.00	\$	0.00
13	Storm Grate Obstruction		0 EA	\$700.00	\$	0.00
14	Transit Obstruction		0 EA	\$500.00	\$	0.00
15	Traffic Obstruction		0 EA	\$2000.00	\$	0.00
16	Tree Obstruction		0 EA	\$500.00	\$	0.00
17	Utility Obstruction		2 EA	\$1500.00	\$	3000.00
18	Vegetation Obstruction - Low		1 EA	\$150.00	\$	150.00
19	Vegetation Obstruction - Overhead		0 EA	\$150.00	\$	0.00
20	Commercial Entrance (within slope violation	tion)	0 EA	\$ 5000.00	\$	0.00
21	Residential Entrance (within slope violati	on)	3 EA	\$ 3000.00	\$	9000.00
22	Running Slope Violations**	2.3	97 SY	\$ 75.00	\$	180.00
23	Cross Slope Violations	100.8	376 SY	\$ 75.00	\$	7566.00
24	Running and Cross Slope Violations	33.8	355 SY	\$ 75.00	\$	2539.00
25	Missing Sidewalk Gaps (Approx.)		0 LF	\$ 41.67	\$	0.00
26	Poor Surface Condition (Approx.)		0 LF	\$ 41.67	\$	0.00
27	Buried Sidewalk (Approx.)	35.2	87 LF	\$ 41.67	\$	1540.00
	Sidewalk SubTotal:				\$	23035.00

Intersection Inventory & Compliance Cost Estimate

Item Description	Total Count	Non Compliant Count	Cost
Curb Ramps	1	11_	\$ 1600.00
Island Curb Cuts	0	0	\$ 0.00
Signal Push Buttons	0	0	\$ 0.00
Transit Stops	2	2	\$ 2800.00
Railroad Crossings	0	0	\$ 0.00
Accessible Parking Spa	ces 0	0	\$ 0.00
Intersection SubTotal:		\$	4400.00

Corridor Total: 27435.00

Ł	Curb Ramps - Compliant	ė.	Curb Ramps - Adjacent
 ል	Curb Ramps - Non Compliant		
*	Island Curb Cuts - Compliant	4	Island Curb Cuts - Adjac
*	Island Curb Cuts - Non Compliant		
#	Signals - Compliant	#	Signals - Adjacent
#	Signals - Non Compliant		
	Transit Stops - Compliant		Transit Stops - Adjacent
	Transit Stops - Non Compliant		
©	Railroad Crossings - Compliant	\otimes	Railroad Crossings - Adj

Railroad Crossings - Non Compliant Accessible Parking - Compliant

Accessible Parking - Non Compliant

- Signals Adjacent Transit Stops - Adjacent
- Railroad Crossings Adjacent Accessible Parking - Adjacent

- Heavings < 1" (Excluded)*** Heavings ≥ 1" (Excluded)***
- Uneven Heaving (Excluded)***

- Island Curb Cuts Adjacent

 - - - - No Sidewalk on Block

	,		•
	Uneven Heaving (Excluded)***	•	Uneven Heaving
•	Heaving Clusters (Excluded)		Heaving Clusters
	Sidewalk Joint Gap (Excluded)***	_	Sidewalk Joint Gap
	Miscellaneous Obstruction	•	Commercial Entrance
	Missing Sidewalk Obstruction	♦	Residential Entrance
	Other Obstruction	4	Commercial Entrance (within slope violation)
	Pole Post Hydrant Obstruction	4	Residential Entrance (within slope violation)
	Ponding Obstruction	Cro	ss Slope
	Sidewalk Joint Obstruction		2 - 3% 7.01 - 8%
	Sign Obstruction		3.01 - 4% 8.01 - 9%
	Storm Grate Obstruction		4.01 - 5% 9.01 - 10%
	Transit Obstruction		5.01% - 6% 10.01 - 12%
	Traffic Obstruction		6.01 - 7% > 12%
	Tree Obstruction	Run	ning Slope
	Utility Obstruction		5 - 8.33%
	Vegetation Obstruction - Low		8.34% - 10%
	Vegetation Obstruction - Overhead		10.01 - 12.5%
•	Sidewalk Collection Path		> 12.5%
	Adjacent Sidewalk Collection Path		
	Buried Sidewalk		
٠	Sidewalk Not Surveyed		
-	Missing Sidewalk Gap		
	No Cidovalle on Dlook		

Heavings < 1"

Heavings ≥ 1"

*Note: ADA pedestrian issues have been identified and quantified in the ADA Survey Summary. There are instances where multiple issues can be resolved with a single corrective measure. The ADA Compliance Cost Estimate reflects the best estimation of quantities and cost to resolve all identified ADA issues.

**Note: Additional investigation may be warranted when sidewalk running slope issues exist within the right-of-way.

***Note: Excluded items are violations that occur in areas with slope violations and have been excluded from the cost estimate.