


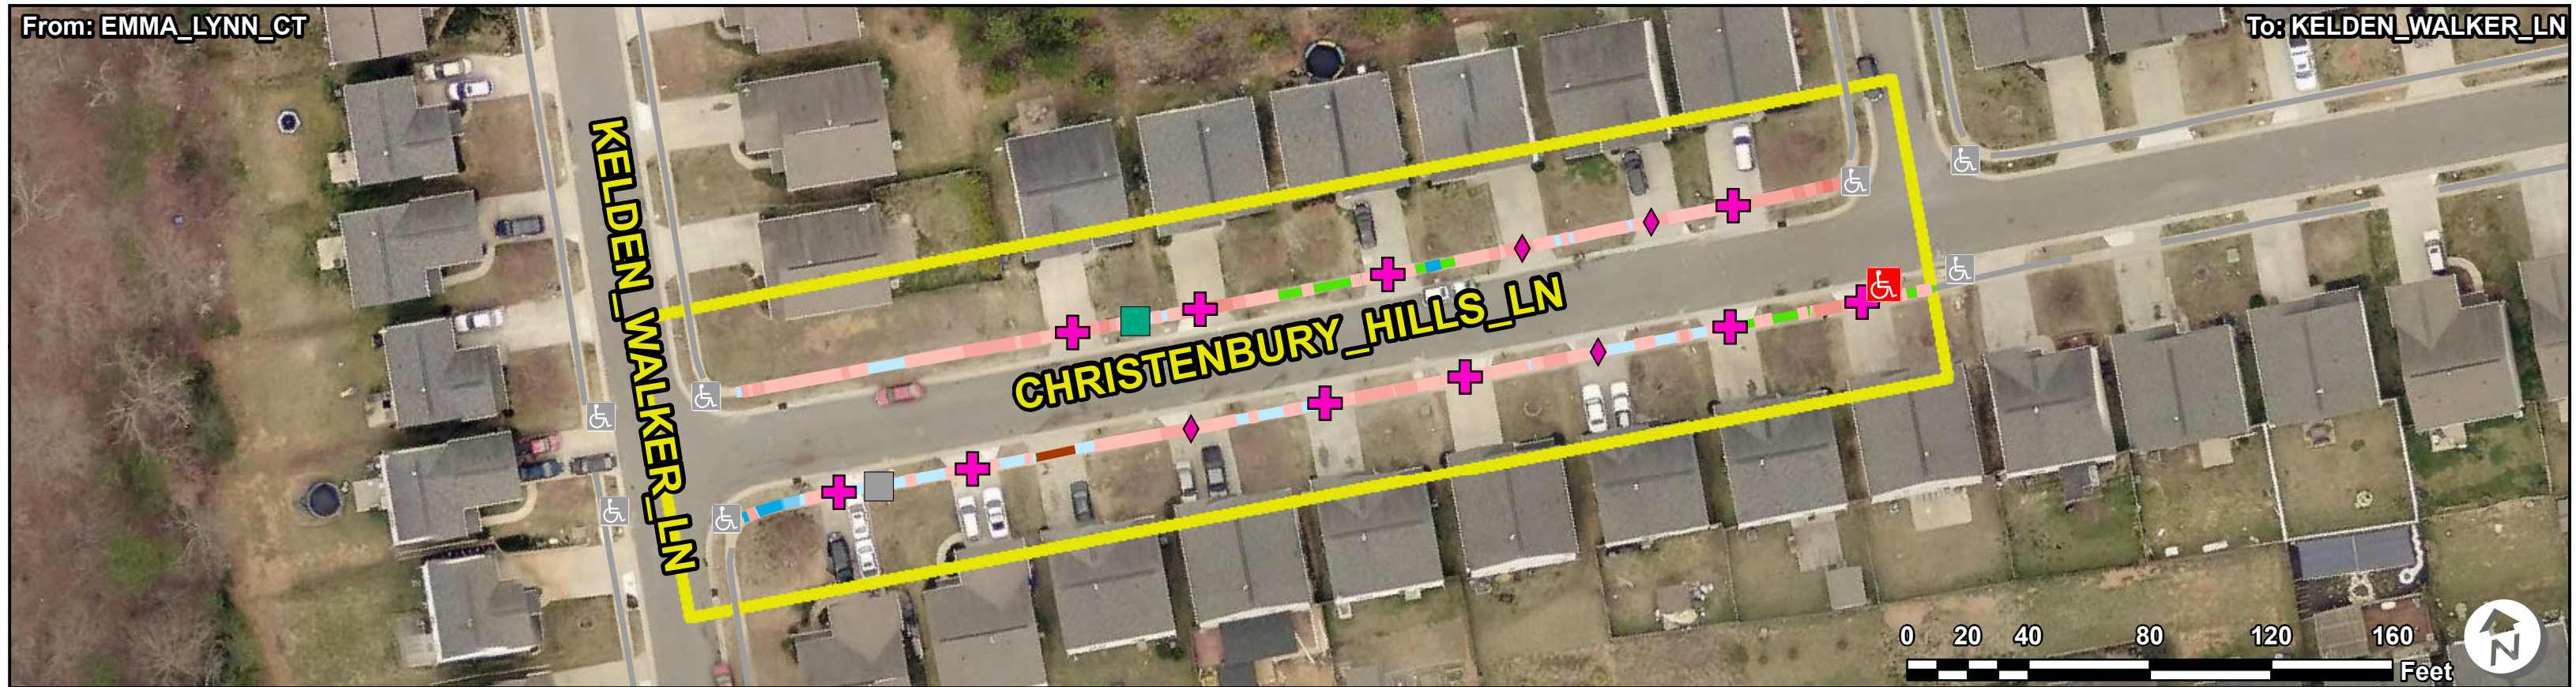

ADA Survey Summary		ADA Compliance Cost Estimate *				Intersection Inventory & Compliance Cost Estimate							
Item Description	Quantity	Item Description	Quantity	Unit Price	Item Cost	Item Description	Total Count	Non Compliant Count	Cost	 Heavings < 1" (Excluded)***	 Heavings < 1"		
1 Heavings less than 1"	11 EA	1 Heavings less than 1"	5 EA	\$ 100.00	\$ 500.00	Curb Ramps	1	1	\$ 1500.00	 Heavings ≥ 1" (Excluded)***	 Heavings ≥ 1"		
2 Heavings 1" or greater	2 EA	2 Heavings 1" or greater	1 EA	\$ 400.00	\$ 400.00	Island Curb Cuts	0	0	\$ 0.00	 Uneven Heaving (Excluded)***	 Uneven Heaving		
3 Uneven Heavings	0 EA	3 Uneven Heavings	0 EA	\$ 400.00	\$ 0.00	Signal Push Buttons	0	0	\$ 0.00	 Heaving Clusters (Excluded)	 Heaving Clusters		
4 Heaving Clusters	17.391 SY	4 Heaving Clusters	12.335 SY	\$ 75.00	\$ 925.00	Transit Stops	0	0	\$ 0.00	 Sidewalk Joint Gap (Excluded)***	 Sidewalk Joint Gap		
5 Sidewalk Joint Gaps	0 EA	5 Sidewalk Joint Gaps	0 EA	\$ 200.00	\$ 0.00	Railroad Crossings	0	0	\$ 0.00	 Miscellaneous Obstruction	 Commercial Entrance		
6 Miscellaneous Obstruction	0 EA	6 Miscellaneous Obstruction	0 EA	\$ 1500.00	\$ 0.00	Accessible Parking Spaces	0	0	\$ 0.00	 Missing Sidewalk Obstruction	 Residential Entrance		
7 Missing Sidewalk Obstruction	0 EA	7 Missing Sidewalk Obstruction	0 EA	\$ 200.00	\$ 0.00	Intersection SubTotal:			\$ 1500.00	 Other Obstruction	 Commercial Entrance (within slope violation)		
8 Other Obstruction	0 EA	8 Other Obstruction	0 EA	\$ 500.00	\$ 0.00	Corridor Total: \$ 46023.00				 Pole Post Hydrant Obstruction	 Residential Entrance (within slope violation)		
9 Pole Post Hydrant Obstruction	0 EA	9 Pole Post Hydrant Obstruction	0 EA	\$ 5000.00	\$ 0.00					Cross Slope			
10 Ponding Obstruction	0 EA	10 Ponding Obstruction	0 EA	\$ 400.00	\$ 0.00	 Sidewalk Joint Obstruction	2 - 3%		 7.01 - 8%				
11 Sidewalk Joint Obstruction	0 EA	11 Sidewalk Joint Obstruction	0 EA	\$ 100.00	\$ 0.00	 Sign Obstruction	3.01 - 4%		 8.01 - 9%				
12 Sign Obstruction	1 EA	12 Sign Obstruction	1 EA	\$ 150.00	\$ 150.00	 Storm Grate Obstruction	4.01 - 5%		 9.01 - 10%				
13 Storm Grate Obstruction	0 EA	13 Storm Grate Obstruction	0 EA	\$700.00	\$ 0.00	 Transit Obstruction	5.01% - 6%		 10.01 - 12%				
14 Transit Obstruction	0 EA	14 Transit Obstruction	0 EA	\$500.00	\$ 0.00	 Traffic Obstruction	6.01 - 7%		 > 12%				
15 Traffic Obstruction	0 EA	15 Traffic Obstruction	0 EA	\$2000.00	\$ 0.00	 Tree Obstruction	Running Slope						
16 Tree Obstruction	0 EA	16 Tree Obstruction	0 EA	\$500.00	\$ 0.00	 Utility Obstruction	5 - 8.33%						
17 Utility Obstruction	0 EA	17 Utility Obstruction	0 EA	\$1500.00	\$ 0.00	 Vegetation Obstruction - Low	8.34% - 10%						
18 Vegetation Obstruction - Low	0 EA	18 Vegetation Obstruction - Low	0 EA	\$150.00	\$ 0.00	 Vegetation Obstruction - Overhead	10.01 - 12.5%						
19 Vegetation Obstruction - Overhead	1 EA	19 Vegetation Obstruction - Overhead	1 EA	\$150.00	\$ 150.00	 Sidewalk Collection Path	> 12.5%						
20 Commercial Entrance	0 EA	20 Commercial Entrance (within slope violation)	0 EA	\$ 5000.00	\$ 0.00	 Adjacent Sidewalk Collection Path							
21 Residential Entrance	14 EA	21 Residential Entrance (within slope violation)	10 EA	\$ 3000.00	\$ 30000.00	 Buried Sidewalk							
22 Total Sidewalk Length Assessed	750.299 LF	22 Running Slope Violations**	0 SY	\$ 75.00	\$ 0.00	 Sidewalk Not Surveyed							
23 Average Sidewalk Width	48 IN	23 Cross Slope Violations	58.272 SY	\$ 75.00	\$ 4370.00	 Missing Sidewalk Gap							
24 No Sidewalk on Block (Approx.)	0 LF	24 Running and Cross Slope Violations	107.03 SY	\$ 75.00	\$ 8027.00	 No Sidewalk on Block							
25 Missing Sidewalk Gaps (Approx.)	0 LF	25 Missing Sidewalk Gaps (Approx.)	0 LF	\$ 41.67	\$ 0.00	*Note: ADA pedestrian issues have been identified and quantified in the ADA Survey Summary. There are instances where multiple issues can be resolved with a single corrective measure. The ADA Compliance Cost Estimate reflects the best estimation of quantities and cost to resolve all identified ADA issues. **Note: Additional investigation may be warranted when sidewalk running slope issues exist within the right-of-way.							
26 Poor Surface Condition (Approx.)	0 LF	26 Poor Surface Condition (Approx.)	0 LF	\$ 41.67	\$ 0.00								
27 Buried Sidewalk (Approx.)	0 LF	27 Buried Sidewalk (Approx.)	0 LF	\$ 41.67	\$ 0.00								
		Sidewalk SubTotal:		\$ 44523.00									