


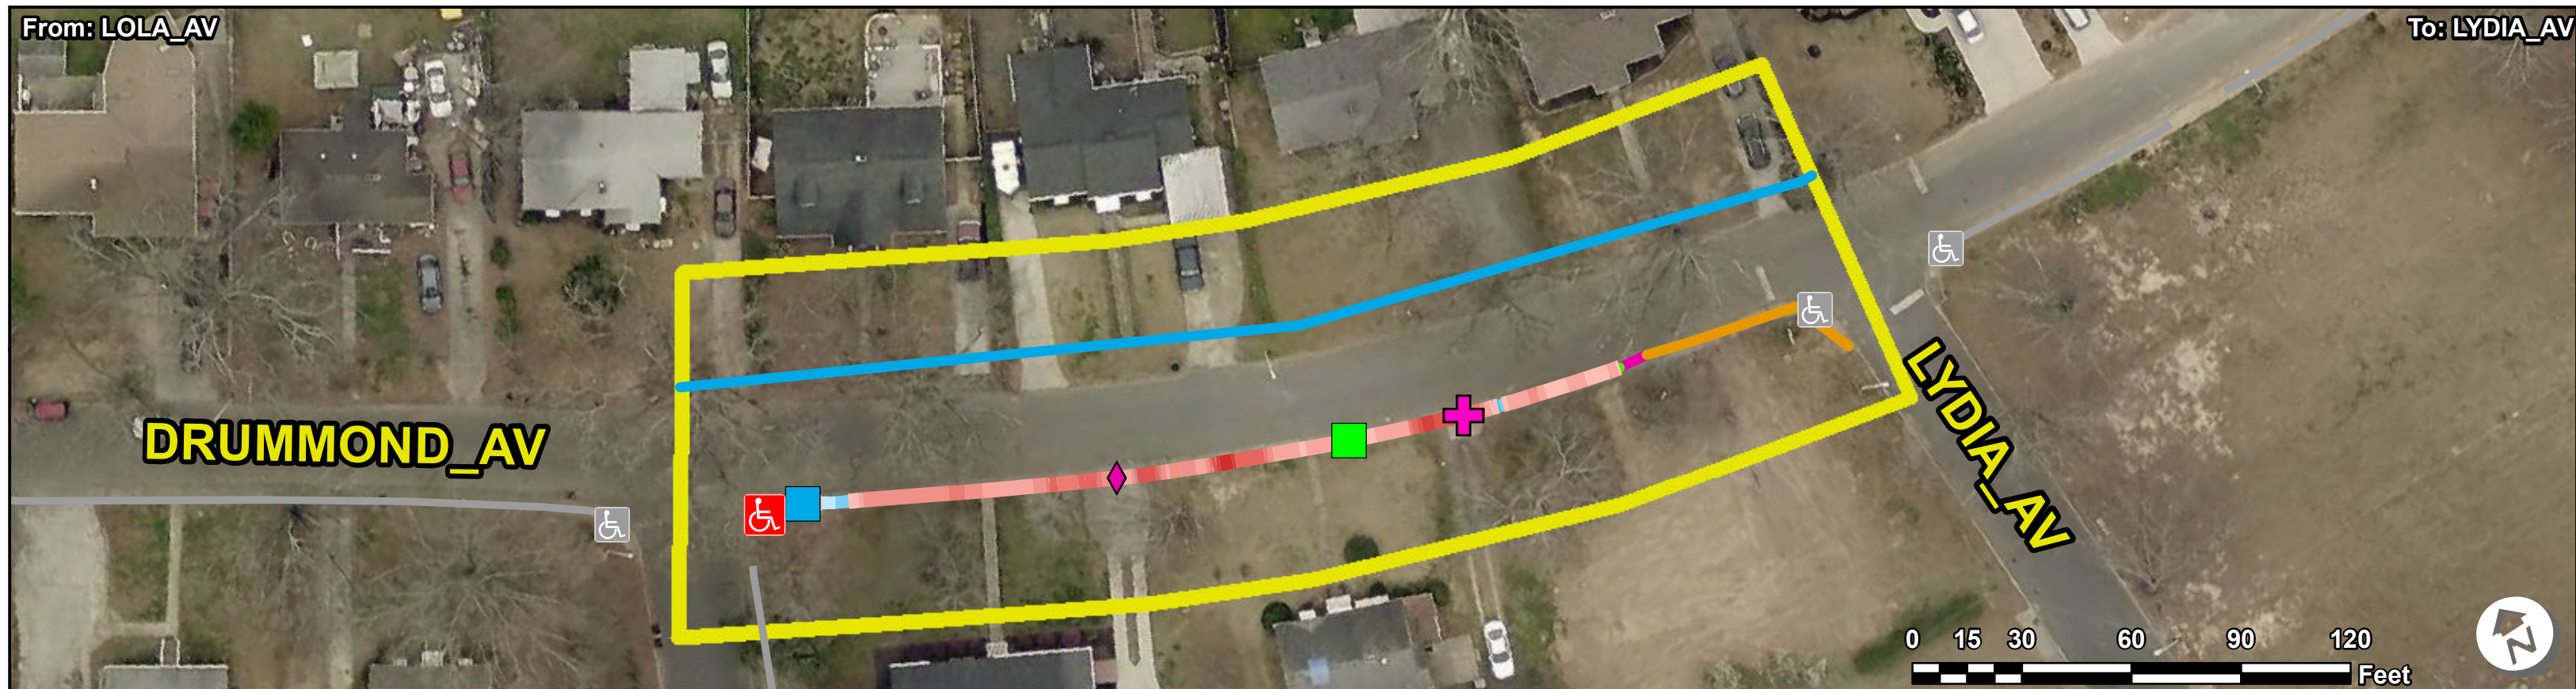

ADA Survey Summary			
Item Description	Quantity	Item Description	Quantity
1 Heavings less than 1"	6 EA	1 Heavings less than 1"	6 EA
2 Heavings 1" or greater	1 EA	2 Heavings 1" or greater	0 EA
3 Uneven Heavings	0 EA	3 Uneven Heavings	0 EA
4 Heaving Clusters	1.406 SY	4 Heaving Clusters	0 SY
5 Sidewalk Joint Gaps	0 EA	5 Sidewalk Joint Gaps	0 EA
6 Miscellaneous Obstruction	0 EA	6 Miscellaneous Obstruction	0 EA
7 Missing Sidewalk Obstruction	0 EA	7 Missing Sidewalk Obstruction	0 EA
8 Other Obstruction	1 EA	8 Other Obstruction	1 EA
9 Pole Post Hydrant Obstruction	0 EA	9 Pole Post Hydrant Obstruction	0 EA
10 Ponding Obstruction	0 EA	10 Ponding Obstruction	0 EA
11 Sidewalk Joint Obstruction	0 EA	11 Sidewalk Joint Obstruction	0 EA
12 Sign Obstruction	0 EA	12 Sign Obstruction	0 EA
13 Storm Grate Obstruction	0 EA	13 Storm Grate Obstruction	0 EA
14 Transit Obstruction	0 EA	14 Transit Obstruction	0 EA
15 Traffic Obstruction	0 EA	15 Traffic Obstruction	0 EA
16 Tree Obstruction	0 EA	16 Tree Obstruction	0 EA
17 Utility Obstruction	0 EA	17 Utility Obstruction	0 EA
18 Vegetation Obstruction - Low	1 EA	18 Vegetation Obstruction - Low	1 EA
19 Vegetation Obstruction - Overhead	0 EA	19 Vegetation Obstruction - Overhead	0 EA
20 Commercial Entrance	0 EA	20 Commercial Entrance (within slope violation)	0 EA
21 Residential Entrance	2 EA	21 Residential Entrance (within slope violation)	1 EA
22 Total Sidewalk Length Assessed	232.73 LF	22 Running Slope Violations**	0 SY
23 Average Sidewalk Width	38 IN	23 Cross Slope Violations	21.738 SY
24 No Sidewalk on Block (Approx.)	316.642 LF	24 Running and Cross Slope Violations	46.105 SY
25 Missing Sidewalk Gaps (Approx.)	8.203 LF	25 Missing Sidewalk Gaps (Approx.)	8.203 LF
26 Poor Surface Condition (Approx.)	0 LF	26 Poor Surface Condition (Approx.)	0 LF
27 Buried Sidewalk (Approx.)	60.926 LF	27 Buried Sidewalk (Approx.)	60.926 LF
		Sidewalk SubTotal:	\$ 9338.00

ADA Compliance Cost Estimate *			
Item Description	Quantity	Unit Price	Item Cost
1 Heavings less than 1"	6 EA	\$ 100.00	\$ 600.00
2 Heavings 1" or greater	0 EA	\$ 400.00	\$ 0.00
3 Uneven Heavings	0 EA	\$ 400.00	\$ 0.00
4 Heaving Clusters	0 SY	\$ 75.00	\$ 0.00
5 Sidewalk Joint Gaps	0 EA	\$ 200.00	\$ 0.00
6 Miscellaneous Obstruction	0 EA	\$ 1500.00	\$ 0.00
7 Missing Sidewalk Obstruction	0 EA	\$ 200.00	\$ 0.00
8 Other Obstruction	1 EA	\$ 500.00	\$ 500.00
9 Pole Post Hydrant Obstruction	0 EA	\$ 5000.00	\$ 0.00
10 Ponding Obstruction	0 EA	\$ 400.00	\$ 0.00
11 Sidewalk Joint Obstruction	0 EA	\$ 100.00	\$ 0.00
12 Sign Obstruction	0 EA	\$ 150.00	\$ 0.00
13 Storm Grate Obstruction	0 EA	\$700.00	\$ 0.00
14 Transit Obstruction	0 EA	\$500.00	\$ 0.00
15 Traffic Obstruction	0 EA	\$2000.00	\$ 0.00
16 Tree Obstruction	0 EA	\$500.00	\$ 0.00
17 Utility Obstruction	0 EA	\$1500.00	\$ 0.00
18 Vegetation Obstruction - Low	1 EA	\$150.00	\$ 150.00
19 Vegetation Obstruction - Overhead	0 EA	\$150.00	\$ 0.00
20 Commercial Entrance (within slope violation)	0 EA	\$ 5000.00	\$ 0.00
21 Residential Entrance (within slope violation)	1 EA	\$ 3000.00	\$ 3000.00
22 Running Slope Violations**	0 SY	\$ 75.00	\$ 0.00
23 Cross Slope Violations	21.738 SY	\$ 75.00	\$ 1630.00
24 Running and Cross Slope Violations	46.105 SY	\$ 75.00	\$ 3458.00
25 Missing Sidewalk Gaps (Approx.)	8.203 LF	\$ 41.67	\$ 440.00
26 Poor Surface Condition (Approx.)	0 LF	\$ 41.67	\$ 0.00
27 Buried Sidewalk (Approx.)	60.926 LF	\$ 41.67	\$ 2640.00
		Sidewalk SubTotal:	\$ 9338.00

Intersection Inventory & Compliance Cost Estimate			
Item Description	Total Count	Non Compliant Count	Cost
Curb Ramps	1	1	\$ 1850.00
Island Curb Cuts	0	0	\$ 0.00
Signal Push Buttons	0	0	\$ 0.00
Transit Stops	0	0	\$ 0.00
Railroad Crossings	0	0	\$ 0.00
Accessible Parking Spaces	0	0	\$ 0.00
Intersection SubTotal:		\$	1850.00

Corridor Total:		\$ 11628.00
------------------------	--	--------------------

Curb Ramps - Compliant

Curb Ramps - Non Compliant

Island Curb Cuts - Compliant

Island Curb Cuts - Non Compliant

Signals - Compliant

Signals - Non Compliant

Transit Stops - Compliant

Transit Stops - Non Compliant

Railroad Crossings - Compliant

Railroad Crossings - Non Compliant

Accessible Parking - Compliant

Accessible Parking - Non Compliant

Curb Ramps - Adjacent

Island Curb Cuts - Adjacent

Signals - Adjacent

Transit Stops - Adjacent

Railroad Crossings - Adjacent

Accessible Parking - Adjacent

Heavings < 1" (Excluded)***

Heavings ≥ 1" (Excluded)***

Uneven Heaving (Excluded)***

Heaving Clusters (Excluded)

Sidewalk Joint Gap (Excluded)***

Miscellaneous Obstruction

Missing Sidewalk Obstruction

Other Obstruction

Pole Post Hydrant Obstruction

Ponding Obstruction

Sidewalk Joint Obstruction

Sign Obstruction

Storm Grate Obstruction

Transit Obstruction

Traffic Obstruction

Tree Obstruction

Utility Obstruction

Vegetation Obstruction - Low

Vegetation Obstruction - Overhead

Sidewalk Collection Path

Adjacent Sidewalk Collection Path

Buried Sidewalk

Sidewalk Not Surveyed

Missing Sidewalk Gap

No Sidewalk on Block

Cross Slope 2 - 3%

Cross Slope 7.01 - 8%

Cross Slope 3.01 - 4%

Cross Slope 8.01 - 9%

Cross Slope 4.01 - 5%

Cross Slope 9.01 - 10%

Cross Slope 5.01% - 6%

Cross Slope 10.01 - 12%

Cross Slope 6.01 - 7%

Cross Slope > 12%

Running Slope 5 - 8.33%

Running Slope 8.34% - 10%

Running Slope 10.01 - 12.5%

Running Slope > 12.5%

*Note: ADA pedestrian issues have been identified and quantified in the ADA Survey Summary. There are instances where multiple issues can