


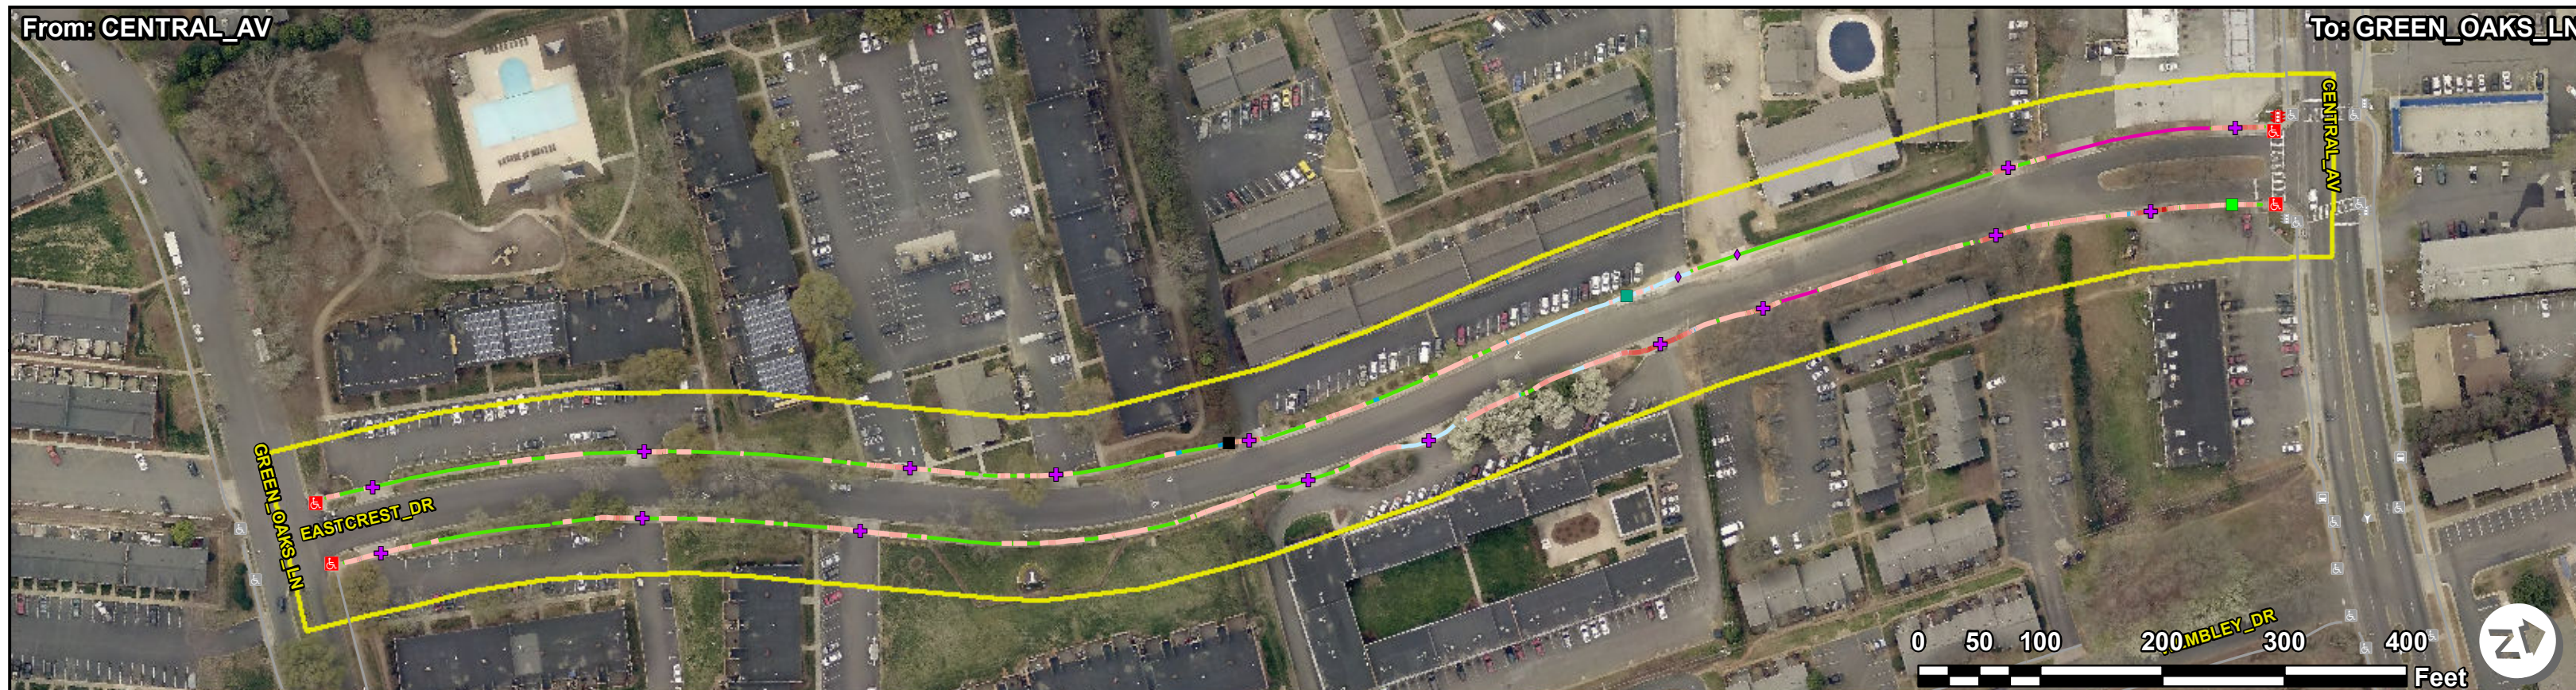

ADA Survey Summary		ADA Compliance Cost Estimate *				Intersection Inventory & Compliance Cost Estimate							
Item Description	Quantity	Item Description	Quantity	Unit Price	Item Cost	Item Description	Total Count	Non Compliant Count	Cost				
1 Heavings less than 1"	13 EA	1 Heavings less than 1"	3 EA	\$ 100.00	\$ 300.00	Curb Ramps	4	4	\$ 10100.00	● Heavings < 1" (Excluded)***	● Heavings < 1"		
2 Heavings 1" or greater	9 EA	2 Heavings 1" or greater	3 EA	\$ 400.00	\$ 1200.00	Island Curb Cuts	0	0	\$ 0.00	● Heavings ≥ 1" (Excluded)***	● Heavings ≥ 1"		
3 Uneven Heavings	0 EA	3 Uneven Heavings	0 EA	\$ 400.00	\$ 0.00	Signal Push Buttons	1	1	\$ 700.00	● Uneven Heaving (Excluded)***	● Uneven Heaving		
4 Heaving Clusters	65.237 SY	4 Heaving Clusters	6.931 SY	\$ 75.00	\$ 520.00	Transit Stops	0	0	\$ 0.00	— Heaving Clusters (Excluded)	— Heaving Clusters		
5 Sidewalk Joint Gaps	0 EA	5 Sidewalk Joint Gaps	0 EA	\$ 200.00	\$ 0.00	Railroad Crossings	0	0	\$ 0.00	▲ Sidewalk Joint Gap (Excluded)***	▲ Sidewalk Joint Gap		
6 Miscellaneous Obstruction	0 EA	6 Miscellaneous Obstruction	0 EA	\$ 1500.00	\$ 0.00	Accessible Parking Spaces	0	0	\$ 0.00	■ Miscellaneous Obstruction	◆ Commercial Entrance		
7 Missing Sidewalk Obstruction	0 EA	7 Missing Sidewalk Obstruction	0 EA	\$ 200.00	\$ 0.00	Intersection SubTotal:			\$ 10800.00	■ Missing Sidewalk Obstruction	◆ Residential Entrance		
8 Other Obstruction	0 EA	8 Other Obstruction	0 EA	\$ 500.00	\$ 0.00					■ Other Obstruction	⊕ Commercial Entrance (within slope violation)		
9 Pole Post Hydrant Obstruction	0 EA	9 Pole Post Hydrant Obstruction	0 EA	\$ 5000.00	\$ 0.00					■ Pole Post Hydrant Obstruction	⊕ Residential Entrance (within slope violation)		
10 Ponding Obstruction	0 EA	10 Ponding Obstruction	0 EA	\$ 400.00	\$ 0.00					■ Ponding Obstruction			
11 Sidewalk Joint Obstruction	0 EA	11 Sidewalk Joint Obstruction	0 EA	\$ 100.00	\$ 0.00					■ Sidewalk Joint Obstruction			
12 Sign Obstruction	0 EA	12 Sign Obstruction	0 EA	\$ 150.00	\$ 0.00					■ Sign Obstruction			
13 Storm Grate Obstruction	0 EA	13 Storm Grate Obstruction	0 EA	\$ 700.00	\$ 0.00					■ Storm Grate Obstruction			
14 Transit Obstruction	0 EA	14 Transit Obstruction	0 EA	\$ 500.00	\$ 0.00					■ Transit Obstruction			
15 Traffic Obstruction	0 EA	15 Traffic Obstruction	0 EA	\$ 2000.00	\$ 0.00					■ Traffic Obstruction			
16 Tree Obstruction	0 EA	16 Tree Obstruction	0 EA	\$ 500.00	\$ 0.00					■ Tree Obstruction			
17 Utility Obstruction	1 EA	17 Utility Obstruction	1 EA	\$ 1500.00	\$ 1500.00					■ Utility Obstruction			
18 Vegetation Obstruction - Low	1 EA	18 Vegetation Obstruction - Low	1 EA	\$ 150.00	\$ 150.00					■ Vegetation Obstruction - Low			
19 Vegetation Obstruction - Overhead	1 EA	19 Vegetation Obstruction - Overhead	1 EA	\$ 150.00	\$ 150.00					■ Vegetation Obstruction - Overhead			
20 Commercial Entrance	18 EA	20 Commercial Entrance (within slope violation)	16 EA	\$ 5000.00	\$ 80000.00					— Sidewalk Collection Path			
21 Residential Entrance	0 EA	21 Residential Entrance (within slope violation)	0 EA	\$ 3000.00	\$ 0.00					— Adjacent Sidewalk Collection Path			
22 Total Sidewalk Length Assessed	3049.469 LF	22 Running Slope Violations**	10.47 SY	\$ 75.00	\$ 785.00					— Buried Sidewalk			
23 Average Sidewalk Width	59.143 IN	23 Cross Slope Violations	539.338 SY	\$ 75.00	\$ 40450.00					— Sidewalk Not Surveyed			
24 No Sidewalk on Block (Approx.)	0 LF	24 Running and Cross Slope Violations	110.172 SY	\$ 75.00	\$ 8263.00					— Missing Sidewalk Gap			
25 Missing Sidewalk Gaps (Approx.)	172.249 LF	25 Missing Sidewalk Gaps (Approx.)	172.249 LF	\$ 41.67	\$ 7260.00					— No Sidewalk on Block			
26 Poor Surface Condition (Approx.)	0 LF	26 Poor Surface Condition (Approx.)	0 LF	\$ 41.67	\$ 0.00								
27 Buried Sidewalk (Approx.)	0 LF	27 Buried Sidewalk (Approx.)	0 LF	\$ 41.67	\$ 0.00								
		Sidewalk SubTotal:			\$ 133318.00								

*Note: ADA pedestrian issues have been identified and quantified in the ADA Survey Summary. There are instances where multiple issues can be resolved with a single corrective measure. The ADA Compliance Cost Estimate reflects the best estimation of quantities and cost to resolve all identified ADA issues.

**Note: Additional investigation may be warranted when sidewalk running slope issues exist within the right-of-way.