


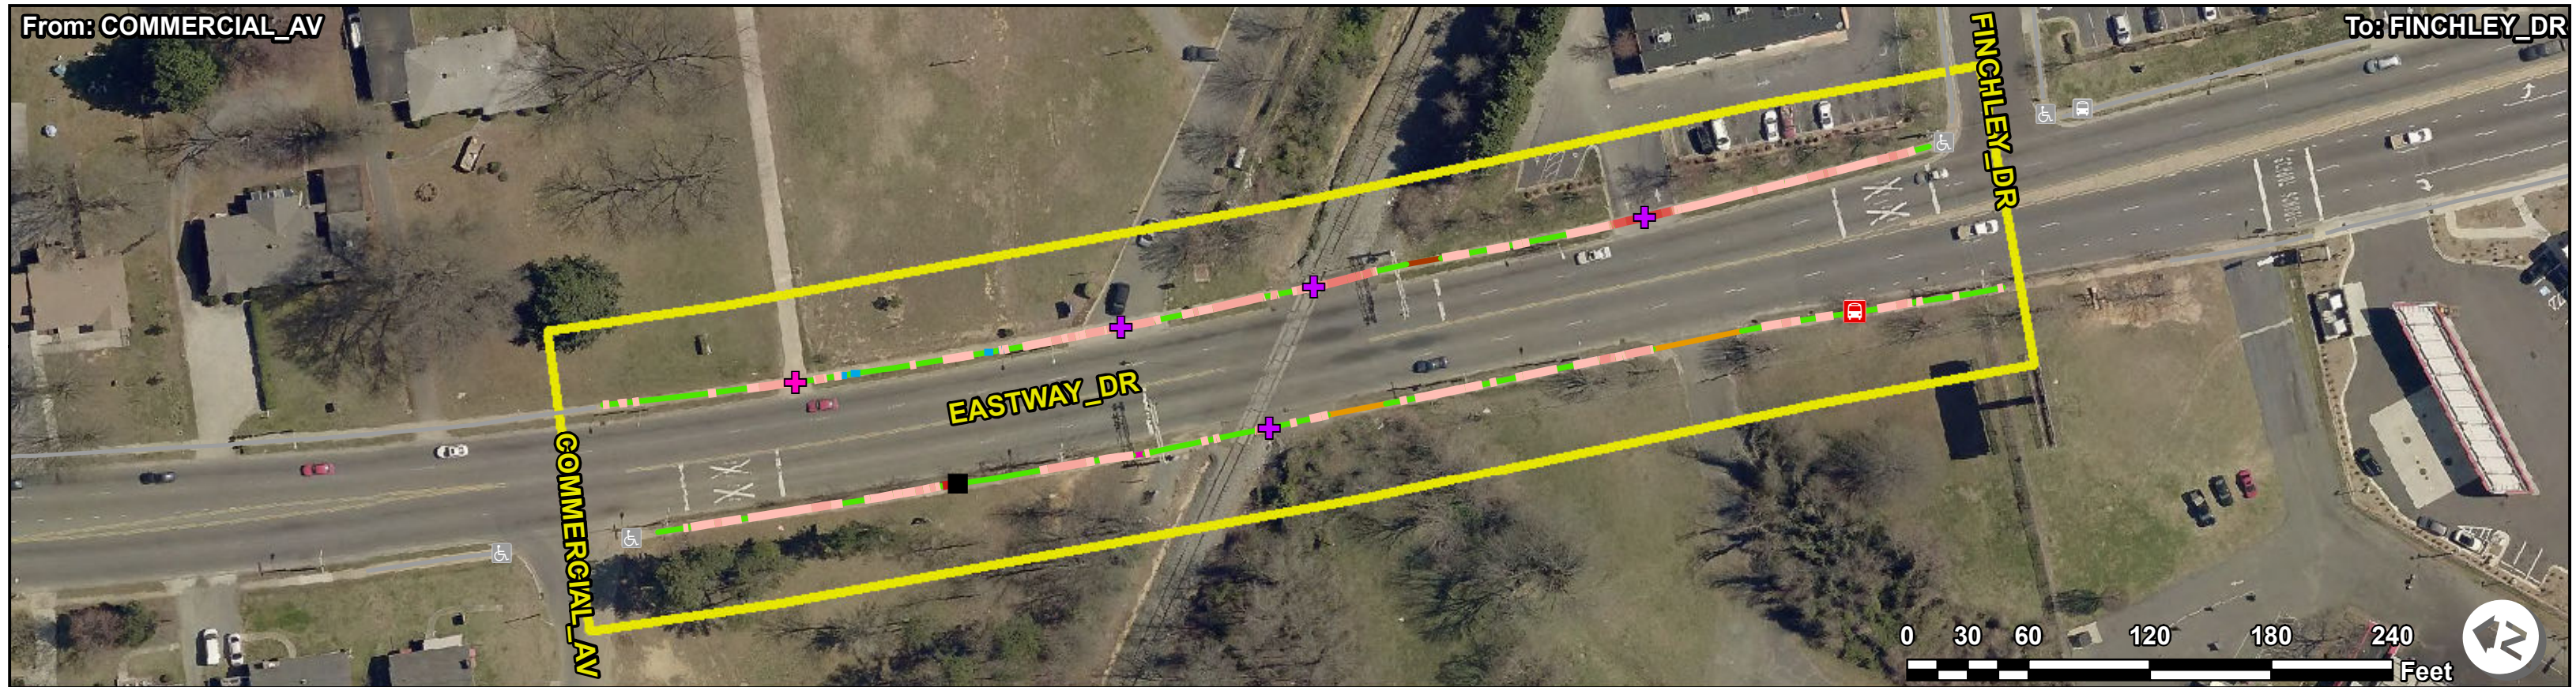

ADA Survey Summary		ADA Compliance Cost Estimate *				Intersection Inventory & Compliance Cost Estimate									
Item	Description	Quantity	Item	Description	Quantity	Unit Price	Item Cost	Item	Description	Total Count	Non Compliant Count	Cost			
1	Heavings less than 1"	17 EA	1	Heavings less than 1"	3 EA	\$ 100.00	\$ 300.00	Curb Ramps		0	0	\$ 0.00	● Heavings < 1" (Excluded)***	● Heavings < 1"	
2	Heavings 1" or greater	2 EA	2	Heavings 1" or greater	1 EA	\$ 400.00	\$ 400.00	Island Curb Cuts		0	0	\$ 0.00	● Heavings ≥ 1" (Excluded)***	● Heavings ≥ 1"	
3	Uneven Heavings	0 EA	3	Uneven Heavings	0 EA	\$ 400.00	\$ 0.00	Signal Push Buttons		0	0	\$ 0.00	● Uneven Heaving (Excluded)***	● Uneven Heaving	
4	Heaving Clusters	35.689 SY	4	Heaving Clusters	0 SY	\$ 75.00	\$ 0.00	Transit Stops		1	1	\$ 1400.00	— Heaving Clusters (Excluded)	— Heaving Clusters	
5	Sidewalk Joint Gaps	0 EA	5	Sidewalk Joint Gaps	0 EA	\$ 200.00	\$ 0.00	Railroad Crossings		0	0	\$ 0.00	▲ Sidewalk Joint Gap (Excluded)***	▲ Sidewalk Joint Gap	
6	Miscellaneous Obstruction	0 EA	6	Miscellaneous Obstruction	0 EA	\$ 1500.00	\$ 0.00	Accessible Parking Spaces		0	0	\$ 0.00	■ Miscellaneous Obstruction	◆ Commercial Entrance	
7	Missing Sidewalk Obstruction	0 EA	7	Missing Sidewalk Obstruction	0 EA	\$ 200.00	\$ 0.00	Intersection SubTotal:			\$ 1400.00	■ Missing Sidewalk Obstruction	◆ Residential Entrance		
8	Other Obstruction	0 EA	8	Other Obstruction	0 EA	\$ 500.00	\$ 0.00						■ Other Obstruction	✚ Commercial Entrance (within slope violation)	
9	Pole Post Hydrant Obstruction	0 EA	9	Pole Post Hydrant Obstruction	0 EA	\$ 5000.00	\$ 0.00						■ Pole Post Hydrant Obstruction	✚ Residential Entrance (within slope violation)	
10	Ponding Obstruction	0 EA	10	Ponding Obstruction	0 EA	\$ 400.00	\$ 0.00						■ Ponding Obstruction		
11	Sidewalk Joint Obstruction	0 EA	11	Sidewalk Joint Obstruction	0 EA	\$ 100.00	\$ 0.00						■ Sidewalk Joint Obstruction	Cross Slope	
12	Sign Obstruction	0 EA	12	Sign Obstruction	0 EA	\$ 150.00	\$ 0.00						■ Sign Obstruction	2 - 3%	7.01 - 8%
13	Storm Grate Obstruction	0 EA	13	Storm Grate Obstruction	0 EA	\$700.00	\$ 0.00						■ Storm Grate Obstruction	3.01 - 4%	8.01 - 9%
14	Transit Obstruction	0 EA	14	Transit Obstruction	0 EA	\$500.00	\$ 0.00						■ Transit Obstruction	4.01 - 5%	9.01 - 10%
15	Traffic Obstruction	0 EA	15	Traffic Obstruction	0 EA	\$2000.00	\$ 0.00						■ Traffic Obstruction	5.01% - 6%	10.01 - 12%
16	Tree Obstruction	0 EA	16	Tree Obstruction	0 EA	\$500.00	\$ 0.00						■ Tree Obstruction	6.01 - 7%	> 12%
17	Utility Obstruction	1 EA	17	Utility Obstruction	1 EA	\$1500.00	\$ 1500.00						■ Utility Obstruction	Running Slope	
18	Vegetation Obstruction - Low	0 EA	18	Vegetation Obstruction - Low	0 EA	\$150.00	\$ 0.00						■ Vegetation Obstruction - Low	5 - 8.33%	
19	Vegetation Obstruction - Overhead	0 EA	19	Vegetation Obstruction - Overhead	0 EA	\$150.00	\$ 0.00						■ Vegetation Obstruction - Overhead	8.34% - 10%	
20	Commercial Entrance	4 EA	20	Commercial Entrance (within slope violation)	4 EA	\$ 5000.00	\$ 20000.00						— Sidewalk Collection Path	10.01 - 12.5%	
21	Residential Entrance	1 EA	21	Residential Entrance (within slope violation)	1 EA	\$ 3000.00	\$ 3000.00						— Adjacent Sidewalk Collection Path	> 12.5%	
22	Total Sidewalk Length Assessed	1246.148 LF	22	Running Slope Violations**	1.999 SY	\$ 75.00	\$ 150.00						— Buried Sidewalk		
23	Average Sidewalk Width	60 IN	23	Cross Slope Violations	362.919 SY	\$ 75.00	\$ 27219.00						— Sidewalk Not Surveyed		
24	No Sidewalk on Block (Approx.)	0 LF	24	Running and Cross Slope Violations	0.555 SY	\$ 75.00	\$ 42.00						— Missing Sidewalk Gap		
25	Missing Sidewalk Gaps (Approx.)	5.886 LF	25	Missing Sidewalk Gaps (Approx.)	5.886 LF	\$ 41.67	\$ 220.00						— No Sidewalk on Block		
26	Poor Surface Condition (Approx.)	17.167 LF	26	Poor Surface Condition (Approx.)	17.167 LF	\$ 41.67	\$ 660.00								
27	Buried Sidewalk (Approx.)	73.784 LF	27	Buried Sidewalk (Approx.)	73.784 LF	\$ 41.67	\$ 3080.00								
				Sidewalk SubTotal:			\$ 53270.00								
										Corridor Total:		\$ 54890.00			