


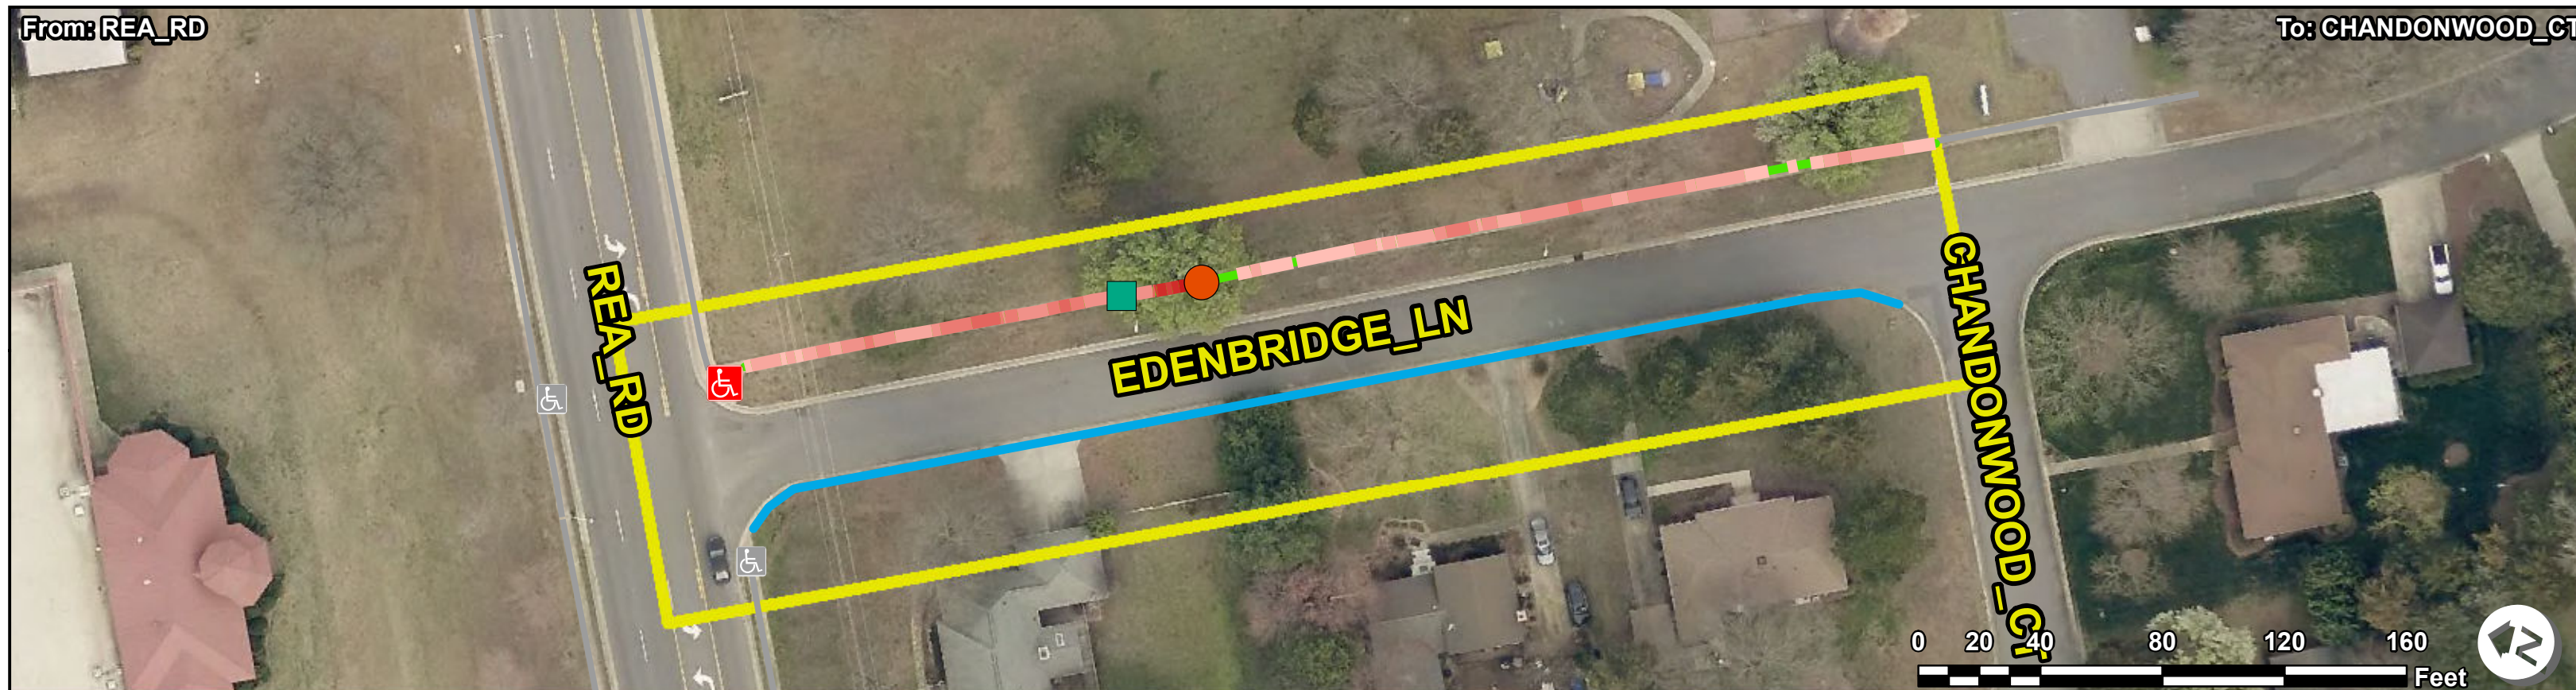

ADA Survey Summary			ADA Compliance Cost Estimate *				Intersection Inventory & Compliance Cost Estimate									
Item Description	Quantity		Item Description	Quantity	Unit Price	Item Cost	Item Description	Total Count	Non Compliant Count	Cost						
1 Heavings less than 1"	4 EA		1 Heavings less than 1"	0 EA	\$ 100.00	\$ 0.00	Curb Ramps	1	1	\$ 3200.00		Heavings < 1" (Excluded)***		Heavings < 1"		
2 Heavings 1" or greater	0 EA		2 Heavings 1" or greater	0 EA	\$ 400.00	\$ 0.00	Island Curb Cuts	0	0	\$ 0.00		Heavings ≥ 1" (Excluded)***		Heavings ≥ 1"		
3 Uneven Heavings	1 EA		3 Uneven Heavings	1 EA	\$ 400.00	\$ 400.00	Signal Push Buttons	0	0	\$ 0.00		Uneven Heaving (Excluded)***		Uneven Heaving		
4 Heaving Clusters	1.776 SY		4 Heaving Clusters	0 SY	\$ 75.00	\$ 0.00	Transit Stops	0	0	\$ 0.00		Heaving Clusters (Excluded)		Heaving Clusters		
5 Sidewalk Joint Gaps	0 EA		5 Sidewalk Joint Gaps	0 EA	\$ 200.00	\$ 0.00	Transit Stops	0	0	\$ 0.00		Sidewalk Joint Gap (Excluded)***		Sidewalk Joint Gap		
6 Miscellaneous Obstruction	0 EA		6 Miscellaneous Obstruction	0 EA	\$ 1500.00	\$ 0.00	Railroad Crossings	0	0	\$ 0.00		Miscellaneous Obstruction		Commercial Entrance		
7 Missing Sidewalk Obstruction	0 EA		7 Missing Sidewalk Obstruction	0 EA	\$ 200.00	\$ 0.00	Accessible Parking Spaces	0	0	\$ 0.00		Missing Sidewalk Obstruction		Residential Entrance		
8 Other Obstruction	0 EA		8 Other Obstruction	0 EA	\$ 500.00	\$ 0.00	Intersection SubTotal:			\$ 3200.00		Other Obstruction		Commercial Entrance (within slope violation)		
9 Pole Post Hydrant Obstruction	0 EA		9 Pole Post Hydrant Obstruction	0 EA	\$ 5000.00	\$ 0.00						Pole Post Hydrant Obstruction		Residential Entrance (within slope violation)		
10 Ponding Obstruction	0 EA		10 Ponding Obstruction	0 EA	\$ 400.00	\$ 0.00						Ponding Obstruction		Cross Slope		
11 Sidewalk Joint Obstruction	0 EA		11 Sidewalk Joint Obstruction	0 EA	\$ 100.00	\$ 0.00						Sidewalk Joint Obstruction		2 - 3%		7.01 - 8%
12 Sign Obstruction	0 EA		12 Sign Obstruction	0 EA	\$ 150.00	\$ 0.00						Sign Obstruction		3.01 - 4%		8.01 - 9%
13 Storm Grate Obstruction	0 EA		13 Storm Grate Obstruction	0 EA	\$700.00	\$ 0.00						Storm Grate Obstruction		4.01 - 5%		9.01 - 10%
14 Transit Obstruction	0 EA		14 Transit Obstruction	0 EA	\$500.00	\$ 0.00						Transit Obstruction		5.01% - 6%		10.01 - 12%
15 Traffic Obstruction	0 EA		15 Traffic Obstruction	0 EA	\$2000.00	\$ 0.00						Traffic Obstruction		6.01 - 7%		> 12%
16 Tree Obstruction	0 EA		16 Tree Obstruction	0 EA	\$500.00	\$ 0.00						Tree Obstruction		Running Slope		
17 Utility Obstruction	0 EA		17 Utility Obstruction	0 EA	\$1500.00	\$ 0.00						Utility Obstruction		5 - 8.33%		
18 Vegetation Obstruction - Low	0 EA		18 Vegetation Obstruction - Low	0 EA	\$150.00	\$ 0.00						Vegetation Obstruction - Low		8.34% - 10%		
19 Vegetation Obstruction - Overhead	1 EA		19 Vegetation Obstruction - Overhead	1 EA	\$150.00	\$ 150.00						Vegetation Obstruction - Overhead		10.01 - 12.5%		
20 Commercial Entrance	0 EA		20 Commercial Entrance (within slope violation)	0 EA	\$ 5000.00	\$ 0.00						Sidewalk Collection Path		> 12.5%		
21 Residential Entrance	0 EA		21 Residential Entrance (within slope violation)	0 EA	\$ 3000.00	\$ 0.00						Adjacent Sidewalk Collection Path				
22 Total Sidewalk Length Assessed	395.575 LF		22 Running Slope Violations**	0 SY	\$ 75.00	\$ 0.00						Buried Sidewalk				
23 Average Sidewalk Width	48 IN		23 Cross Slope Violations	164.13 SY	\$ 75.00	\$ 12310.00						Sidewalk Not Surveyed				
24 No Sidewalk on Block (Approx.)	387.187 LF		24 Running and Cross Slope Violations	0 SY	\$ 75.00	\$ 0.00						Missing Sidewalk Gap				
25 Missing Sidewalk Gaps (Approx.)	0 LF		25 Missing Sidewalk Gaps (Approx.)	0 LF	\$ 41.67	\$ 0.00						No Sidewalk on Block				
26 Poor Surface Condition (Approx.)	0 LF		26 Poor Surface Condition (Approx.)	0 LF	\$ 41.67	\$ 0.00										
27 Buried Sidewalk (Approx.)	0 LF		27 Buried Sidewalk (Approx.)	0 LF	\$ 41.67	\$ 0.00										
			Sidewalk SubTotal:			\$ 12860.00										

Corridor Total:

\$ 16060.00

Curb Ramps - Compliant

Curb Ramps - Non Compliant

Island Curb Cuts - Compliant

Island Curb Cuts - Non Compliant

Signals - Compliant

Signals - Non Compliant

Transit Stops - Compliant

Transit Stops - Non Compliant

Railroad Crossings - Compliant

Railroad Crossings - Non Compliant

Accessible Parking - Compliant

Accessible Parking - Non Compliant

Curb Ramps - Adjacent

Island Curb Cuts - Adjacent

Signals - Adjacent

Transit Stops - Adjacent

Railroad Crossings - Adjacent

Accessible Parking - Adjacent

Heavings < 1" (Excluded)***

Heavings ≥ 1" (Excluded)***

Uneven Heaving (Excluded)***

Heaving Clusters (Excluded)

Sidewalk Joint Gap (Excluded)***

Miscellaneous Obstruction

Missing Sidewalk Obstruction

Other Obstruction

Pole Post Hydrant Obstruction

Ponding Obstruction

Sidewalk Joint Obstruction

Sign Obstruction

Storm Grate Obstruction

Transit Obstruction

Traffic Obstruction

Tree Obstruction

Utility Obstruction

Vegetation Obstruction - Low

Vegetation Obstruction - Overhead

Sidewalk Collection Path

Adjacent Sidewalk Collection Path

Buried Sidewalk

Sidewalk Not Surveyed

Missing Sidewalk Gap

No Sidewalk on Block

Heavings < 1"

Heavings ≥ 1"

Uneven Heaving

Heaving Clusters

Sidewalk Joint Gap

Commercial Entrance

Residential Entrance

Commercial Entrance (within slope violation)

Residential Entrance (within slope violation)

Cross Slope

2 - 3%

7.01 - 8%

3.01 - 4%

8.01 - 9%

4.01 - 5%

9.01 - 10%

5.01% - 6%

10.01 - 12%

6.01 - 7%

> 12%

Running Slope

5 - 8.33%

8.34% - 10%

10.01 - 12.5%

> 12.5%

*Note: ADA pedestrian issues have been identified and quantified in the ADA Survey Summary. There are instances where multiple issues can be resolved with a single corrective measure. The ADA Compliance Cost Estimate reflects the best estimation of quantities and cost to resolve all identified ADA issues.

**Note: Additional investigation may be warranted when sidewalk running slope issues exist within the right-of-way.

***Note: Excluded items are violations that occur in areas with slope violations and have been excluded from the cost estimate.