
Access Compliance Report - Public Rights-of-Way (Corridor: Sidewalk & Intersection Items)

Corridor ID: GOLF-LINKS-DR-109



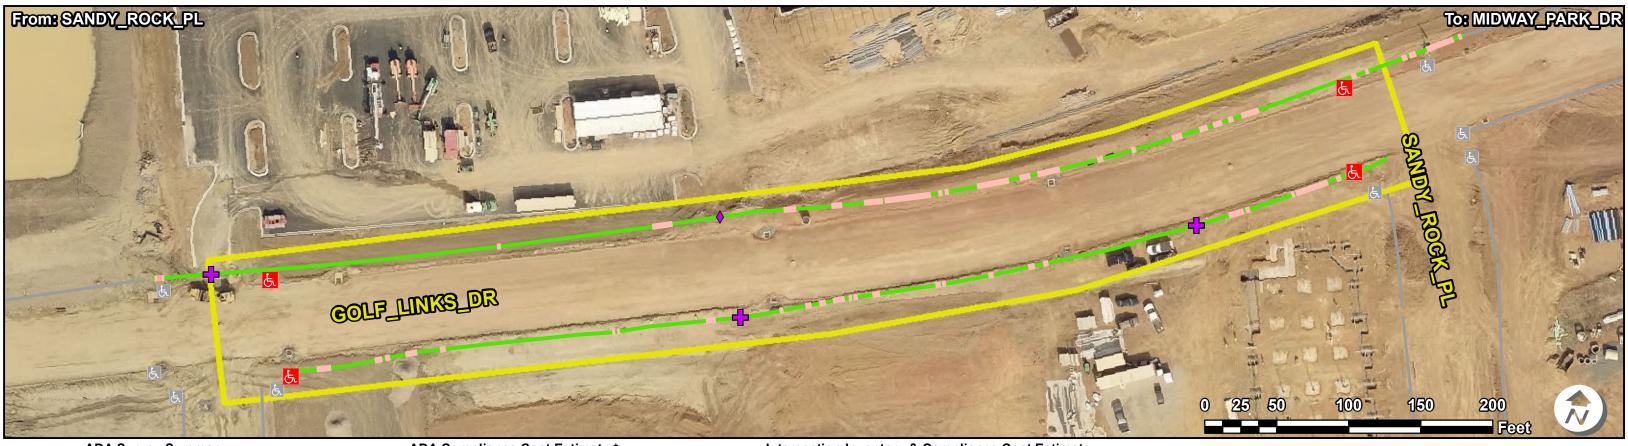

ADA Survey Summary			
Item Description	Quantity		
1 Heavings less than 1"	5 EA		
2 Heavings 1" or greater	0 EA		
3 Uneven Heavings	0 EA		
4 Heaving Clusters	3.564 SY		
5 Sidewalk Joint Gaps	0 EA		
6 Miscellaneous Obstruction	0 EA		
7 Missing Sidewalk Obstruction	0 EA		
8 Other Obstruction	0 EA		
9 Pole Post Hydrant Obstruction	0 EA		
10 Ponding Obstruction	0 EA		
11 Sidewalk Joint Obstruction	0 EA		
12 Sign Obstruction	0 EA		
13 Storm Grate Obstruction	0 EA		
14 Transit Obstruction	0 EA		
15 Traffic Obstruction	0 EA		
16 Tree Obstruction	0 EA		
17 Utility Obstruction	0 EA		
18 Vegetation Obstruction - Low	0 EA		
19 Vegetation Obstruction - Overhead	0 EA		
20 Commercial Entrance	4 EA		
21 Residential Entrance	0 EA		
22 Total Sidewalk Length Assessed 17	02.583 LF		
23 Average Sidewalk Width	96 IN		
24 No Sidewalk on Block (Approx.)	0 LF		
25 Missing Sidewalk Gaps (Approx.)	0 LF		
26 Poor Surface Condition (Approx.)	0 LF		
27 Buried Sidewalk (Approx.)	0 LF		

ADA Compliance Cost Estimate *					
Item Description	Quantity	ntity Unit Price		em Cost	
1 Heavings less than 1"	3 EA	\$ 100.00	\$	300.00	
2 Heavings 1" or greater	0 EA	\$ 400.00	\$	0.00	
3 Uneven Heavings	0 EA	\$ 400.00	\$	0.00	
4 Heaving Clusters	0 SY	\$ 75.00	\$	0.00	
5 Sidewalk Joint Gaps	0 EA	\$ 200.00	\$	0.00	
6 Miscellaneous Obstruction	0 EA	\$ 1500.00	\$	0.00	
7 Missing Sidewalk Obstruction	0 EA	\$ 200.00	\$	0.00	
8 Other Obstruction	0 EA	\$ 500.00	\$	0.00	
9 Pole Post Hydrant Obstruction	0 EA	\$ 5000.00	\$	0.00	
10 Ponding Obstruction	0 EA	\$ 400.00	\$	0.00	
11 Sidewalk Joint Obstruction	0 EA	\$ 100.00	\$	0.00	
12 Sign Obstruction	0 EA	\$ 150.00	\$	0.00	
13 Storm Grate Obstruction	0 EA	\$700.00	\$	0.00	
14 Transit Obstruction	0 EA	\$500.00	\$	0.00	
15 Traffic Obstruction	0 EA	\$2000.00	\$	0.00	
16 Tree Obstruction	0 EA	\$500.00	\$	0.00	
17 Utility Obstruction	0 EA	\$1500.00	\$	0.00	
18 Vegetation Obstruction - Low	0 EA	\$150.00	\$	0.00	
19 Vegetation Obstruction - Overhead	0 EA	\$150.00	\$	0.00	
20 Commercial Entrance (within slope viola	tion) 3 EA	\$ 5000.00	\$	15000.00	
21 Residential Entrance (within slope violate	ion) 0 EA	\$ 3000.00	\$	0.00	
22 Running Slope Violations**	0 SY	\$ 75.00	\$	0.00	
23 Cross Slope Violations	316.366 SY	\$ 75.00	\$	23727.00	
24 Running and Cross Slope Violations	0 SY	\$ 75.00	\$	0.00	
25 Missing Sidewalk Gaps (Approx.)	0 LF	\$ 41.67	\$	0.00	
26 Poor Surface Condition (Approx.)	0 LF	\$ 41.67	\$	0.00	
27 Buried Sidewalk (Approx.)	0 LF	\$ 41.67	\$	0.00	
Sidewalk SubTotal:			\$	39027.00	

Description	Total Count	Non Compliant Count		Co	
Ramps	4	4	\$	7150	
d Curb Cuts	0	0	\$	0	

Corridor Total:

- Curb Ramps Compliant Curb Ramps - Non Compliant
- Island Curb Cuts Compliant
- Island Curb Cuts Non Compliant
- Signals Compliant
- § Signals Non Compliant Transit Stops - Compliant
- Transit Stops Non Compliant
- Railroad Crossings Compliant
- Railroad Crossings Non Compliant
- Accessible Parking Compliant
- Accessible Parking Non Compliant

Intersection Inventory & Compliance Cost Estimate

Item Description	Total Count	Non Compliant Count	Cost	
Curb Ramps	4	4	\$ 7150.00	
Island Curb Cuts	0	0	\$ 0.00	
Signal Push Buttons	0	0	\$ 0.00	•
Transit Stops	0	0	\$ 0.00	
Railroad Crossings	0	0	\$ 0.00	
Accessible Parking Space	ces 0	0	\$ 0.00	
Intersection SubTotal:		\$	7150.00	

46177.00

- Curb Ramps Adjacent
- Island Curb Cuts Adjacent
 - Signals Adjacent
 - □ Transit Stops Adjacent
 - Railroad Crossings Adjacent
 - Accessible Parking Adjacent

Heavings < 1" (Excluded)***

Heavings < 1"

Heavings ≥ 1"

Uneven Heaving

Heaving Clusters

Sidewalk Joint Gap

Commercial Entrance

Residential Entrance

5.01% - 6% 10.01 - 12%

Cross Slope

3.01 - 4%

4.01 - 5%

6.01 - 7%

> 12.5%

Running Slope

5 - 8.33%

8.34% - 10%

10.01 - 12.5%

2 - 3%

Commercial Entrance (within slope violation) Residential Entrance (within slope violation)

7.01 - 8%

8.01 - 9%

9.01 - 10%

> 12%

- Heavings ≥ 1" (Excluded)***
- Uneven Heaving (Excluded)***
- Heaving Clusters (Excluded)
- Sidewalk Joint Gap (Excluded)***
- Miscellaneous Obstruction
- Missing Sidewalk Obstruction
- Other Obstruction
- Pole Post Hydrant Obstruction
- Ponding Obstruction
- Sidewalk Joint Obstruction Sign Obstruction
- Storm Grate Obstruction
- Transit Obstruction
 - Traffic Obstruction
 - Tree Obstruction
 - **Utility Obstruction**
 - Vegetation Obstruction Low
 - Vegetation Obstruction Overhead
 - Sidewalk Collection Path
 - Adjacent Sidewalk Collection Path
 - **Buried Sidewalk**

 - Sidewalk Not Surveyed
 - Missing Sidewalk Gap
 - No Sidewalk on Block
- *Note: ADA pedestrian issues have been identified and quantified in the ADA Survey Summary. There are instances where multiple issues can be resolved with a single corrective measure. The ADA Compliance Cost Estimate reflects the best estimation of quantities and cost to resolve all identified ADA issues. **Note: Additional investigation may be warranted when sidewalk running slope issues exist within the right-of-way.

 ***Note: Excluded items are violations that occur in areas with slope violations and have been excluded from the cost estimate.