


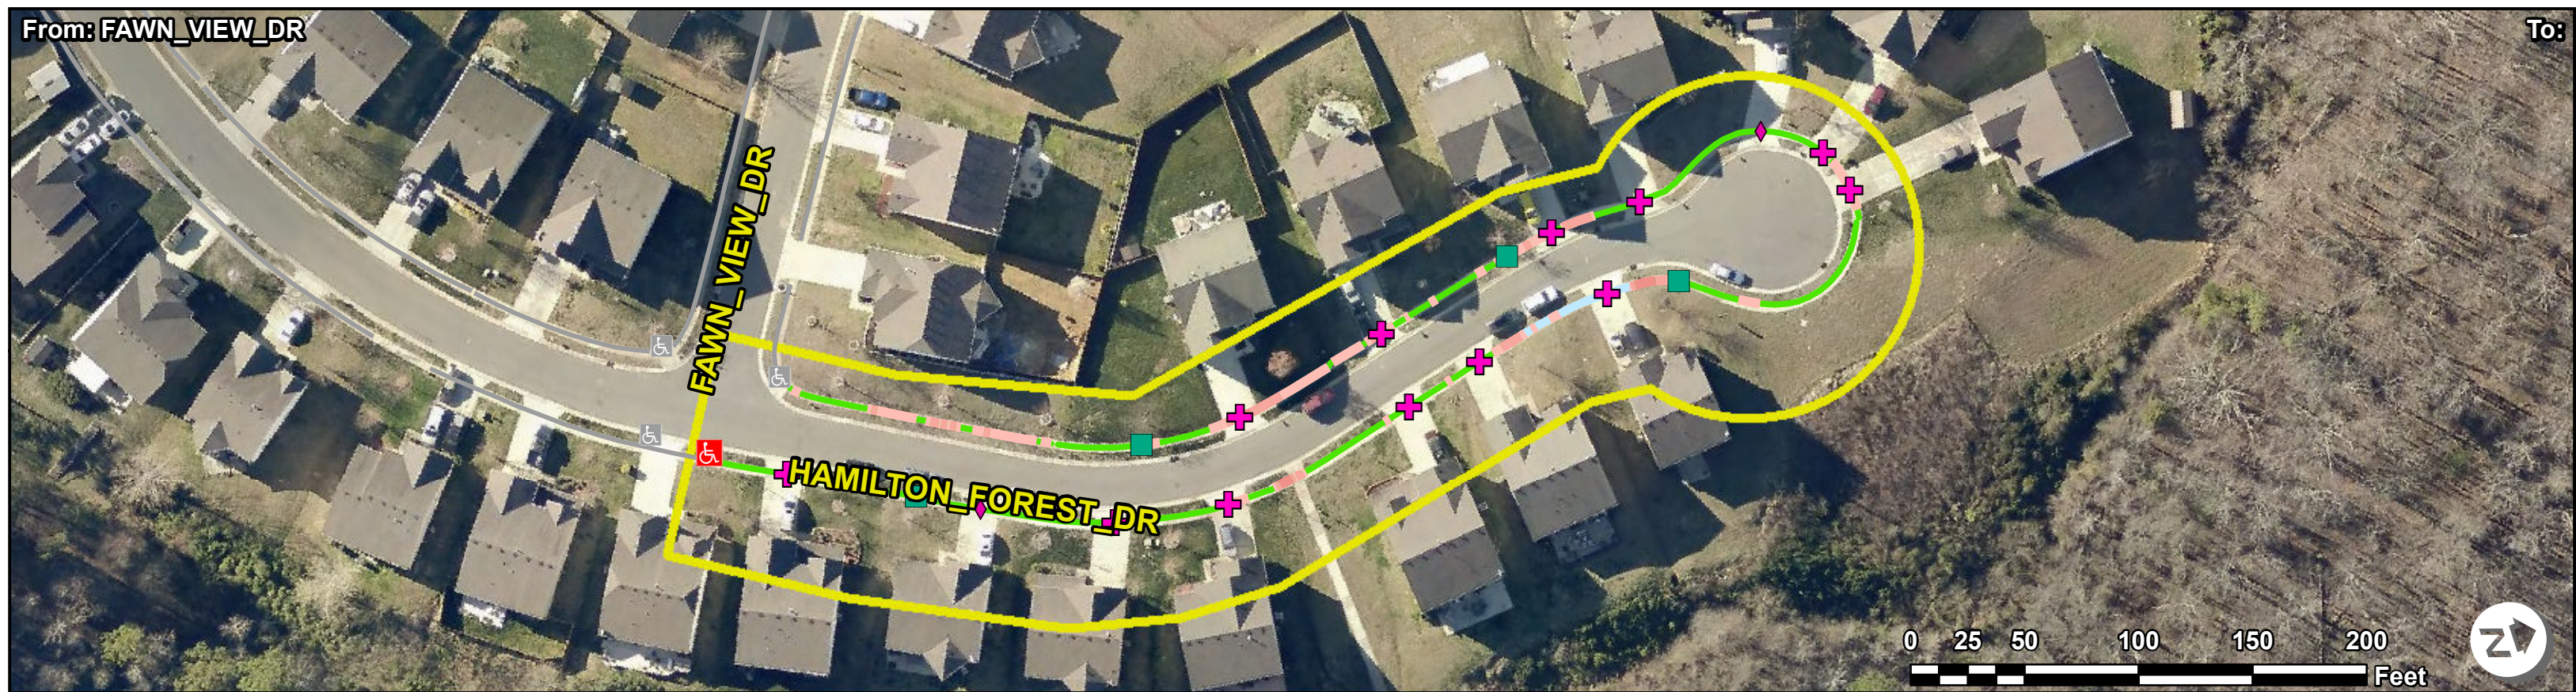

ADA Survey Summary		ADA Compliance Cost Estimate *				Intersection Inventory & Compliance Cost Estimate											
Item	Description	Quantity	Item	Description	Quantity	Unit Price	Item	Description	Total Count	Non Compliant Count	Cost						
1	Heavings less than 1"	16 EA	1	Heavings less than 1"	6 EA	\$ 100.00	\$	600.00	Curb Ramps	1	1	\$	1850.00	● Heavings < 1" (Excluded)***	● Heavings < 1"		
2	Heavings 1" or greater	0 EA	2	Heavings 1" or greater	0 EA	\$ 400.00	\$	0.00	Island Curb Cuts	0	0	\$	0.00	● Heavings ≥ 1" (Excluded)***	● Heavings ≥ 1"		
3	Uneven Heavings	0 EA	3	Uneven Heavings	0 EA	\$ 400.00	\$	0.00	Signal Push Buttons	0	0	\$	0.00	● Uneven Heaving (Excluded)***	● Uneven Heaving		
4	Heaving Clusters	1.775 SY	4	Heaving Clusters	1.775 SY	\$ 75.00	\$	133.00	Transit Stops	0	0	\$	0.00	● Heaving Clusters (Excluded)	● Heaving Clusters		
5	Sidewalk Joint Gaps	0 EA	5	Sidewalk Joint Gaps	0 EA	\$ 200.00	\$	0.00	Railroad Crossings	0	0	\$	0.00	▲ Sidewalk Joint Gap (Excluded)***	▲ Sidewalk Joint Gap		
6	Miscellaneous Obstruction	0 EA	6	Miscellaneous Obstruction	0 EA	\$ 1500.00	\$	0.00	Accessible Parking Spaces	0	0	\$	0.00	■ Miscellaneous Obstruction	◆ Commercial Entrance		
7	Missing Sidewalk Obstruction	0 EA	7	Missing Sidewalk Obstruction	0 EA	\$ 200.00	\$	0.00	Intersection SubTotal:			\$	1850.00	■ Missing Sidewalk Obstruction	◆ Residential Entrance		
8	Other Obstruction	0 EA	8	Other Obstruction	0 EA	\$ 500.00	\$	0.00					■ Other Obstruction	✚ Commercial Entrance (within slope violation)			
9	Pole Post Hydrant Obstruction	0 EA	9	Pole Post Hydrant Obstruction	0 EA	\$ 5000.00	\$	0.00					■ Pole Post Hydrant Obstruction	✚ Residential Entrance (within slope violation)			
10	Ponding Obstruction	0 EA	10	Ponding Obstruction	0 EA	\$ 400.00	\$	0.00					■ Ponding Obstruction	Cross Slope			
11	Sidewalk Joint Obstruction	0 EA	11	Sidewalk Joint Obstruction	0 EA	\$ 100.00	\$	0.00					■ Sidewalk Joint Obstruction	■ 2 - 3%	■ 7.01 - 8%		
12	Sign Obstruction	0 EA	12	Sign Obstruction	0 EA	\$ 150.00	\$	0.00					■ Sign Obstruction	■ 3.01 - 4%	■ 8.01 - 9%		
13	Storm Grate Obstruction	0 EA	13	Storm Grate Obstruction	0 EA	\$700.00	\$	0.00					■ Storm Grate Obstruction	■ 4.01 - 5%	■ 9.01 - 10%		
14	Transit Obstruction	0 EA	14	Transit Obstruction	0 EA	\$500.00	\$	0.00					■ Transit Obstruction	■ 5.01% - 6%	■ 10.01 - 12%		
15	Traffic Obstruction	0 EA	15	Traffic Obstruction	0 EA	\$2000.00	\$	0.00					■ Traffic Obstruction	■ 6.01 - 7%	■ > 12%		
16	Tree Obstruction	0 EA	16	Tree Obstruction	0 EA	\$500.00	\$	0.00					■ Tree Obstruction	Running Slope			
17	Utility Obstruction	0 EA	17	Utility Obstruction	0 EA	\$1500.00	\$	0.00					■ Utility Obstruction	■ 5 - 8.33%			
18	Vegetation Obstruction - Low	0 EA	18	Vegetation Obstruction - Low	0 EA	\$150.00	\$	0.00					■ Vegetation Obstruction - Low	■ 8.34% - 10%			
19	Vegetation Obstruction - Overhead	4 EA	19	Vegetation Obstruction - Overhead	4 EA	\$150.00	\$	600.00					■ Vegetation Obstruction - Overhead	■ 10.01 - 12.5%			
20	Commercial Entrance	0 EA	20	Commercial Entrance (within slope violation)	0 EA	\$ 5000.00	\$	0.00					■ Sidewalk Collection Path	■ > 12.5%			
21	Residential Entrance	14 EA	21	Residential Entrance (within slope violation)	12 EA	\$ 3000.00	\$	36000.00					■ Adjacent Sidewalk Collection Path				
22	Total Sidewalk Length Assessed	1073.984 LF	22	Running Slope Violations**	0 SY	\$ 75.00	\$	0.00					■ Buried Sidewalk				
23	Average Sidewalk Width	48 IN	23	Cross Slope Violations	106.797 SY	\$ 75.00	\$	8010.00					■ Sidewalk Not Surveyed				
24	No Sidewalk on Block (Approx.)	0 LF	24	Running and Cross Slope Violations	7.415 SY	\$ 75.00	\$	556.00					■ Missing Sidewalk Gap				
25	Missing Sidewalk Gaps (Approx.)	0 LF	25	Missing Sidewalk Gaps (Approx.)	0 LF	\$ 41.67	\$	0.00					■ No Sidewalk on Block				
26	Poor Surface Condition (Approx.)	0 LF	26	Poor Surface Condition (Approx.)	0 LF	\$ 41.67	\$	0.00									
27	Buried Sidewalk (Approx.)	0 LF	27	Buried Sidewalk (Approx.)	0 LF	\$ 41.67	\$	0.00									
			Sidewalk SubTotal:				\$	45899.00									
Corridor Total:										\$		47749.00					