
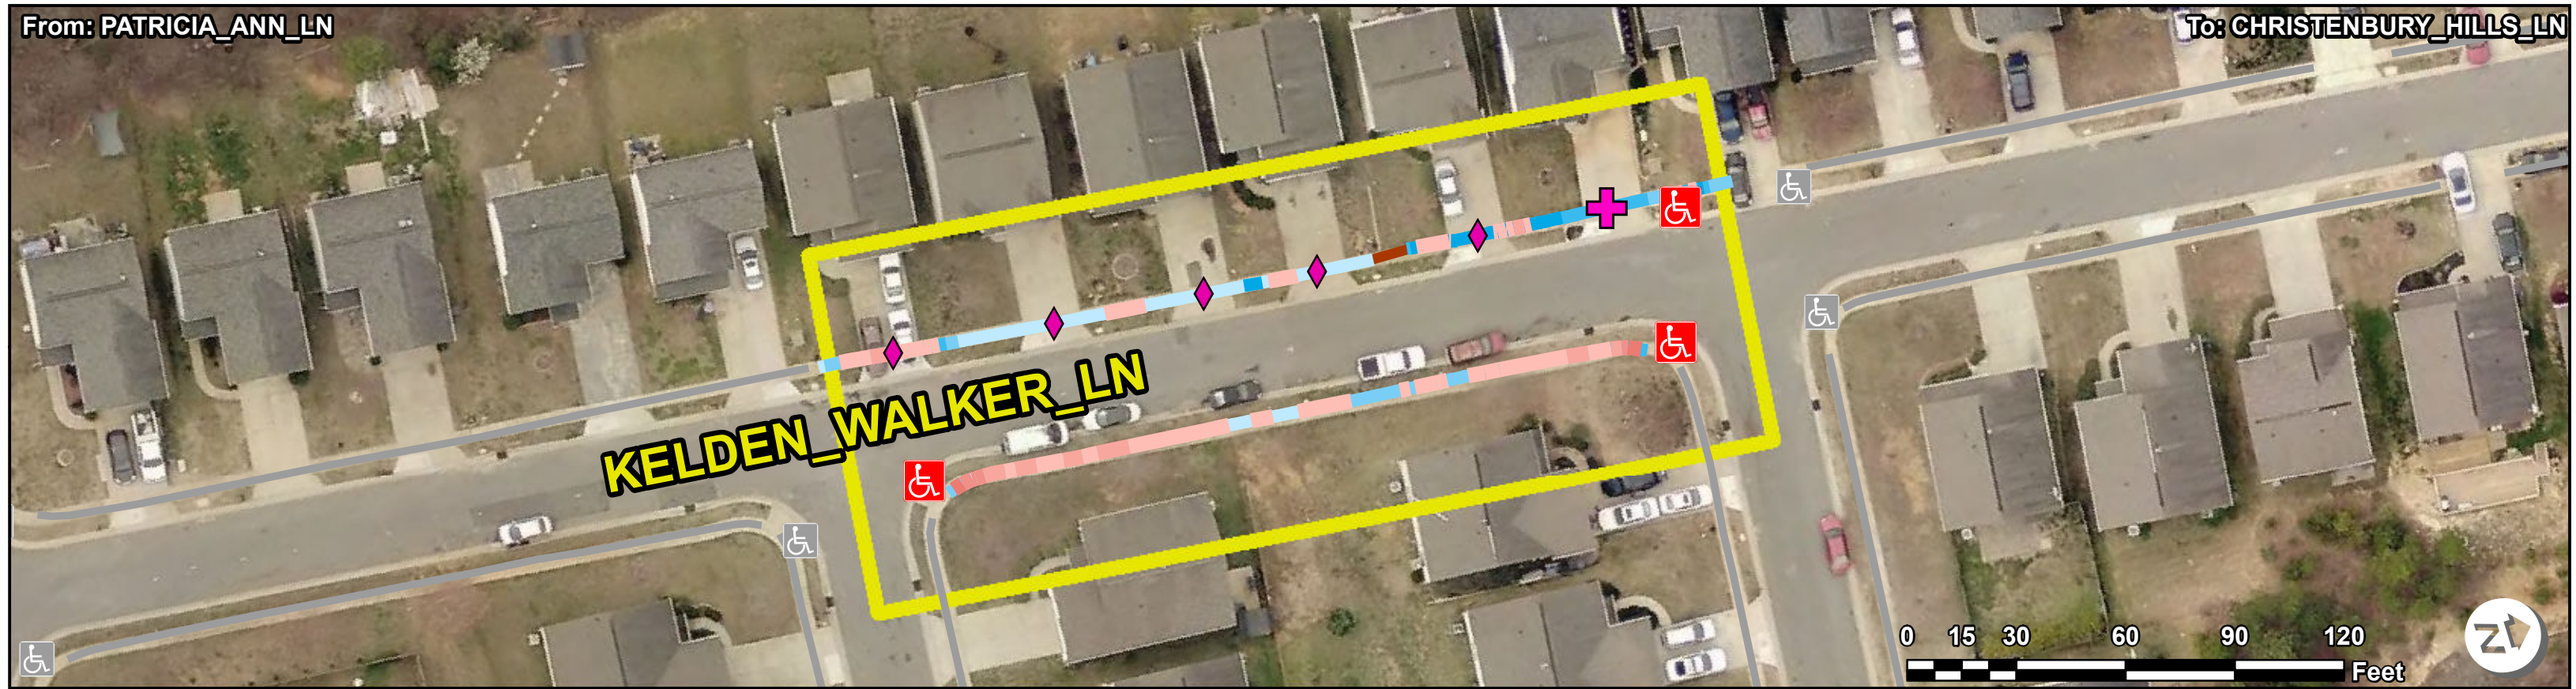





ADA Survey Summary		ADA Compliance Cost Estimate *				Intersection Inventory & Compliance Cost Estimate							
Item Description	Quantity	Item Description	Quantity	Unit Price	Item Cost	Item Description	Total Count	Non Compliant Count	Cost	 Heavings < 1" (Excluded)***	 Heavings < 1"		
1 Heavings less than 1"	2 EA	1 Heavings less than 1"	2 EA	\$ 100.00	\$ 200.00	Curb Ramps	3	3	\$ 8250.00	 Heavings ≥ 1" (Excluded)***	 Heavings ≥ 1"		
2 Heavings 1" or greater	0 EA	2 Heavings 1" or greater	0 EA	\$ 400.00	\$ 0.00	Island Curb Cuts	0	0	\$ 0.00	 Uneven Heaving (Excluded)***	 Uneven Heaving		
3 Uneven Heavings	0 EA	3 Uneven Heavings	0 EA	\$ 400.00	\$ 0.00	Signal Push Buttons	0	0	\$ 0.00	 Heaving Clusters (Excluded)	 Heaving Clusters		
4 Heaving Clusters	9.103 SY	4 Heaving Clusters	7.327 SY	\$ 75.00	\$ 550.00	Transit Stops	0	0	\$ 0.00	 Sidewalk Joint Gap (Excluded)***	 Sidewalk Joint Gap		
5 Sidewalk Joint Gaps	0 EA	5 Sidewalk Joint Gaps	0 EA	\$ 200.00	\$ 0.00	Railroad Crossings	0	0	\$ 0.00	 Miscellaneous Obstruction	 Commercial Entrance		
6 Miscellaneous Obstruction	0 EA	6 Miscellaneous Obstruction	0 EA	\$ 1500.00	\$ 0.00	Accessible Parking Spaces	0	0	\$ 0.00	 Missing Sidewalk Obstruction	 Residential Entrance		
7 Missing Sidewalk Obstruction	0 EA	7 Missing Sidewalk Obstruction	0 EA	\$ 200.00	\$ 0.00	Intersection SubTotal:			\$ 8250.00	 Other Obstruction	 Commercial Entrance (within slope violation)		
8 Other Obstruction	0 EA	8 Other Obstruction	0 EA	\$ 500.00	\$ 0.00	Corridor Total: \$ 18985.00				 Pole Post Hydrant Obstruction	 Residential Entrance (within slope violation)		
9 Pole Post Hydrant Obstruction	0 EA	9 Pole Post Hydrant Obstruction	0 EA	\$ 5000.00	\$ 0.00					Cross Slope			
10 Ponding Obstruction	0 EA	10 Ponding Obstruction	0 EA	\$ 400.00	\$ 0.00	 Curb Ramps - Compliant	 Curb Ramps - Adjacent	 2 - 3%	 7.01 - 8%				
11 Sidewalk Joint Obstruction	0 EA	11 Sidewalk Joint Obstruction	0 EA	\$ 100.00	\$ 0.00	 Curb Ramps - Non Compliant		 3.01 - 4%	 8.01 - 9%				
12 Sign Obstruction	0 EA	12 Sign Obstruction	0 EA	\$ 150.00	\$ 0.00	 Island Curb Cuts - Compliant	 Island Curb Cuts - Adjacent	 4.01 - 5%	 9.01 - 10%				
13 Storm Grate Obstruction	0 EA	13 Storm Grate Obstruction	0 EA	\$700.00	\$ 0.00	 Island Curb Cuts - Non Compliant		 5.01% - 6%	 10.01 - 12%				
14 Transit Obstruction	0 EA	14 Transit Obstruction	0 EA	\$500.00	\$ 0.00	 Signals - Compliant	 Signals - Adjacent	 6.01 - 7%	 > 12%				
15 Traffic Obstruction	0 EA	15 Traffic Obstruction	0 EA	\$2000.00	\$ 0.00	 Signals - Non Compliant		Running Slope					
16 Tree Obstruction	0 EA	16 Tree Obstruction	0 EA	\$500.00	\$ 0.00	 Transit Stops - Compliant	 Transit Stops - Adjacent	 5 - 8.33%	 8.34% - 10%				
17 Utility Obstruction	0 EA	17 Utility Obstruction	0 EA	\$1500.00	\$ 0.00	 Transit Stops - Non Compliant		 10.01 - 12.5%	 > 12.5%				
18 Vegetation Obstruction - Low	0 EA	18 Vegetation Obstruction - Low	0 EA	\$150.00	\$ 0.00	 Railroad Crossings - Compliant	 Railroad Crossings - Adjacent	 Sidewalk Collection Path					
19 Vegetation Obstruction - Overhead	0 EA	19 Vegetation Obstruction - Overhead	0 EA	\$150.00	\$ 0.00	 Railroad Crossings - Non Compliant		 Adjacent Sidewalk Collection Path					
20 Commercial Entrance	0 EA	20 Commercial Entrance (within slope violation)	0 EA	\$ 5000.00	\$ 0.00	 Accessible Parking - Compliant	 Accessible Parking - Adjacent	 Buried Sidewalk					
21 Residential Entrance	6 EA	21 Residential Entrance (within slope violation)	1 EA	\$ 3000.00	\$ 3000.00	 Accessible Parking - Non Compliant		 Sidewalk Not Surveyed					
22 Total Sidewalk Length Assessed	432.353 LF	22 Running Slope Violations**	0 SY	\$ 75.00	\$ 0.00					 Missing Sidewalk Gap			
23 Average Sidewalk Width	48 IN	23 Cross Slope Violations	0 SY	\$ 75.00	\$ 0.00					 No Sidewalk on Block			
24 No Sidewalk on Block (Approx.)	0 LF	24 Running and Cross Slope Violations	93.14 SY	\$ 75.00	\$ 6986.00								
25 Missing Sidewalk Gaps (Approx.)	0 LF	25 Missing Sidewalk Gaps (Approx.)	0 LF	\$ 41.67	\$ 0.00								
26 Poor Surface Condition (Approx.)	0 LF	26 Poor Surface Condition (Approx.)	0 LF	\$ 41.67	\$ 0.00								
27 Buried Sidewalk (Approx.)	0 LF	27 Buried Sidewalk (Approx.)	0 LF	\$ 41.67	\$ 0.00								
		Sidewalk SubTotal:											