


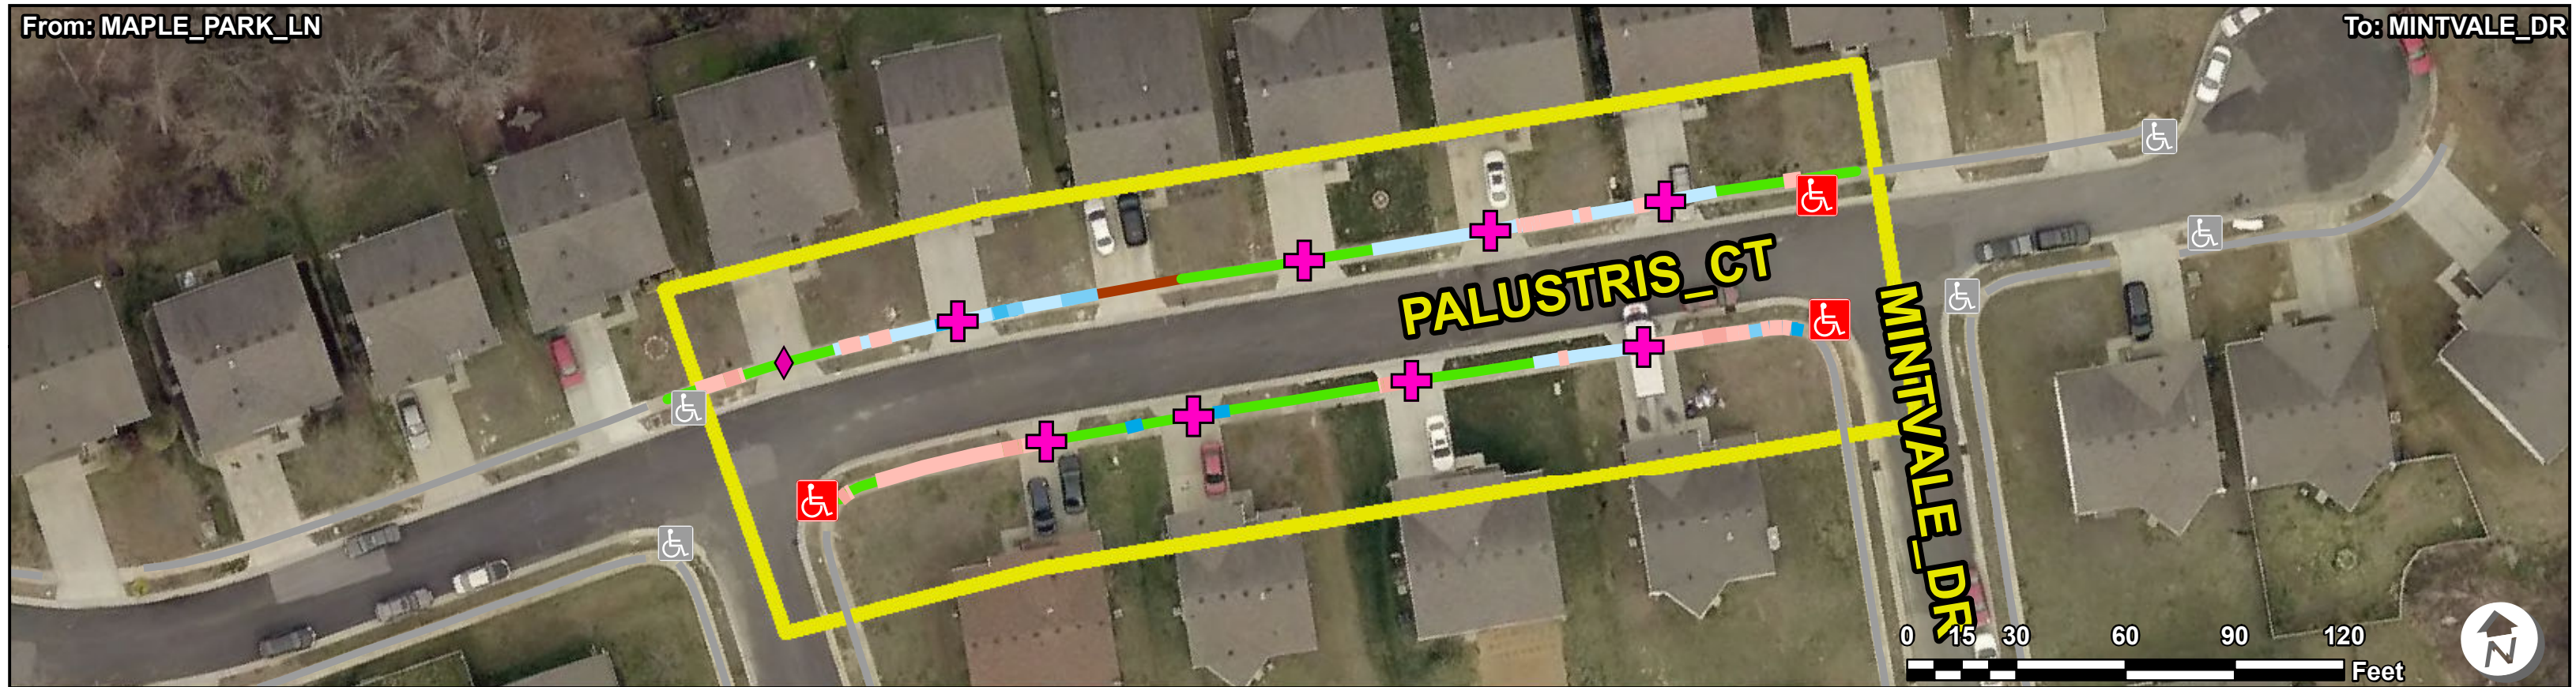

ADA Survey Summary		ADA Compliance Cost Estimate *				Intersection Inventory & Compliance Cost Estimate							
Item Description	Quantity	Item Description	Quantity	Unit Price	Item Cost	Item Description	Total Count	Non Compliant Count	Cost	 Heavings < 1" (Excluded)***	 Heavings < 1"		
1 Heavings less than 1"	8 EA	1 Heavings less than 1"	5 EA	\$ 100.00	\$ 500.00	Curb Ramps	3	3	\$ 8250.00	 Heavings ≥ 1" (Excluded)***	 Heavings ≥ 1"		
2 Heavings 1" or greater	2 EA	2 Heavings 1" or greater	0 EA	\$ 400.00	\$ 0.00	Island Curb Cuts	0	0	\$ 0.00	 Uneven Heaving (Excluded)***	 Uneven Heaving		
3 Uneven Heavings	0 EA	3 Uneven Heavings	0 EA	\$ 400.00	\$ 0.00	Signal Push Buttons	0	0	\$ 0.00	Heaving Clusters (Excluded)	Heaving Clusters		
4 Heaving Clusters	25.266 SY	4 Heaving Clusters	9.324 SY	\$ 75.00	\$ 699.00	Transit Stops	0	0	\$ 0.00	 Sidewalk Joint Gap (Excluded)***	 Sidewalk Joint Gap		
5 Sidewalk Joint Gaps	0 EA	5 Sidewalk Joint Gaps	0 EA	\$ 200.00	\$ 0.00	Railroad Crossings	0	0	\$ 0.00	 Miscellaneous Obstruction	 Commercial Entrance		
6 Miscellaneous Obstruction	0 EA	6 Miscellaneous Obstruction	0 EA	\$ 1500.00	\$ 0.00	Accessible Parking Spaces	0	0	\$ 0.00	 Missing Sidewalk Obstruction	 Residential Entrance		
7 Missing Sidewalk Obstruction	0 EA	7 Missing Sidewalk Obstruction	0 EA	\$ 200.00	\$ 0.00	Intersection SubTotal:			\$ 8250.00	 Other Obstruction	 Commercial Entrance (within slope violation)		
8 Other Obstruction	0 EA	8 Other Obstruction	0 EA	\$ 500.00	\$ 0.00	Corridor Total: \$ 37658.00				 Pole Post Hydrant Obstruction	 Residential Entrance (within slope violation)		
9 Pole Post Hydrant Obstruction	0 EA	9 Pole Post Hydrant Obstruction	0 EA	\$ 5000.00	\$ 0.00					Cross Slope			
10 Ponding Obstruction	0 EA	10 Ponding Obstruction	0 EA	\$ 400.00	\$ 0.00	 Sidewalk Joint Obstruction				 2 - 3%	 7.01 - 8%		
11 Sidewalk Joint Obstruction	0 EA	11 Sidewalk Joint Obstruction	0 EA	\$ 100.00	\$ 0.00	 Sign Obstruction				 3.01 - 4%	 8.01 - 9%		
12 Sign Obstruction	0 EA	12 Sign Obstruction	0 EA	\$ 150.00	\$ 0.00	 Storm Grate Obstruction				 4.01 - 5%	 9.01 - 10%		
13 Storm Grate Obstruction	0 EA	13 Storm Grate Obstruction	0 EA	\$700.00	\$ 0.00	 Transit Obstruction				 5.01% - 6%	 10.01 - 12%		
14 Transit Obstruction	0 EA	14 Transit Obstruction	0 EA	\$500.00	\$ 0.00	 Traffic Obstruction				 6.01 - 7%	 > 12%		
15 Traffic Obstruction	0 EA	15 Traffic Obstruction	0 EA	\$2000.00	\$ 0.00	 Tree Obstruction				Running Slope			
16 Tree Obstruction	0 EA	16 Tree Obstruction	0 EA	\$500.00	\$ 0.00	 Utility Obstruction				 5 - 8.33%			
17 Utility Obstruction	0 EA	17 Utility Obstruction	0 EA	\$1500.00	\$ 0.00	 Vegetation Obstruction - Low				 8.34% - 10%			
18 Vegetation Obstruction - Low	0 EA	18 Vegetation Obstruction - Low	0 EA	\$150.00	\$ 0.00	 Vegetation Obstruction - Overhead				 10.01 - 12.5%			
19 Vegetation Obstruction - Overhead	0 EA	19 Vegetation Obstruction - Overhead	0 EA	\$150.00	\$ 0.00	Sidewalk Collection Path				> 12.5%			
20 Commercial Entrance	0 EA	20 Commercial Entrance (within slope violation)	0 EA	\$ 5000.00	\$ 0.00	Adjacent Sidewalk Collection Path							
21 Residential Entrance	9 EA	21 Residential Entrance (within slope violation)	8 EA	\$ 3000.00	\$ 24000.00	Buried Sidewalk							
22 Total Sidewalk Length Assessed	575.239 LF	22 Running Slope Violations**	0 SY	\$ 75.00	\$ 0.00	Sidewalk Not Surveyed							
23 Average Sidewalk Width	48 IN	23 Cross Slope Violations	28.477 SY	\$ 75.00	\$ 2136.00	Missing Sidewalk Gap							
24 No Sidewalk on Block (Approx.)	0 LF	24 Running and Cross Slope Violations	27.637 SY	\$ 75.00	\$ 2073.00	No Sidewalk on Block							
25 Missing Sidewalk Gaps (Approx.)	0 LF	25 Missing Sidewalk Gaps (Approx.)	0 LF	\$ 41.67	\$ 0.00	*Note: ADA pedestrian issues have been identified and quantified in the ADA Survey Summary. There are instances where multiple issues can be resolved with a single corrective measure. The ADA Compliance Cost Estimate reflects the best estimation of quantities and cost to resolve all identified ADA issues. **Note: Additional investigation may be warranted when sidewalk running slope issues exist within the right-of-way.							
26 Poor Surface Condition (Approx.)	0 LF	26 Poor Surface Condition (Approx.)	0 LF	\$ 41.67	\$ 0.00								
27 Buried Sidewalk (Approx.)	0 LF	27 Buried Sidewalk (Approx.)	0 LF	\$ 41.67	\$ 0.00								
Sidewalk SubTotal:					\$ 29408.00								