
Access Compliance Report - Public Rights-of-Way (Corridor: Sidewalk & Intersection Items)

Corridor ID: REGAL-OAKS-DR-010



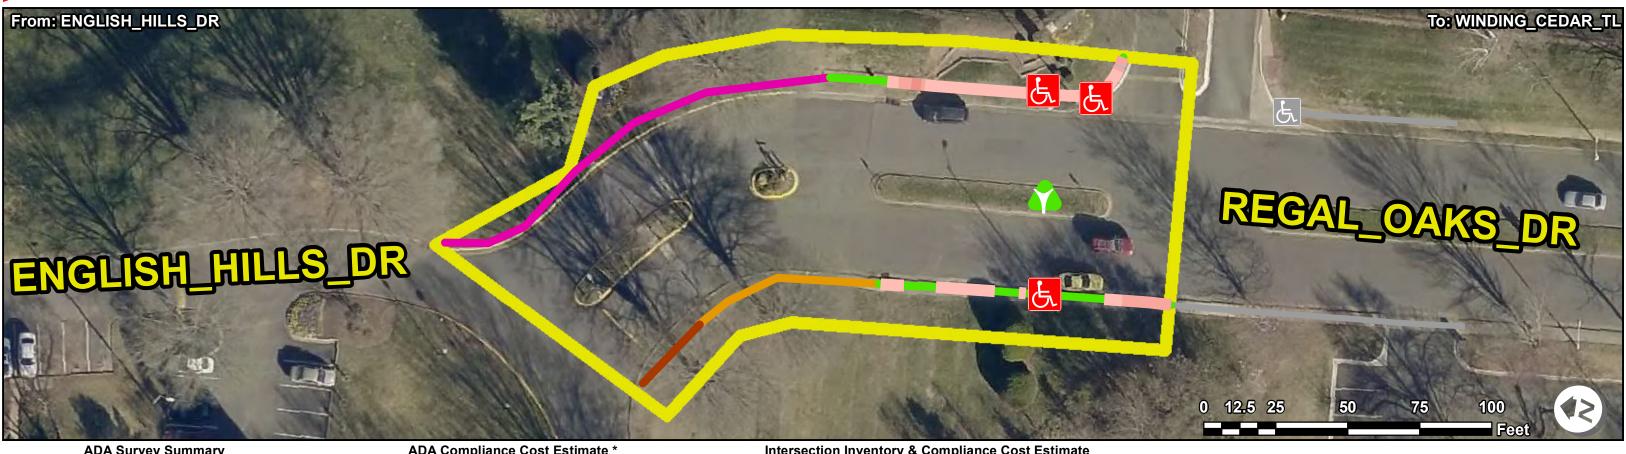

ADA Survey Summary			
Item Description	Quantity		
1 Heavings less than 1"	2 EA		
2 Heavings 1" or greater	0 EA		
3 Uneven Heavings	0 EA		
4 Heaving Clusters	0 SY		
5 Sidewalk Joint Gaps	0 EA		
6 Miscellaneous Obstruction	0 EA		
7 Missing Sidewalk Obstruction	0 EA		
8 Other Obstruction	0 EA		
9 Pole Post Hydrant Obstruction	0 EA		
10 Ponding Obstruction	0 EA		
11 Sidewalk Joint Obstruction	0 EA		
12 Sign Obstruction	0 EA		
13 Storm Grate Obstruction	0 EA		
14 Transit Obstruction	0 EA		
15 Traffic Obstruction	0 EA		
16 Tree Obstruction	0 EA		
17 Utility Obstruction	0 EA		
18 Vegetation Obstruction - Low	0 EA		
19 Vegetation Obstruction - Overhead	0 EA		
20 Commercial Entrance	0 EA		
21 Residential Entrance	0 EA		
22 Total Sidewalk Length Assessed	200.908 LF		
23 Average Sidewalk Width	48 IN		
24 No Sidewalk on Block (Approx.)	0 LF		
25 Missing Sidewalk Gaps (Approx.)	151.741 LF		
26 Poor Surface Condition (Approx.)	0 LF		
27 Buried Sidewalk (Approx.)	67.009 LF		

	ADA Compliance Cost Estimate *				
Iten	n Description	Quantity	Unit Price	Ite	em Cost
1	Heavings less than 1"	1 EA	\$ 100.00	\$	100.00
2	Heavings 1" or greater	0 EA	\$ 400.00	\$	0.00
3	Uneven Heavings	0 EA	\$ 400.00	\$	0.00
4	Heaving Clusters	0 SY	\$ 75.00	\$	0.00
5	Sidewalk Joint Gaps	0 EA	\$ 200.00	\$	0.00
6	Miscellaneous Obstruction	0 EA	\$ 1500.00	\$	0.00
7	Missing Sidewalk Obstruction	0 EA	\$ 200.00	\$	0.00
8	Other Obstruction	0 EA	\$ 500.00	\$	0.00
9	Pole Post Hydrant Obstruction	0 EA	\$ 5000.00	\$	0.00
10	Ponding Obstruction	0 EA	\$ 400.00	\$	0.00
11	Sidewalk Joint Obstruction	0 EA	\$ 100.00	\$	0.00
12	Sign Obstruction	0 EA	\$ 150.00	\$	0.00
13	Storm Grate Obstruction	0 EA	\$700.00	\$	0.00
14	Transit Obstruction	0 EA	\$500.00	\$	0.00
15	Traffic Obstruction	0 EA	\$2000.00	\$	0.00
16	Tree Obstruction	0 EA	\$500.00	\$	0.00
17	Utility Obstruction	0 EA	\$1500.00	\$	0.00
18	Vegetation Obstruction - Low	0 EA	\$150.00	\$	0.00
19	Vegetation Obstruction - Overhead	0 EA	\$150.00	\$	0.00
20	Commercial Entrance (within slope viol	ation) 0 EA	\$ 5000.00	\$	0.00
21	Residential Entrance (within slope viola	ition) 0 EA	\$ 3000.00	\$	0.00
22	Running Slope Violations**	0 SY	\$ 75.00	\$	0.00
23	Cross Slope Violations	55.849 SY	\$ 75.00	\$	4189.00
24	Running and Cross Slope Violations	3.507 SY	\$ 75.00	\$	263.00
25	Missing Sidewalk Gaps (Approx.)	151.741 LF	\$ 41.67	\$	6380.00
26	Poor Surface Condition (Approx.)	0 LF	\$ 41.67	\$	0.00
27	Buried Sidewalk (Approx.)	67.009 LF	\$ 41.67	\$	2860.00
	Sidewalk SubTotal:			\$	4552.00

In	tersection	Inventory	<i>8</i>	Compliance	Cost	Estimate
----	------------	-----------	----------	------------	------	----------

Item Description	Total Count	Non Compliant Count	Cost
Curb Ramps	3	3	\$ 6650.00
Island Curb Cuts	1	0	\$ 0.00
Signal Push Buttons	0	0	\$ 0.00
Transit Stops	0	0	\$ 0.00
Railroad Crossings	0	0	\$ 0.00
Accessible Parking Space	ces 0	0	\$ 0.00
Intersection SubTotal:		\$	6650.00

Corridor Total:	\$ 17582.00

ક્ષ	Curb Ramps - Compliant	Ł	Curb Ramps - Adjacent
Ł	Curb Ramps - Non Compliant		
•	Island Curb Cuts - Compliant	4	Island Curb Cuts - Adjacent
•	Island Curb Cuts - Non Compliant		
#	Signals - Compliant	#	Signals - Adjacent
#	Signals - Non Compliant		
	Transit Stops - Compliant		Transit Stops - Adjacent

- Railroad Crossings Compliant Railroad Crossings - Non Compliant Accessible Parking - Compliant Accessible Parking - Adjacent
- Accessible Parking Non Compliant

Transit Stops - Non Compliant

•	Heavings < 1" (Excluded)***
•	Heavings ≥ 1" (Excluded)***
•	Uneven Heaving (Excluded)***
	Heaving Clusters (Excluded)
A	Sidewalk Joint Gap (Excluded)***
•	Miscellaneous Obstruction

- Missing Sidewalk Obstruction Other Obstruction Pole Post Hydrant Obstruction
- Ponding Obstruction Sidewalk Joint Obstruction

- Railroad Crossings Adjacent

- Heavings < 1" Heavings ≥ 1"
- - Heaving Clusters
- Sidewalk Joint Gap Commercial Entrance
- Residential Entrance
 - ◆ Commercial Entrance (within slope violation)

Uneven Heaving

Residential Entrance (within slope violation)

Cross Slope 2 - 3% 7.01 - 8%

- 3.01 4% Sign Obstruction 8.01 - 9% Storm Grate Obstruction 4.01 - 5% 9.01 - 10%
- Transit Obstruction 5.01% - 6% 10.01 - 12% Traffic Obstruction 6.01 - 7% > 12%
- Tree Obstruction **Running Slope Utility Obstruction** 5 - 8.33%
- Vegetation Obstruction Low 8.34% - 10% Vegetation Obstruction - Overhead 10.01 - 12.5%
- > 12.5% Sidewalk Collection Path
- Adjacent Sidewalk Collection Path **Buried Sidewalk**
- Sidewalk Not Surveyed
- Missing Sidewalk Gap No Sidewalk on Block
- *Note: ADA pedestrian issues have been identified and quantified in the ADA Survey Summary. There are instances where multiple issues can be resolved with a single corrective measure. The ADA Compliance Cost Estimate reflects the best estimation of quantities and cost to resolve all identified ADA issues.
- **Note: Additional investigation may be warranted when sidewalk running slope issues exist within the right-of-way.

 ***Note: Excluded items are violations that occur in areas with slope violations and have been excluded from the cost estimate.