


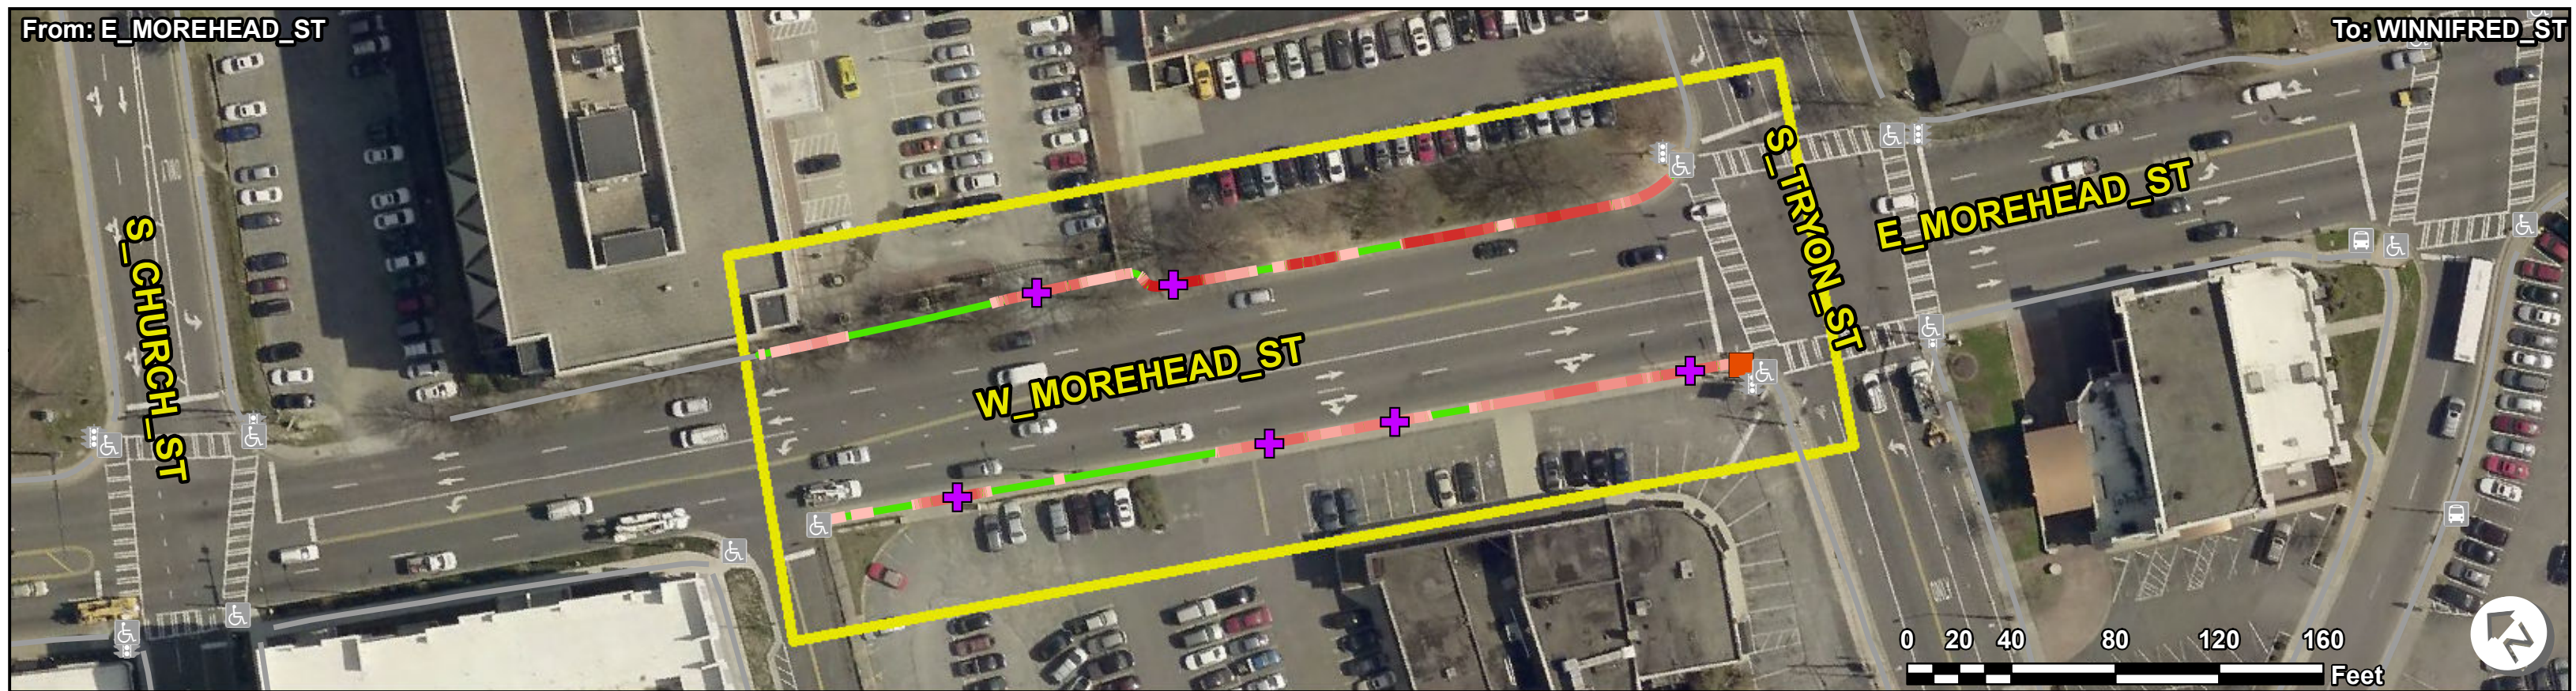

ADA Survey Summary		ADA Compliance Cost Estimate *				Intersection Inventory & Compliance Cost Estimate											
Item	Description	Quantity	Item	Description	Quantity	Unit Price	Item Cost	Item	Description	Total Count	Non Compliant Count	Cost					
1	Heavings less than 1"	15 EA	1	Heavings less than 1"	2 EA	\$ 100.00	\$ 200.00	Curb Ramps	0	0	\$ 0.00	● Heavings < 1" (Excluded)***	● Heavings < 1"				
2	Heavings 1" or greater	1 EA	2	Heavings 1" or greater	0 EA	\$ 400.00	\$ 0.00	Island Curb Cuts	0	0	\$ 0.00	● Heavings ≥ 1" (Excluded)***	● Heavings ≥ 1"				
3	Uneven Heavings	0 EA	3	Uneven Heavings	0 EA	\$ 400.00	\$ 0.00	Signal Push Buttons	0	0	\$ 0.00	● Uneven Heaving (Excluded)***	● Uneven Heaving				
4	Heaving Clusters	2.663 SY	4	Heaving Clusters	0 SY	\$ 75.00	\$ 0.00	Transit Stops	0	0	\$ 0.00	— Heaving Clusters (Excluded)	— Heaving Clusters				
5	Sidewalk Joint Gaps	0 EA	5	Sidewalk Joint Gaps	0 EA	\$ 200.00	\$ 0.00	Railroad Crossings	0	0	\$ 0.00	▲ Sidewalk Joint Gap (Excluded)***	▲ Sidewalk Joint Gap				
6	Miscellaneous Obstruction	0 EA	6	Miscellaneous Obstruction	0 EA	\$ 1500.00	\$ 0.00	Accessible Parking Spaces	0	0	\$ 0.00	■ Miscellaneous Obstruction	◆ Commercial Entrance				
7	Missing Sidewalk Obstruction	0 EA	7	Missing Sidewalk Obstruction	0 EA	\$ 200.00	\$ 0.00	Intersection SubTotal:			\$ 0.00	■ Missing Sidewalk Obstruction	◆ Residential Entrance				
8	Other Obstruction	0 EA	8	Other Obstruction	0 EA	\$ 500.00	\$ 0.00					■ Other Obstruction	⊕ Commercial Entrance (within slope violation)				
9	Pole Post Hydrant Obstruction	1 EA	9	Pole Post Hydrant Obstruction	1 EA	\$ 5000.00	\$ 5000.00					■ Pole Post Hydrant Obstruction	⊕ Residential Entrance (within slope violation)				
10	Ponding Obstruction	0 EA	10	Ponding Obstruction	0 EA	\$ 400.00	\$ 0.00					■ Ponding Obstruction					
11	Sidewalk Joint Obstruction	0 EA	11	Sidewalk Joint Obstruction	0 EA	\$ 100.00	\$ 0.00					■ Sidewalk Joint Obstruction	Cross Slope				
12	Sign Obstruction	0 EA	12	Sign Obstruction	0 EA	\$ 150.00	\$ 0.00					■ Sign Obstruction	2 - 3%	7.01 - 8%			
13	Storm Grate Obstruction	0 EA	13	Storm Grate Obstruction	0 EA	\$700.00	\$ 0.00					■ Storm Grate Obstruction	3.01 - 4%	8.01 - 9%			
14	Transit Obstruction	0 EA	14	Transit Obstruction	0 EA	\$500.00	\$ 0.00					■ Transit Obstruction	4.01 - 5%	9.01 - 10%			
15	Traffic Obstruction	0 EA	15	Traffic Obstruction	0 EA	\$2000.00	\$ 0.00					■ Traffic Obstruction	5.01% - 6%	10.01 - 12%			
16	Tree Obstruction	0 EA	16	Tree Obstruction	0 EA	\$500.00	\$ 0.00					■ Tree Obstruction	6.01 - 7%	> 12%			
17	Utility Obstruction	0 EA	17	Utility Obstruction	0 EA	\$1500.00	\$ 0.00					■ Utility Obstruction	Running Slope				
18	Vegetation Obstruction - Low	0 EA	18	Vegetation Obstruction - Low	0 EA	\$150.00	\$ 0.00					■ Vegetation Obstruction - Low	5 - 8.33%				
19	Vegetation Obstruction - Overhead	0 EA	19	Vegetation Obstruction - Overhead	0 EA	\$150.00	\$ 0.00					■ Vegetation Obstruction - Overhead	8.34% - 10%				
20	Commercial Entrance	6 EA	20	Commercial Entrance (within slope violation)	6 EA	\$ 5000.00	\$ 30000.00					— Sidewalk Collection Path	10.01 - 12.5%				
21	Residential Entrance	0 EA	21	Residential Entrance (within slope violation)	0 EA	\$ 3000.00	\$ 0.00					— Adjacent Sidewalk Collection Path	> 12.5%				
22	Total Sidewalk Length Assessed	719.445 LF	22	Running Slope Violations**	0 SY	\$ 75.00	\$ 0.00					— Buried Sidewalk					
23	Average Sidewalk Width	72 IN	23	Cross Slope Violations	245.756 SY	\$ 75.00	\$ 18432.00					— Sidewalk Not Surveyed					
24	No Sidewalk on Block (Approx.)	0 LF	24	Running and Cross Slope Violations	5.8 SY	\$ 75.00	\$ 435.00					— Missing Sidewalk Gap					
25	Missing Sidewalk Gaps (Approx.)	0 LF	25	Missing Sidewalk Gaps (Approx.)	0 LF	\$ 41.67	\$ 0.00					— No Sidewalk on Block					
26	Poor Surface Condition (Approx.)	0 LF	26	Poor Surface Condition (Approx.)	0 LF	\$ 41.67	\$ 0.00										
27	Buried Sidewalk (Approx.)	0 LF	27	Buried Sidewalk (Approx.)	0 LF	\$ 41.67	\$ 0.00										
				Sidewalk SubTotal:				\$ 54067.00									
										Corridor Total:		\$ 54067.00					