


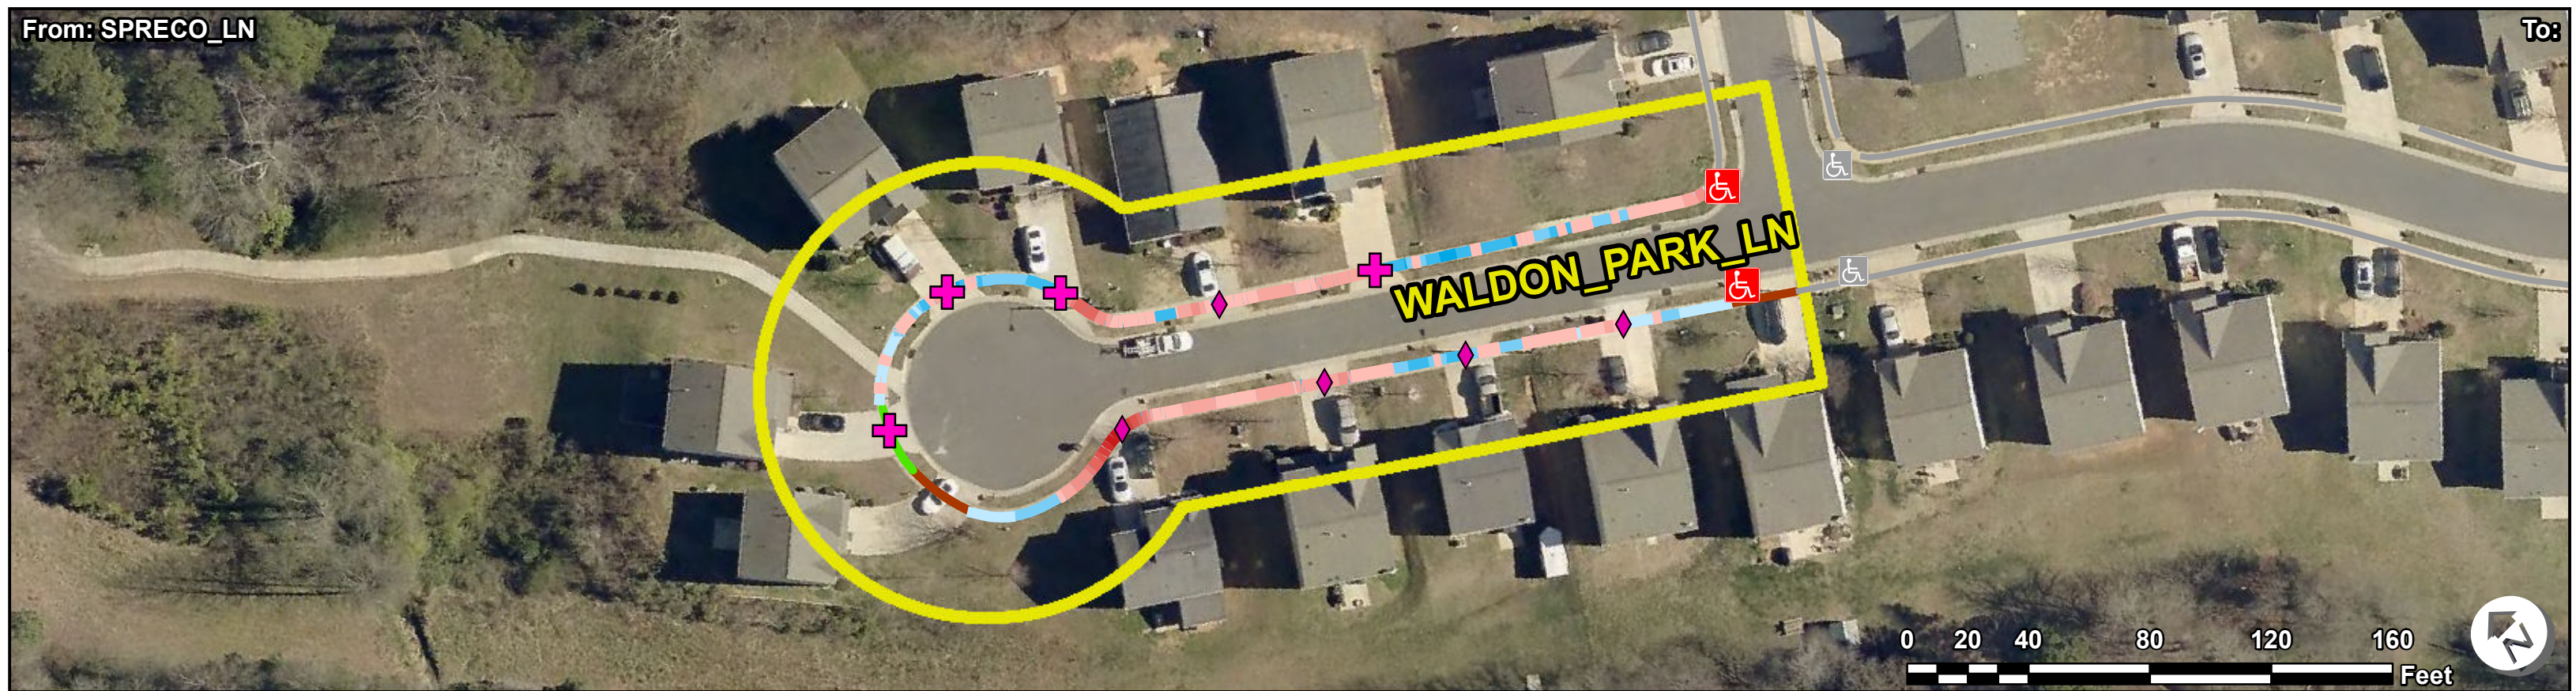

ADA Survey Summary		ADA Compliance Cost Estimate *				Intersection Inventory & Compliance Cost Estimate							
Item Description	Quantity	Item Description	Quantity	Unit Price	Item Cost	Item Description	Total Count	Non Compliant Count	Cost	 Heavings < 1" (Excluded)***	 Heavings < 1"		
1 Heavings less than 1"	10 EA	1 Heavings less than 1"	5 EA	\$ 100.00	\$ 500.00	Curb Ramps	2	2	\$ 4700.00	 Heavings ≥ 1" (Excluded)***	 Heavings ≥ 1"		
2 Heavings 1" or greater	0 EA	2 Heavings 1" or greater	0 EA	\$ 400.00	\$ 0.00	Island Curb Cuts	0	0	\$ 0.00	 Uneven Heaving (Excluded)***	 Uneven Heaving		
3 Uneven Heavings	0 EA	3 Uneven Heavings	0 EA	\$ 400.00	\$ 0.00	Signal Push Buttons	0	0	\$ 0.00	 Heaving Clusters (Excluded)	 Heaving Clusters		
4 Heaving Clusters	7.108 SY	4 Heaving Clusters	7.108 SY	\$ 75.00	\$ 533.00	Transit Stops	0	0	\$ 0.00	 Sidewalk Joint Gap (Excluded)***	 Sidewalk Joint Gap		
5 Sidewalk Joint Gaps	0 EA	5 Sidewalk Joint Gaps	0 EA	\$ 200.00	\$ 0.00	Railroad Crossings	0	0	\$ 0.00	 Miscellaneous Obstruction	 Commercial Entrance		
6 Miscellaneous Obstruction	0 EA	6 Miscellaneous Obstruction	0 EA	\$ 1500.00	\$ 0.00	Accessible Parking Spaces	0	0	\$ 0.00	 Missing Sidewalk Obstruction	 Residential Entrance		
7 Missing Sidewalk Obstruction	0 EA	7 Missing Sidewalk Obstruction	0 EA	\$ 200.00	\$ 0.00	Intersection SubTotal:			\$ 4700.00	 Other Obstruction	 Commercial Entrance (within slope violation)		
8 Other Obstruction	0 EA	8 Other Obstruction	0 EA	\$ 500.00	\$ 0.00					 Pole Post Hydrant Obstruction	 Residential Entrance (within slope violation)		
9 Pole Post Hydrant Obstruction	0 EA	9 Pole Post Hydrant Obstruction	0 EA	\$ 5000.00	\$ 0.00					 Ponding Obstruction			
10 Ponding Obstruction	0 EA	10 Ponding Obstruction	0 EA	\$ 400.00	\$ 0.00					 Sidewalk Joint Obstruction	Cross Slope		
11 Sidewalk Joint Obstruction	0 EA	11 Sidewalk Joint Obstruction	0 EA	\$ 100.00	\$ 0.00					 Sign Obstruction	 2 - 3%	 7.01 - 8%	
12 Sign Obstruction	0 EA	12 Sign Obstruction	0 EA	\$ 150.00	\$ 0.00					 Storm Grate Obstruction	 3.01 - 4%	 8.01 - 9%	
13 Storm Grate Obstruction	0 EA	13 Storm Grate Obstruction	0 EA	\$700.00	\$ 0.00					 Transit Obstruction	 4.01 - 5%	 9.01 - 10%	
14 Transit Obstruction	0 EA	14 Transit Obstruction	0 EA	\$500.00	\$ 0.00					 Traffic Obstruction	 5.01% - 6%	 10.01 - 12%	
15 Traffic Obstruction	0 EA	15 Traffic Obstruction	0 EA	\$2000.00	\$ 0.00					 Tree Obstruction	 6.01 - 7%	 > 12%	
16 Tree Obstruction	0 EA	16 Tree Obstruction	0 EA	\$500.00	\$ 0.00					 Utility Obstruction	Running Slope		
17 Utility Obstruction	0 EA	17 Utility Obstruction	0 EA	\$1500.00	\$ 0.00					 Vegetation Obstruction - Low	 5 - 8.33%		
18 Vegetation Obstruction - Low	0 EA	18 Vegetation Obstruction - Low	0 EA	\$150.00	\$ 0.00					 Vegetation Obstruction - Overhead	 8.34% - 10%		
19 Vegetation Obstruction - Overhead	0 EA	19 Vegetation Obstruction - Overhead	0 EA	\$150.00	\$ 0.00					 Sidewalk Collection Path	 10.01 - 12.5%		
20 Commercial Entrance	0 EA	20 Commercial Entrance (within slope violation)	0 EA	\$ 5000.00	\$ 0.00					 Adjacent Sidewalk Collection Path	 > 12.5%		
21 Residential Entrance	9 EA	21 Residential Entrance (within slope violation)	4 EA	\$ 3000.00	\$ 12000.00					 Buried Sidewalk			
22 Total Sidewalk Length Assessed	590.83 LF	22 Running Slope Violations**	9.756 SY	\$ 75.00	\$ 732.00					 Sidewalk Not Surveyed			
23 Average Sidewalk Width	48 IN	23 Cross Slope Violations	0.341 SY	\$ 75.00	\$ 26.00					 Missing Sidewalk Gap			
24 No Sidewalk on Block (Approx.)	0 LF	24 Running and Cross Slope Violations	113.363 SY	\$ 75.00	\$ 8502.00					 No Sidewalk on Block			
25 Missing Sidewalk Gaps (Approx.)	0 LF	25 Missing Sidewalk Gaps (Approx.)	0 LF	\$ 41.67	\$ 0.00								
26 Poor Surface Condition (Approx.)	0 LF	26 Poor Surface Condition (Approx.)	0 LF	\$ 41.67	\$ 0.00								
27 Buried Sidewalk (Approx.)	0 LF	27 Buried Sidewalk (Approx.)	0 LF	\$ 41.67	\$ 0.00								
		Sidewalk SubTotal:			\$ 22293.00								

▲ Sidewalk Joint Gap (Excluded)***

▲ Sidewalk Joint Gap

■ Miscellaneous Obstruction

■ Miscellaneous Obstruction

■ Missing Sidewalk Obstruction

■ Missing Sidewalk Obstruction

■ Other Obstruction

■ Other Obstruction

■ Pole Post Hydrant Obstruction

■ Pole Post Hydrant Obstruction

■ Ponding Obstruction

■ Ponding Obstruction

■ Sidewalk Joint Obstruction

■ Sidewalk Joint Obstruction

■ Sign Obstruction

■ Sign Obstruction

■ Storm Grate Obstruction

■ Storm Grate Obstruction

■ Transit Obstruction

■ Transit Obstruction

■ Traffic Obstruction

■ Traffic Obstruction

■ Tree Obstruction

■ Tree Obstruction

■ Utility Obstruction

■ Utility Obstruction

■ Vegetation Obstruction - Low

■ Vegetation Obstruction - Low

■ Vegetation Obstruction - Overhead

■ Vegetation Obstruction - Overhead

■ Sidewalk Collection Path

■ Sidewalk Collection Path

■ Adjacent Sidewalk Collection Path

■ Adjacent Sidewalk Collection Path

■ Buried Sidewalk

■ Buried Sidewalk

■ Sidewalk Not Surveyed

■ Sidewalk Not Surveyed

■ Missing Sidewalk Gap

■ Missing Sidewalk Gap

■ No Sidewalk on Block

■ No Sidewalk on Block

● Heavings < 1" (Excluded)***

● Heavings < 1"

● Heavings ≥ 1" (Excluded)***

● Heavings ≥ 1"

● Uneven Heaving (Excluded)***

● Uneven Heaving

● Heaving Clusters (Excluded)

● Heaving Clusters

▲ Sidewalk Joint Gap (Excluded)***

▲ Sidewalk Joint Gap

▲ Miscellaneous Obstruction

▲ Miscellaneous Obstruction

▲ Missing Sidewalk Obstruction

▲ Missing Sidewalk Obstruction

▲ Other Obstruction

▲ Other Obstruction

▲ Pole Post Hydrant Obstruction

▲ Pole Post Hydrant Obstruction

▲ Ponding Obstruction

▲ Ponding Obstruction

▲ Sidewalk Joint Obstruction

▲ Sidewalk Joint Obstruction

▲ Sign Obstruction

▲ Sign Obstruction

▲ Storm Grate Obstruction

▲ Storm Grate Obstruction

▲ Transit Obstruction

▲ Transit Obstruction

▲ Traffic Obstruction

▲ Traffic Obstruction

▲ Tree Obstruction

▲ Tree Obstruction

▲ Utility Obstruction

▲ Utility Obstruction

▲ Vegetation Obstruction - Low

▲ Vegetation Obstruction - Low

▲ Vegetation Obstruction - Overhead

▲ Vegetation Obstruction - Overhead

▲ Sidewalk Collection Path

▲ Sidewalk Collection Path

▲ Adjacent Sidewalk Collection Path

▲ Adjacent Sidewalk Collection Path

▲ Buried Sidewalk

▲ Buried Sidewalk

▲ Sidewalk Not Surveyed

▲ Sidewalk Not Surveyed

▲ Missing Sidewalk Gap

▲ Missing Sidewalk Gap

▲ No Sidewalk on Block

▲ No Sidewalk on Block

■ Commercial Entrance (within slope violation)

■ Commercial Entrance

■ Residential Entrance (within slope violation)

■ Residential Entrance

■ Cross Slope

■ Cross Slope

■ Running Slope

■ Running Slope

*Note: ADA pedestrian issues have been identified and quantified in the ADA Survey Summary. There are instances where multiple issues can be resolved with a single corrective measure. The ADA Compliance Cost Estimate reflects the best estimation of quantities and cost to resolve all identified ADA issues.

**Note: Additional investigation may be warranted when sidewalk running slope issues exist within the right-of-way.

***Note: Excluded items are violations that occur in areas with slope violations and have been excluded from the cost estimate.