


Intersection ID: 8141	Main Street: CROSSRIDGE_RD	Cross Street: RUNNING_DEER_RD	Location:	E
ADA ID: 0033DD39E09D	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 8.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance								
	Possible Solutions:		Remove & Replace Entire Ramp.			Compliance	Description	Data	Compliance	Description	Data
						N/A	Ramp Length (in)	98.0	Yes	Ramp Slope (%)	6.1
						No	Ramp Width (in)	46.0	Yes	Ramp XSlope (%)	1.7
						N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
						N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
						N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
						N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
						N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
						N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
						N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:		N/A			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
PROW/ADA:		Not Found, R304.5.1			N/A	Shared Landing?	N/A	N/A	Gutter Slope (%)	N/A	
					N/A	Gutter Ponding?	N/A	N/A	Gutter X Slope (%)	N/A	
					N/A	Gutter Lip Ht (in)	N/A	N/A	Painted X Walk2?	N/A	
					N/A	Painted X Walk1?	No	N/A	X Walk 2 Direction	N/A	
						X Walk 1 Direction	To W		X Walk 2 Width (in)	N/A	
					N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Slope (%)	N/A	
						X Walk 1 Slope (%)	3.8		X Walk 2 X Slope (%)	N/A	
						X Walk 1 X Slope (%)	0.1				
Street 1 Name		RUNNING DEER RD			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
Stop Condition-Street 2		StopSign				Road Slope (%)	N/A	N/A	Clear Space?	N/A	
Street 2 Name		N/A				Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
Stop Condition-Street 1		N/A			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
						Obstruction Type			Storm Grate/Utility Type		
							N/A			N/A	
								Yes	Surface Condition? (G/P)	Good	
Total Cost:		\$ 1850.00									

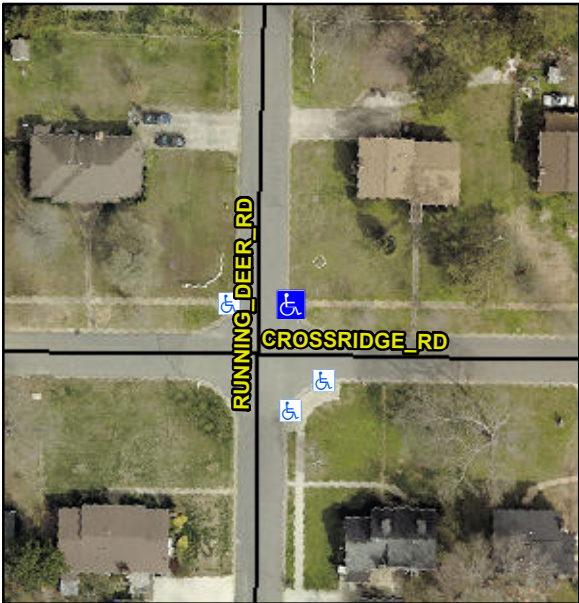