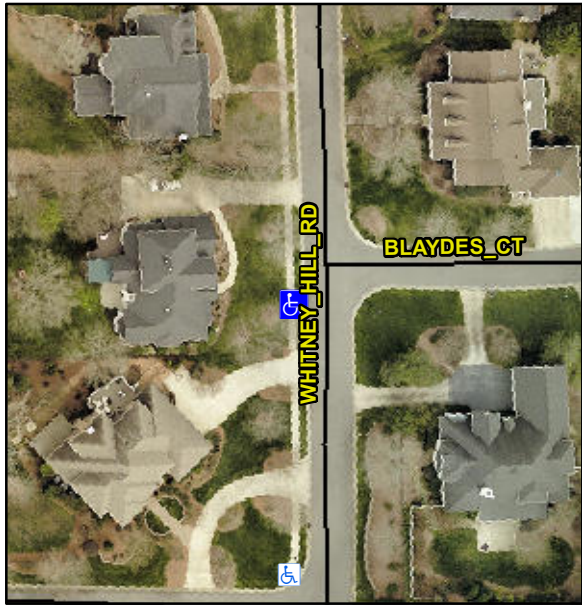


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: WHITNEY_HILL_RD	Cross Street: N/A	Location: W
ADA ID: 0057EC5D8386	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 25.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	94.0	Yes	Ramp Slope (%)	6.8
	Remove & Replace Gutter.		Yes	Ramp Width (in)	67.5	No	Ramp XSlope (%)	3.1
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	4.0	Yes	Flare Slope RT (%)	7.4
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
			No	Landing Length (in)	N/A	No	DWS Provided?	No
			No	Landing Width (in)	N/A	N/A	DWS Contrast?	No
			No	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			No	Landing X Slope (%)	N/A	N/A	DWS Full Width?	No
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
PROW/ADA:		Not Found, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305, R304.5.4	N/A	Shared Landing?	No			
			Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.2
			Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.3
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To E		X Walk 2 Direction	N/A
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	4.4		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	2.0		X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	N/A	N/A	Clear Space?	Yes
				Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
				Obstruction Type			Storm Grate/Utility Type	
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good
			</					

