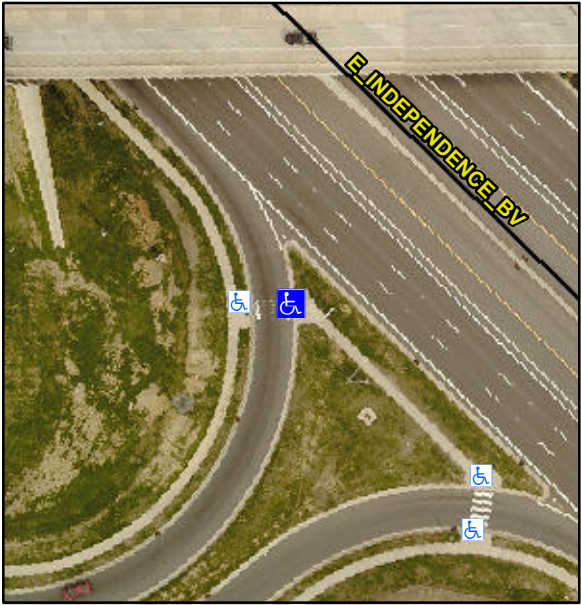


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10025447	Main Street: E_INDEPENDENCE_BV	Cross Street: N/A	Location: W
ADA ID: 014D24D547ED	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
	Possible Solutions:	<b>Compliance</b>	<b>Description</b>	<b>Data</b>	<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Entire Ramp.</b>	N/A	Ramp Length (in)	65.0	No	Ramp Slope (%)	8.8
		Yes	Ramp Width (in)	59.0	Yes	Ramp XSlope (%)	2.0
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	N/A			
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
			X Walk 1 Direction	To E		X Walk 2 Direction	N/A
		N/A	X Walk 1 Width (in)	119.0	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	4.8		X Walk 2 Slope (%)	N/A
			X Walk 1 X Slope (%)	1.9		X Walk 2 X Slope (%)	N/A
		N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
<p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>Not Found, R304.2.2</b></p>			Road Slope (%)	N/A	N/A	Clear Space?	N/A
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			Obstruction Type			Storm Grate/Utility Type	
					N/A		N/A
					Yes	Surface Condition? (G/P)	Good
Total Cost:		\$	1850.00				

