


| | | | | |
|------------------------|------------------------|-----------------------------|------------------------|--------------------|
| Intersection ID: 12618 | Main Street: E_5TH_ST | Cross Street: N_CALDWELL_ST | Location: | E |
| ADA ID: 0184F06BCA18 | Ramp Type: BlendTrans1 | Initial Pass/Fail: Pass | Overall Compliance: No | Severity Score: 20 |

| Codes/Mitigation Info/Possible Solution | Field Measurements/Component Compliance |
|---|---|
|---|---|

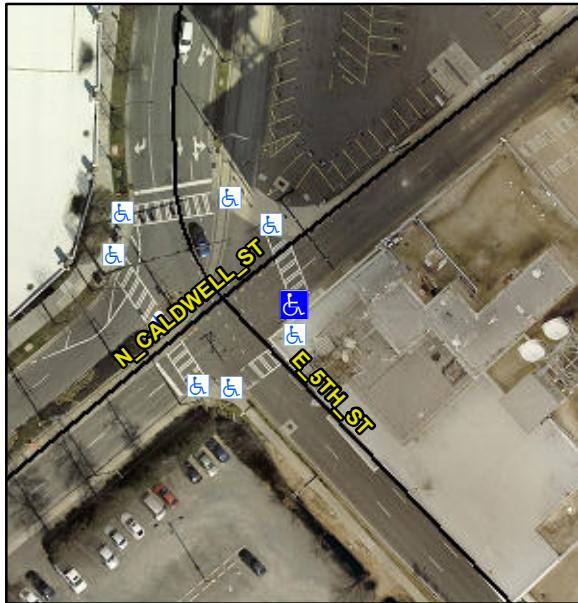

Possible Solutions:

**Remove & Replace Curb Slope and
Extend Ramp. Restripe Crosswalk.
Relocate Obstruction.**

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R207.1, R302.3, R402.2

| Compliance | Description | Data | Compliance | Description | Data |
|-----------------|-----------------------|--------|------------|-----------------------------|--------|
| N/A | Ramp Length (in) | 25.0 | Yes | BlendTrans Slope (%) | 2.1 |
| Yes | Ramp Width (in) | 48.0 | Yes | BlendTrans XSlope (%) | 1.9 |
| N/A | Flare Type LT | Sloped | N/A | Flare Type RT | Sloped |
| N/A | Flare Slope LT (%) | 3.4 | N/A | Flare Slope RT (%) | 5.8 |
| N/A | Flare Traversable LT? | No | N/A | Flare Traversable RT? | No |
| Yes | Landing Length (in) | 56.0 | Yes | DWS Provided? | Yes |
| Yes | Landing Width (in) | 48.0 | Yes | DWS Contrast? | Yes |
| Yes | Landing Slope (%) | 1.9 | Yes | DWS Length (in) | 25.0 |
| Yes | Landing X Slope (%) | 1.7 | Yes | DWS Full Width? | Yes |
| N/A | Landing Curb? (Y/N) | No | Yes | DWS Offset (in) | 0.0 |
| N/A | Shared Landing? | No | | | |
| Yes | Gutter Ponding? | No | Yes | Gutter Slope (%) | 3.2 |
| Yes | Gutter Lip Ht (in) | 0.0 | Yes | Gutter X Slope (%) | 0.1 |
| N/A | Painted X Walk1? | Yes | N/A | Painted X Walk2? | N/A |
| | X Walk 1 Direction | To N | | X Walk 2 Direction | N/A |
| | X Walk 1 Width (in) | 115.0 | | X Walk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 2.8 | | X Walk 2 Slope (%) | N/A |
| | X Walk 1 X Slope (%) | 0.1 | | X Walk 2 X Slope (%) | N/A |
| No | Ramp inside XWalk1? | No | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | 0.1 | | Clear Space? | Yes |
| | Road X Slope (%) | 2.8 | N/A | Clear Space to XWalk (in) | N/A |
| No | Any Obstructions? | Yes | Yes | Storm Grate/Utility Hazard? | No |
| | Obstruction Type | | | Storm Grate/Utility Type | |
| POWER POLE 36.0 | | | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |
| | | | No | Curb Slope (%) | 10.8 |

Total Cost: \$ 3200.00

