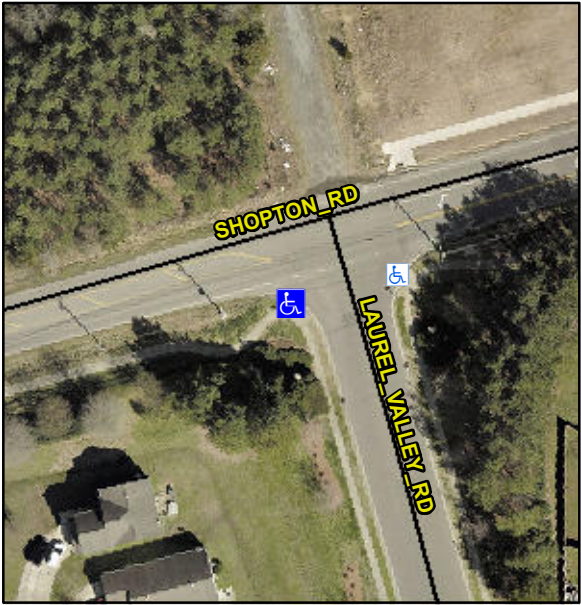


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 45980	Main Street: LAUREL_VALLEY_RD	Cross Street: SHOPTON_RD	Location: SW
ADA ID: 01B3D398E4AA	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 46.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
 <p>Street 1 Name LAUREL VALLEY RD</p> <p>Stop Condition-Street 2 StopSign</p> <p>Street 2 Name SHOPTON RD</p> <p>Stop Condition-Street 1 None</p>	<p>Possible Solutions:</p> <p><b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b></p> <p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>Not Found, R304.5.1, R304.2.2, R304.5.3</b></p> <p>Total Cost: \$ 3200.00</p>	Compliance	Description	Data	
		N/A	Ramp Length (in)	47.0	No
		No	Ramp Width (in)	42.0	No
		N/A	Flare Type LT	N/A	N/A
		N/A	Flare Slope LT (%)	N/A	N/A
		N/A	Flare Traversable LT?	N/A	N/A
		N/A	Landing Length (in)	N/A	N/A
		N/A	Landing Width (in)	N/A	N/A
		N/A	Landing Slope (%)	N/A	N/A
		N/A	Landing X Slope (%)	N/A	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A
		N/A	Shared Landing?	N/A	
		N/A	Gutter Ponding?	N/A	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A
		N/A	Painted X Walk1?	No	N/A
			X Walk 1 Direction	To E	
		N/A	X Walk 1 Width (in)	N/A	N/A
			X Walk 1 Slope (%)	7.8	
			X Walk 1 X Slope (%)	4.8	
		N/A	Ramp inside XWalk1?	N/A	N/A
			Road Slope (%)	6.7	N/A
			Road X Slope (%)	5.6	N/A
		N/A	Any Obstructions?	N/A	N/A
			Obstruction Type		
				N/A	N/A
				Yes	Surface Condition? (G/P) Good

