


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 3675		Main Street: DAVIS_LAKE_PY		Cross Street: ELK_RUN_LN		Location: W																																																																																																																																																											
ADA ID: 0218DAAF2135		Ramp Type: Directional1		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 50																																																																																																																																																									
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance																																																																																																																																																													
<div></div> <div>Street 1 NameELK RUN LN</div> <div>Stop Condition-Street 1StopSign</div> <div>Street 2 NameN/A</div> <div>Stop Condition-Street 2N/A</div>				<div>Possible Solutions:</div> <div>Remove & Replace Entire Ramp.</div> <div>Surveyor Notes:</div> <div>ASP SURFACE</div> <div>PROW/ADA:</div> <div>R304.2.2, R304.5.3</div>		<table><thead><tr><th>Compliance</th><th>Description</th><th>Data</th><th>Compliance</th><th>Description</th><th>Data</th></tr></thead><tbody><tr><td>N/A</td><td>Ramp Length (in)</td><td>36.0</td><td>N/A</td><td>Grade Break?</td><td>N/A</td></tr><tr><td>Yes</td><td>Ramp Width (in)</td><td>48.0</td><td>N/A</td><td>Grade Break Slope (%)</td><td>0.0</td></tr><tr><td>No</td><td>Ramp Slope (%)</td><td>20.0</td><td>N/A</td><td>Grade Break XSlope (%)</td><td>0.0</td></tr><tr><td>No</td><td>Ramp XSlope (%)</td><td>8.3</td><td></td><td></td><td></td></tr><tr><td>N/A</td><td>Flare Type LT</td><td>N/A</td><td>N/A</td><td>Flare Type RT</td><td>N/A</td></tr><tr><td>N/A</td><td>Flare Slope LT (%)</td><td>N/A</td><td>N/A</td><td>Flare Slope RT (%)</td><td>0.0</td></tr><tr><td>N/A</td><td>Flare Traversable LT?</td><td>N/A</td><td>N/A</td><td>Flare Traversable RT?</td><td>N/A</td></tr><tr><td>N/A</td><td>Landing Length (in)</td><td>0.0</td><td>N/A</td><td>DWS Provided?</td><td>N/A</td></tr><tr><td>N/A</td><td>Landing Width (in)</td><td>0.0</td><td>N/A</td><td>DWS Contrast?</td><td>N/A</td></tr><tr><td>N/A</td><td>Landing Slope (%)</td><td>0.0</td><td>N/A</td><td>DWS Length (in)</td><td>N/A</td></tr><tr><td>N/A</td><td>Landing X Slope (%)</td><td>0.0</td><td>N/A</td><td>DWS Full Width?</td><td>N/A</td></tr><tr><td>N/A</td><td>Landing Curb? (Y/N)</td><td>N/A</td><td>N/A</td><td>DWS Offset LT (in)</td><td>N/A</td></tr><tr><td>N/A</td><td>Shared Landing?</td><td>N/A</td><td>N/A</td><td>DWS Offset RT (in)</td><td>N/A</td></tr><tr><td>N/A</td><td>Gutter Ponding?</td><td>0.0</td><td>N/A</td><td>Gutter Slope (%)</td><td>N/A</td></tr><tr><td>N/A</td><td>Gutter Lip Ht (in)</td><td>0.0</td><td>N/A</td><td>Gutter X Slope (%)</td><td>N/A</td></tr><tr><td>N/A</td><td>Painted X Walk1?</td><td>No</td><td></td><td>Road Slope (%)</td><td>2.3</td></tr><tr><td></td><td>X Walk 1 Direction</td><td>To SE</td><td></td><td>Road X Slope (%)</td><td>1.7</td></tr><tr><td></td><td>X Walk 1 Width (in)</td><td>N/A</td><td></td><td>Clear Space?</td><td>N/A</td></tr><tr><td></td><td>X Walk 1 Slope (%)</td><td>2.3</td><td>N/A</td><td>Clear Space to XWalk (in)</td><td>N/A</td></tr><tr><td></td><td>X Walk 1 X Slope (%)</td><td>1.7</td><td>N/A</td><td>Storm Grate/Utility Hazard?</td><td>N/A</td></tr><tr><td>N/A</td><td>Ramp inside XWalk1?</td><td>N/A</td><td></td><td>Storm Grate/Utility Type</td><td></td></tr><tr><td>N/A</td><td>Any Obstructions?</td><td>N/A</td><td></td><td></td><td>N/A</td></tr><tr><td></td><td>Obstruction Type</td><td></td><td>Yes</td><td>Surface Condition? (G/P)</td><td>Good</td></tr><tr><td></td><td></td><td></td><td>N/A</td><td>Curb Slope (%)</td><td>21.9</td></tr></tbody></table>						Compliance	Description	Data	Compliance	Description	Data	N/A	Ramp Length (in)	36.0	N/A	Grade Break?	N/A	Yes	Ramp Width (in)	48.0	N/A	Grade Break Slope (%)	0.0	No	Ramp Slope (%)	20.0	N/A	Grade Break XSlope (%)	0.0	No	Ramp XSlope (%)	8.3				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A	N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A	N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A	N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A	N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A	N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A	N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A	N/A	Painted X Walk1?	No		Road Slope (%)	2.3		X Walk 1 Direction	To SE		Road X Slope (%)	1.7		X Walk 1 Width (in)	N/A		Clear Space?	N/A		X Walk 1 Slope (%)	2.3	N/A	Clear Space to XWalk (in)	N/A		X Walk 1 X Slope (%)	1.7	N/A	Storm Grate/Utility Hazard?	N/A	N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type		N/A	Any Obstructions?	N/A			N/A		Obstruction Type		Yes	Surface Condition? (G/P)	Good				N/A	Curb Slope (%)	21.9
Compliance	Description	Data	Compliance	Description	Data																																																																																																																																																												
N/A	Ramp Length (in)	36.0	N/A	Grade Break?	N/A																																																																																																																																																												
Yes	Ramp Width (in)	48.0	N/A	Grade Break Slope (%)	0.0																																																																																																																																																												
No	Ramp Slope (%)	20.0	N/A	Grade Break XSlope (%)	0.0																																																																																																																																																												
No	Ramp XSlope (%)	8.3																																																																																																																																																															
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A																																																																																																																																																												
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0																																																																																																																																																												
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A																																																																																																																																																												
N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A																																																																																																																																																												
N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A																																																																																																																																																												
N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A																																																																																																																																																												
N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A																																																																																																																																																												
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A																																																																																																																																																												
N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A																																																																																																																																																												
N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A																																																																																																																																																												
N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A																																																																																																																																																												
N/A	Painted X Walk1?	No		Road Slope (%)	2.3																																																																																																																																																												
	X Walk 1 Direction	To SE		Road X Slope (%)	1.7																																																																																																																																																												
	X Walk 1 Width (in)	N/A		Clear Space?	N/A																																																																																																																																																												
	X Walk 1 Slope (%)	2.3	N/A	Clear Space to XWalk (in)	N/A																																																																																																																																																												
	X Walk 1 X Slope (%)	1.7	N/A	Storm Grate/Utility Hazard?	N/A																																																																																																																																																												
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type																																																																																																																																																													
N/A	Any Obstructions?	N/A			N/A																																																																																																																																																												
	Obstruction Type		Yes	Surface Condition? (G/P)	Good																																																																																																																																																												
			N/A	Curb Slope (%)	21.9																																																																																																																																																												
Total Cost:		\$	1600.00																																																																																																																																																														

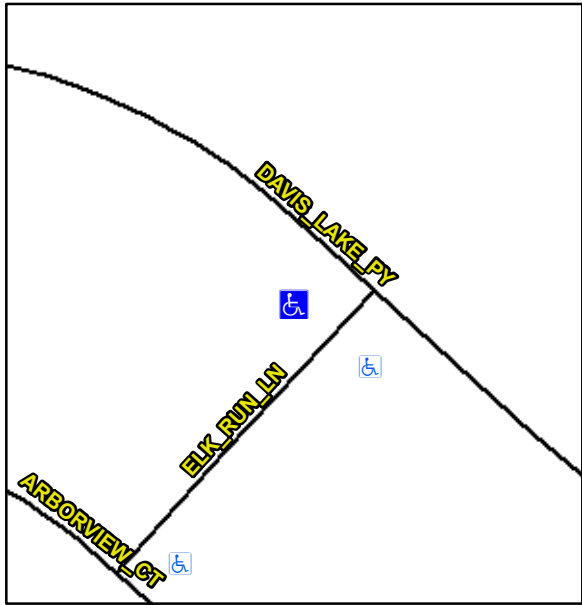