

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: PERIMETER_PY	Cross Street: N/A	Location: SW
ADA ID: 023AA9BF14EC	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

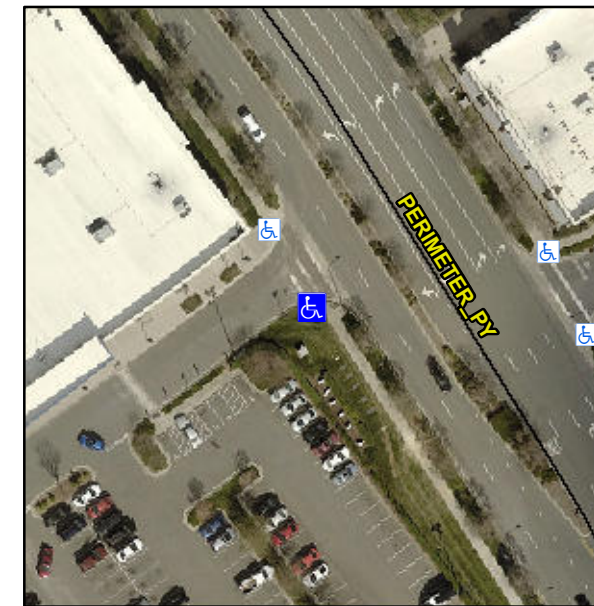

Possible Solutions:

**Remove & Replace Landing.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.1, R304.2.2-Perp, R304.3.2-
Para, R302.7, R304.5.4**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	72.0	Yes	Ramp Slope (%)	7.5
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	7.3	N/A	Flare Slope RT (%)	8.9
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	30.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.1	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	0.7	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	6.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.7
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To E		X Walk 2 Direction	To N
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	71.0
	X Walk 1 Slope (%)	4.2		X Walk 2 Slope (%)	4.6
	X Walk 1 X Slope (%)	2.9		X Walk 2 X Slope (%)	3.3
N/A	Ramp inside XWalk1?	N/A	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	0.0	N/A	Clear Space?	Yes
	Road X Slope (%)	4.3	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 1250.00

Street 1 Name PERIMETER PY
Stop Condition-Street 2 None
Street 2 Name ENTRANCE
Stop Condition-Street 1 StopSign

