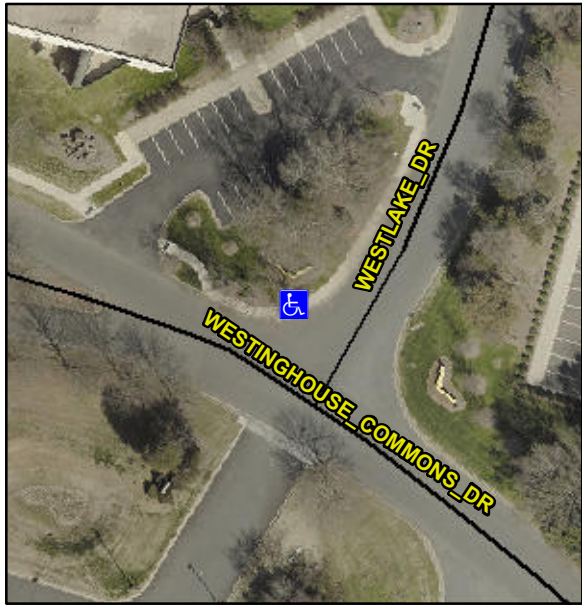


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 20961	Main Street: WESTINGHOUSE COMMONS DR	Cross Street: WESTLAKE DR	Location:	N
ADA ID: 02CFD0B51D7F	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 15

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.		N/A	Ramp Length (in)	60.0	Yes	Ramp Slope (%)	6.3
			Yes	Ramp Width (in)	59.0	Yes	Ramp XSlope (%)	0.1
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	3.0	Yes	Flare Slope RT (%)	4.6
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
	Surveyor Notes:		No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
			No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
			No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
			No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A			Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0	
PROW/ADA:		N/A	Shared Landing?	No				
		Yes	Gutter Ponding?	No	No	Gutter Slope (%)	8.0	
		Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.1	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
			X Walk 1 Direction	To SW		X Walk 2 Direction	To SE	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	1.6		X Walk 2 Slope (%)	2.5	
			X Walk 1 X Slope (%)	2.5		X Walk 2 X Slope (%)	1.7	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	0.6	N/A	Clear Space?	Yes	
			Road X Slope (%)	3.2	N/A	Clear Space to XWalk (in)	N/A	
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
			Obstruction Type			Storm Grate/Utility Type		
				N/A			N/A	
					Yes	Surface Condition? (G/P)	Good	

