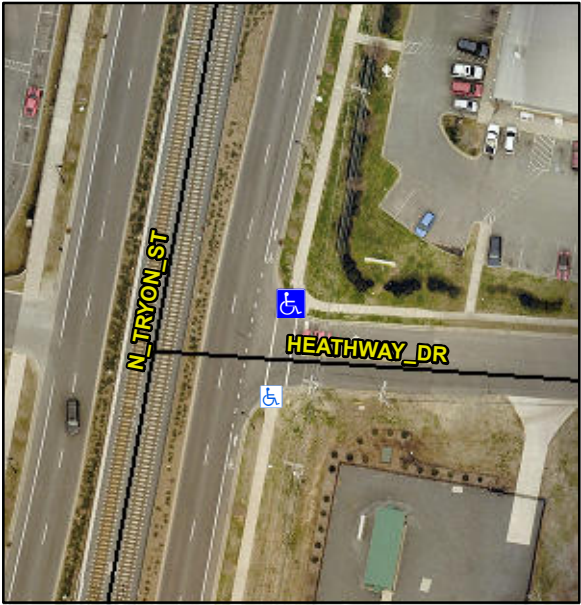


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 7613	Main Street: N_TRYON_ST	Cross Street: HEATHWAY_DR	Location: NE
ADA ID: 0319D89911E7	Ramp Type: Combination2	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 1.25	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Entire Ramp.</b>		N/A	Ramp Length LT (in)	13.0
			Yes	Ramp Width LT (in)	74.0
			Yes	Ramp Slope LT (%)	5.6
			No	Ramp XSlope LT (%)	2.6
			N/A	Ramp Length (in)	58.0
			Yes	Ramp Width (in)	48.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
<p>Surveyor Notes:</p> <p><b>RT RP &lt; 5%</b></p> <p>PROW/ADA:</p> <p><b>R304.5.3</b></p>			N/A	Ramp Length RT (in)	39.5
			N/A	Ramp Width RT (in)	70.0
			N/A	Ramp Slope RT (%)	1.8
			N/A	Ramp XSlope RT (%)	1.7
			Yes	Ramp Slope (%)	6.4
			Yes	Ramp XSlope (%)	0.2
			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
<p>Street 1 Name</p> <p>Stop Condition-Street 1</p> <p>Street 2 Name</p> <p>Stop Condition-Street 2</p>			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Gutter Slope (%)	N/A
			N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk2?	N/A
			To S	X Walk 2 Direction	N/A
			N/A	X Walk 2 Width (in)	N/A
			0.8	X Walk 2 Slope (%)	N/A
<p>Total Cost:</p> <p>\$ 1600.00</p>			2.8	X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk2?	N/A
			N/A	Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	2.6

