


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 18365	Main Street: TRYON_ST	Cross Street: TYVOLA_RD	Location: SW
ADA ID: 032A2CCBAD1C	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution			Severity Score: 5
			Field Measurements/Component Compliance

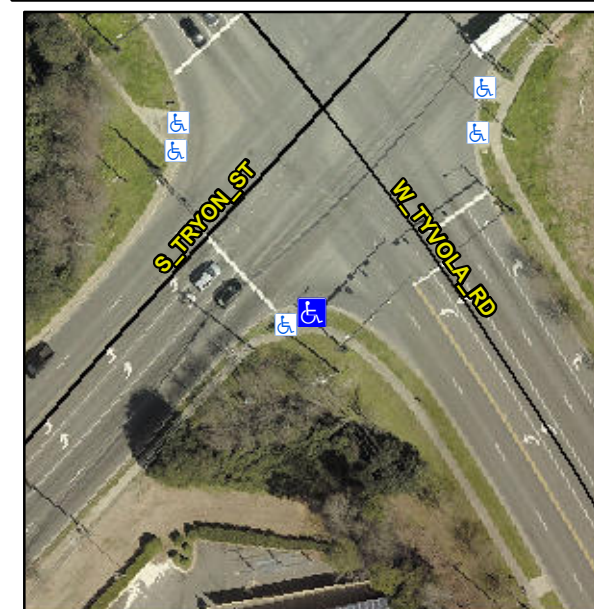

Possible Solutions:

Remove & Replace Detectable Warning System. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R305.2, R304.5.4, R304.5.3

Total Cost: \$ 1550.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	99.0	Yes	Ramp Slope (%)	5.4
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	9.8	Yes	Flare Slope RT (%)	6.4
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	56.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.2	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.4	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.0
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.2		X Walk 2 Slope (%)	0.8
	X Walk 1 X Slope (%)	1.9		X Walk 2 X Slope (%)	0.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.9	N/A	Clear Space?	Yes
	Road X Slope (%)	1.8	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name W TYVOLA RD
 Stop Condition-Street 2 Signal
 Street 2 Name S TRYON ST
 Stop Condition-Street 1 Signal

