


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 2959	Main Street: HARBURN_FOREST_DR	Cross Street: TUNSTON_LN	Location: SE
ADA ID: 038E5F498423	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 17.5	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

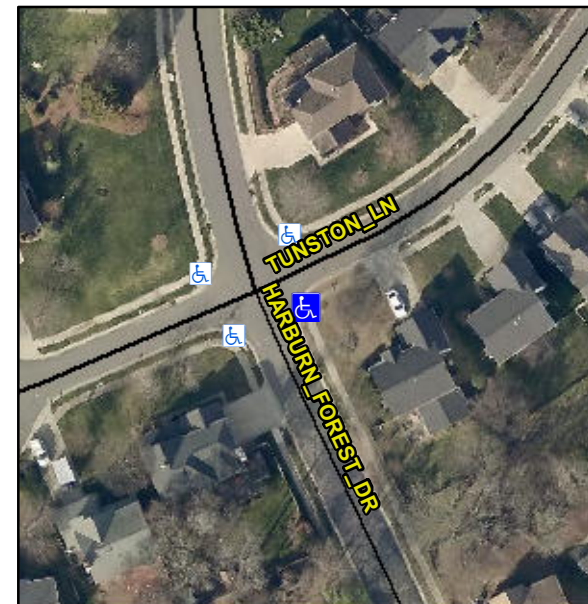

Possible Solutions:

**Install Detectable Warning System.
Grind Gutter Lip.**

Surveyor Notes:

N/A

PROW/ADA:

R305, R302.7.2

Street 1 Name	TUNSTON LN
Stop Condition-Street 2	StopSign
Street 2 Name	HARBURN FOREST DR
Stop Condition-Street 1	None

Total Cost: \$ **435.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	7.2
Yes	Ramp Width (in)	75.0	Yes	Ramp XSlope (%)	1.8
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	0.8	N/A	Flare Slope RT (%)	1.2
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.5	No	DWS Provided?	No
Yes	Landing Width (in)	75.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	1.7	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	0.1	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.9
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	1.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.6		X Walk 2 Slope (%)	7.8
	X Walk 1 X Slope (%)	7.6		X Walk 2 X Slope (%)	4.4
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.0	N/A	Clear Space?	Yes
	Road X Slope (%)	8.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

