


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 13853		Main Street: EUCLID_AV		Cross Street: MT_VERNON_AV		Location: S							
ADA ID: 04852636F3DA		Ramp Type: Directional1		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 35					
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance									
<div></div> <div>Possible Solutions:</div> <div>Remove & Replace Entire Ramp.</div> <div>Surveyor Notes:</div> <div>N/A</div> <div>PROW/ADA:</div> <div>R304.5.1, R304.2.2, R304.5.3</div> <div>Street 1 Name</div> <div>MT VERNON AV</div> <div>Stop Condition-Street 1</div> <div>StopSign</div> <div>Street 2 Name</div> <div>N/A</div> <div>Stop Condition-Street 2</div> <div>N/A</div>				Compliance	Description	Data	Compliance	Description	Data				
				N/A	Ramp Length (in)	92.0	N/A	Grade Break?	N/A				
				No	Ramp Width (in)	36.0	N/A	Grade Break Slope (%)	0.0				
				No	Ramp Slope (%)	12.1	N/A	Grade Break XSlope (%)	0.0				
				No	Ramp XSlope (%)	3.2							
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A				
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0				
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A				
				N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A				
				N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A				
				N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A				
				N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A				
				N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A				
				N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A				
				N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A				
				N/A	Gutter Lip Ht (in)	1.0	N/A	Gutter X Slope (%)	N/A				
				N/A	Painted X Walk1?	No		Road Slope (%)	5.0				
					X Walk 1 Direction	To NE		Road X Slope (%)	6.4				
					X Walk 1 Width (in)	N/A		Clear Space?	N/A				
					X Walk 1 Slope (%)	5.0	N/A	Clear Space to XWalk (in)	N/A				
					X Walk 1 X Slope (%)	6.4	N/A	Storm Grate/Utility Hazard?	N/A				
				N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type					
				N/A	Any Obstructions?	N/A			N/A				
					Obstruction Type		Yes	Surface Condition? (G/P)	Good				
							N/A	Curb Slope (%)	15.7				
				Total Cost:				\$	1600.00				

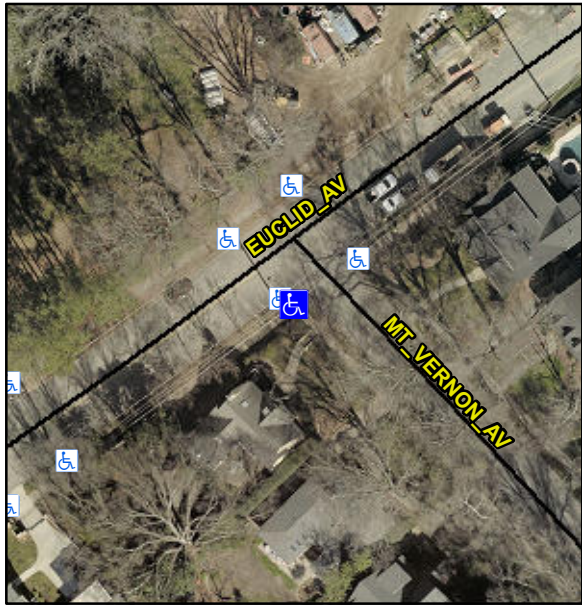