


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 21120	Main Street: RUTHERFORD_DR	Cross Street: SULKIRK_RD	Location: NE
ADA ID: 050BF3BE5177	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 17.5			

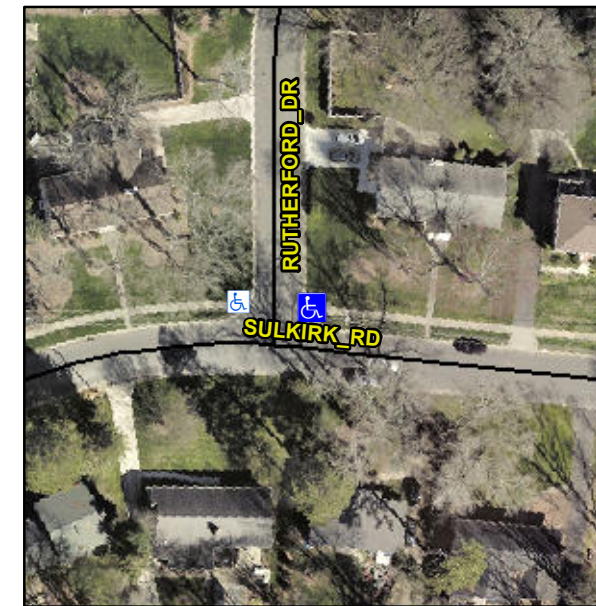

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.

Surveyor Notes:

VERIFIED GUTTER SLOPES AS CORRECT, LIP HEIGHT 2.0

PROW/ADA:

R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.1.4, R305.2, R302.7, R302.7.2

Total Cost: \$ 3400.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	52.0	Yes	Ramp Slope (%)	7.4
Yes	Ramp Width (in)	87.0	Yes	Ramp XSlope (%)	1.6
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	2.4	N/A	Flare Slope RT (%)	2.5
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	51.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	44.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.8	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.4	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	8.5
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	0.8
No	Gutter Lip Ht (in)	2.0	Yes	Gutter X Slope (%)	0.7
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To W		X Walk 2 Direction	To S
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.2		X Walk 2 Slope (%)	0.7
	X Walk 1 X Slope (%)	3.0		X Walk 2 X Slope (%)	0.4
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.9	N/A	Clear Space?	Yes
	Road X Slope (%)	0.3	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

