


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|  |  |                         |  |   |                       |                        |            |                             |      |
|--|--|-------------------------|--|---|-----------------------|------------------------|------------|-----------------------------|------|
| Intersection ID: 14648   |  | Main Street: EAST_BV    |  | Cross Street: LENNOX_AV                 |                       | Location: NE           |            |                             |      |
| ADA ID: 0524964FE81A   |  | Ramp Type: Directional1 |  | Initial Pass/Fail: Fail                 |                       | Overall Compliance: No |            | Severity Score: 12.5        |      |
| Codes/Mitigation Info/Possible Solution  |  |                         |  | Field Measurements/Component Compliance |                       |                        |            |                             |      |
| <div></div> <div>Street 1 NameEAST BV</div> <div>Stop Condition-Street 1None</div> <div>Street 2 NameN/A</div> <div>Stop Condition-Street 2N/A</div> <div>Possible Solutions:<br/><b>Remove &amp; Replace Entire Ramp.</b></div> <div>Surveyor Notes:<br/><b>N/A</b></div> <div>PROW/ADA:<br/><b>R304.2.2</b></div> <div>Total Cost:\$ 1600.00</div> |  |                         |  | Compliance                              | Description           | Data                   | Compliance | Description                 | Data |
|  |  |                         |  | N/A                                     | Ramp Length (in)      | 64.0                   | N/A        | Grade Break?                | N/A  |
|  |  |                         |  | Yes                                     | Ramp Width (in)       | 73.0                   | N/A        | Grade Break Slope (%)       | 0.0  |
|  |  |                         |  | No                                      | Ramp Slope (%)        | 8.7                    | N/A        | Grade Break XSlope (%)      | 0.0  |
|  |  |                         |  | Yes                                     | Ramp XSlope (%)       | 1.7                    |            |                             |      |
|  |  |                         |  | N/A                                     | Flare Type LT         | N/A                    | N/A        | Flare Type RT               | N/A  |
|  |  |                         |  | N/A                                     | Flare Slope LT (%)    | N/A                    | N/A        | Flare Slope RT (%)          | 0.0  |
|  |  |                         |  | N/A                                     | Flare Traversable LT? | N/A                    | N/A        | Flare Traversable RT?       | N/A  |
|  |  |                         |  | N/A                                     | Landing Length (in)   | 0.0                    | N/A        | DWS Provided?               | N/A  |
|  |  |                         |  | N/A                                     | Landing Width (in)    | 0.0                    | N/A        | DWS Contrast?               | N/A  |
|  |  |                         |  | N/A                                     | Landing Slope (%)     | 0.0                    | N/A        | DWS Length (in)             | N/A  |
|  |  |                         |  | N/A                                     | Landing X Slope (%)   | 0.0                    | N/A        | DWS Full Width?             | N/A  |
|  |  |                         |  | N/A                                     | Landing Curb? (Y/N)   | N/A                    | N/A        | DWS Offset LT (in)          | N/A  |
|  |  |                         |  | N/A                                     | Shared Landing?       | N/A                    | N/A        | DWS Offset RT (in)          | N/A  |
|  |  |                         |  | N/A                                     | Gutter Ponding?       | 0.0                    | N/A        | Gutter Slope (%)            | N/A  |
|  |  |                         |  | N/A                                     | Gutter Lip Ht (in)    | 0.0                    | N/A        | Gutter X Slope (%)          | N/A  |
|  |  |                         |  | N/A                                     | Painted X Walk1?      | Yes                    |            | Road Slope (%)              | 3.9  |
|  |  |                         |  |   | X Walk 1 Direction    | To SW                  |            | Road X Slope (%)            | 1.0  |
|  |  |                         |  |   | X Walk 1 Width (in)   | 114.0                  |            | Clear Space?                | N/A  |
|  |  |                         |  |   | X Walk 1 Slope (%)    | 3.9                    | N/A        | Clear Space to XWalk (in)   | N/A  |
|  |  |                         |  |   | X Walk 1 X Slope (%)  | 1.0                    | N/A        | Storm Grate/Utility Hazard? | N/A  |
|  |  |                         |  | N/A                                     | Ramp inside XWalk1?   | Yes                    |            | Storm Grate/Utility Type    |      |
|  |  |                         |  | N/A                                     | Any Obstructions?     | N/A                    |            |                             | N/A  |
|  |  |                         |  |   | Obstruction Type      |                        | Yes        | Surface Condition? (G/P)    | Good |
|  |  |                         |  |   |                       |                        | N/A        | Curb Slope (%)              | 9.1  |

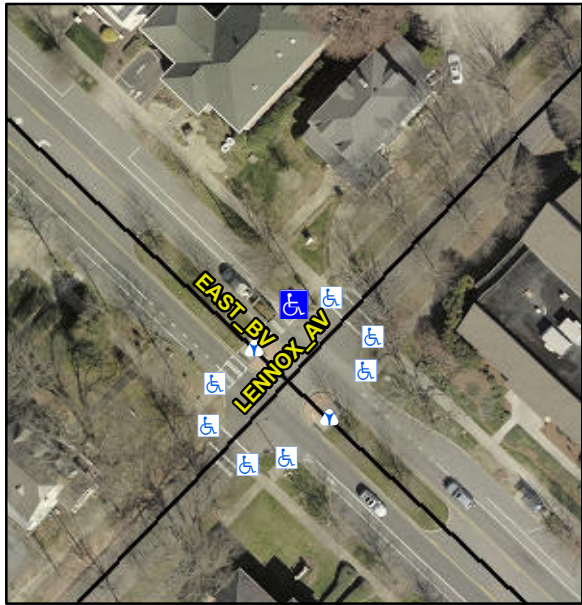