

Access Compliance Report Public Rights-of-Way (Curb Ramps)



N/A

Good

Surface Condition? (G/P)

Intersection ID: 16794 Main Street: HIGHBROOK DR **Cross Street: IDLEWILD RD** Location: SW ADA ID: 05F466A42CDF Ramp Type: PerpDiag Initial Pass/Fail: Fail **Overall Compliance: No Severity Score:** 37.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance




Street 1 Name Stop Condition-Street 2 Street 2 Name Stop Condition-Street 1 HIGHBROOK DR StopSign **IDLEWILD RD** None

Possible Solutions: Remove & Replace Curb Ramp With **Two New Directional Ramps or** Equivalent.

N/A

PROW/ADA:

Not Found, R304.2.2, R304.5.3

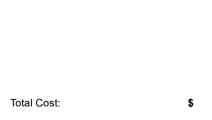

Compliance Description		Data	Compliance		Description	Data
N/A	Ramp Length (in)	60.0	No	Ram	Slope (%)	9.5
Yes	Ramp Width (in)	48.0	No	Ram	XSlope (%)	7.0
N/A	Flare Type LT	N/A	N/A	Flare	Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare	Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare	Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS	Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS	Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS	Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N/A
N/A	Shared Landing?	N/A				
N/A	Gutter Ponding?	N/A	N/A	Gutte	er Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutte	er X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Paint	ed X Walk2?	No
	X Walk 1 Direction	To E		X Wa	lk 2 Direction	To N
N/A	X Walk 1 Width (in)	N/A	N/A	X Wa	lk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.1		X Wa	lk 2 Slope (%)	3.4
	X Walk 1 X Slope (%)	4.3		X Wa	lk 2 X Slope (%)	6.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ram	o inside XWalk2?	N/A
	Road Slope (%)	7.2	N/A	Clear	Space?	N/A
	Road X Slope (%)	2.0	N/A	Clear	Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storn	n Grate/Utility Hazard?	N/A
	Obstruction Type		l	Storn	n Grate/Utility Type	







3200.00