


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 28184	Main Street: BLAKENEY_HEATH_RD	Cross Street: BLAKENEY_PROFESSIONAL_DR	Location: NW
ADA ID: 062932AB92CD	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 26.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

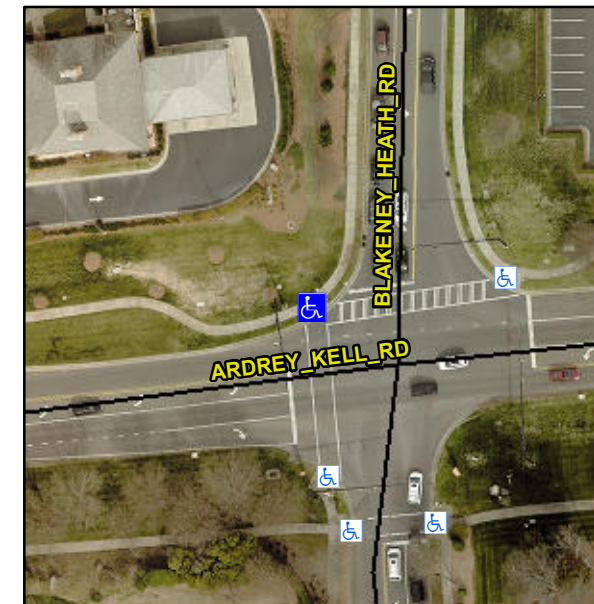

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**RT RP < 5%**

PROW/ADA:

**R304.3.2, R304.5.3**

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	57.0	N/A	Ramp Length RT (in)	54.0
Yes	Ramp Width LT (in)	57.0	Yes	Ramp Width RT (in)	57.0
No	Ramp Slope LT (%)	13.2	Yes	Ramp Slope RT (%)	2.5
No	Ramp XSlope LT (%)	2.5	No	Ramp XSlope RT (%)	3.1
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To S		X Walk 2 Direction	To E
N/A	X Walk 1 Width (in)	126.0	N/A	X Walk 2 Width (in)	113.0
	X Walk 1 Slope (%)	1.9		X Walk 2 Slope (%)	2.0
	X Walk 1 X Slope (%)	1.0		X Walk 2 X Slope (%)	0.1
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	Yes
	Road Slope (%)	1.8	N/A	Clear Space?	N/A
	Road X Slope (%)	0.6	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	3.4

