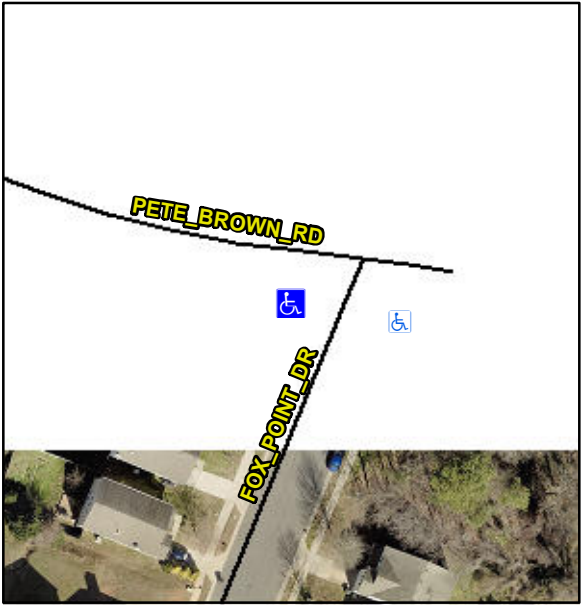


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 54470	Main Street: PETE_BROWN_RD	Cross Street: FOX_POINT_DR	Location: SW
ADA ID: 0690CF90AFC0	Ramp Type: Directional	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
 <p>Street 1 Name: FOX POINT DR</p> <p>Stop Condition-Street 1: StopSign</p> <p>Street 2 Name: N/A</p> <p>Stop Condition-Street 2: N/A</p>	Possible Solutions:	Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.	N/A	Ramp Length (in)	36.0	N/A	Grade Break?	N/A
		Yes	Ramp Width (in)	71.5	N/A	Grade Break Slope (%)	0.0
		No	Ramp Slope (%)	8.7	N/A	Grade Break XSlope (%)	0.0
		No	Ramp XSlope (%)	2.2			
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
		N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
		N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No		Road Slope (%)	1.6
			X Walk 1 Direction	To NE		Road X Slope (%)	4.4
			X Walk 1 Width (in)	N/A		Clear Space?	N/A
			X Walk 1 Slope (%)	1.6	N/A	Clear Space to XWalk (in)	N/A
			X Walk 1 X Slope (%)	4.4	N/A	Storm Grate/Utility Hazard?	N/A
		N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
		N/A	Any Obstructions?	N/A			N/A
			Obstruction Type		Yes	Surface Condition? (G/P)	Good
					N/A	Curb Slope (%)	N/A
Total Cost:		\$	1600.00				

