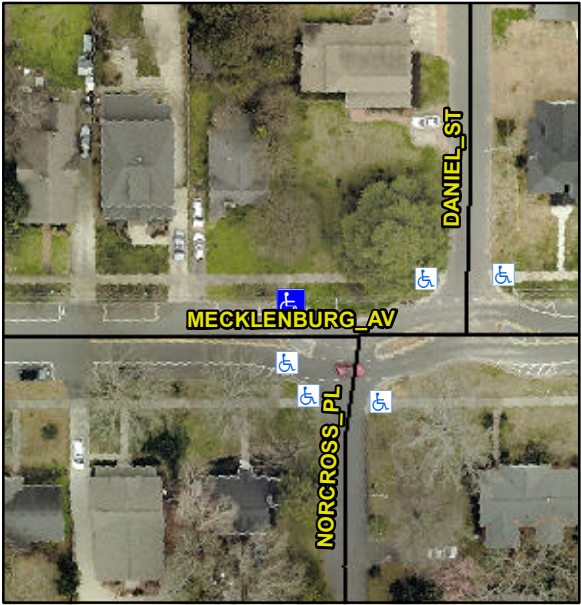


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11799	Main Street: MECKLENBURG_AV	Cross Street: NORCROSS_PL	Location: NW
ADA ID: 06F1FF36B805	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Landing. Remove & Replace Gutter.		Compliance	Description	Data
	Surveyor Notes:		Yes	Ramp Length (in)	114.0
	N/A		Yes	Ramp Width (in)	58.5
	PROW/ADA:		Yes	Flare Type LT	Curbed_NoWalkSurface
	R304.2.2-Perp, R304.3.2-Para, R304.5.3		Yes	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	No
			Yes	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	No
			Yes	Landing Length (in)	61.0
			Yes	Landing Width (in)	61.0
			Yes	DWS Provided?	Yes
			No	DWS Contrast?	Yes
			Yes	Landing Slope (%)	2.7
			Yes	DWS Length (in)	24.0
			No	DWS Full Width?	Yes
			Yes	DWS Offset (in)	0.0
			No	Landing X Slope (%)	3.0
			N/A	Landing Curb? (Y/N)	No
			Yes	Shared Landing?	No
			Yes	Gutter Ponding?	No
			Yes	Gutter Slope (%)	1.2
			No	Gutter Lip Ht (in)	0.0
			No	Gutter X Slope (%)	3.3
			N/A	Painted X Walk1?	N/A
			N/A	Painted X Walk2?	N/A
			N/A	X Walk 1 Direction	To S
			N/A	X Walk 2 Direction	N/A
			N/A	X Walk 1 Width (in)	N/A
			N/A	X Walk 2 Width (in)	N/A
			N/A	X Walk 1 Slope (%)	3.4
			N/A	X Walk 2 Slope (%)	N/A
			N/A	X Walk 1 X Slope (%)	1.5
			N/A	X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A
			N/A	Ramp inside XWalk2?	N/A
			N/A	Road Slope (%)	N/A
			N/A	Clear Space?	Yes
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Storm Grate/Utility Hazard?	No
			Yes	Storm Grate/Utility Type	
			No	Obstruction Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 1250.00

