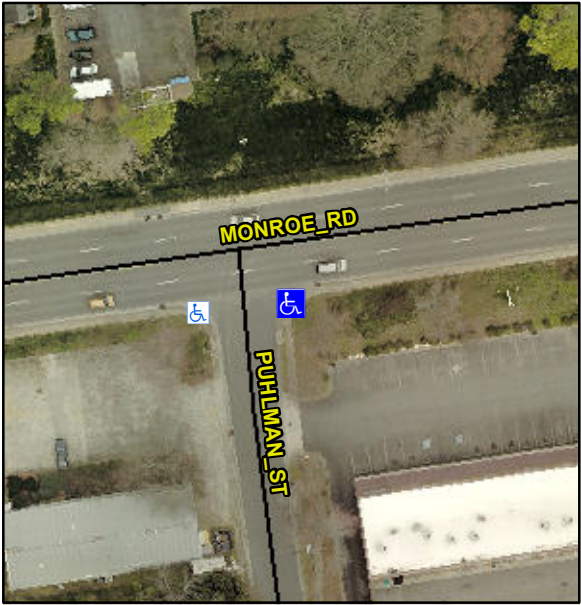


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: MONROE_RD	Cross Street: PUHLMAN_ST	Location: SE
ADA ID: 06F79B78A54F	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 46.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	62.0
			No	Ramp Width (in)	39.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
<p>Surveyor Notes:</p> <p>N/A</p>			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To N
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	2.3
				X Walk 1 X Slope (%)	0.5
			N/A	Ramp inside XWalk1?	N/A
<p>PROW/ADA:</p> <p>Not Found, R304.5.1, R304.2.2, R304.5.3</p>			N/A	Road Slope (%)	2.9
				Road X Slope (%)	3.9
			N/A	Any Obstructions?	N/A
				Obstruction Type	
<p>Total Cost:</p> <p>\$ 3200.00</p>			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	
<p>Street 1 Name</p> <p>Stop Condition-Street 2</p> <p>Street 2 Name</p> <p>Stop Condition-Street 1</p>					
<p>MONROE RD</p> <p>None</p> <p>PUHLMAN ST</p> <p>StopSign</p>					
<p>Yes</p> <p>Surface Condition? (G/P)</p> <p>Good</p>					

