

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 13531	Main Street: REMOUNT_RD	Cross Street: WEST_BV	Location: SW
ADA ID: 07F0004BF84C	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 10	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

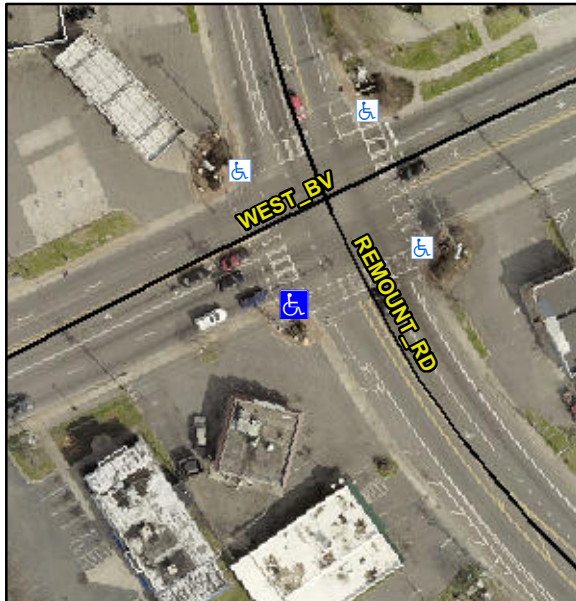

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	64.0	Yes	Ramp Slope (%)	5.4
Yes	Ramp Width (in)	63.5	Yes	Ramp XSlope (%)	1.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	1.6	Yes	Flare Slope RT (%)	4.4
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	72.0	No	DWS Provided?	No
Yes	Landing Width (in)	63.5	N/A	DWS Contrast?	No
No	Landing Slope (%)	2.2	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	3.5	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.2
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.6
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To E		X Walk 2 Direction	To N
N/A	X Walk 1 Width (in)	111.0	N/A	X Walk 2 Width (in)	110.0
	X Walk 1 Slope (%)	1.1		X Walk 2 Slope (%)	3.1
	X Walk 1 X Slope (%)	2.6		X Walk 2 X Slope (%)	1.6
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	2.0	N/A	Clear Space?	Yes
	Road X Slope (%)	0.1	Yes	Clear Space to XWalk (in)	90.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 3200.00

