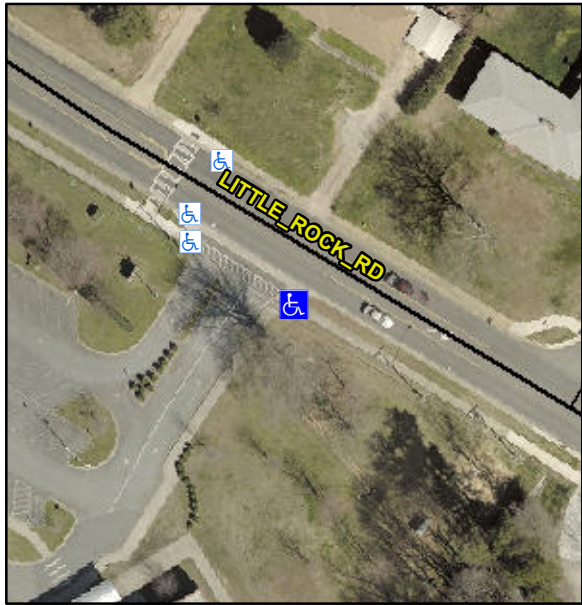


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: N/A	Main Street: LITTLE ROCK RD	Cross Street: N/A	Location: S
ADA ID: 08325886692B	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 10.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	100.0	Yes	Ramp Slope (%)	5.5
			Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	3.0
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	9.0	Yes	Flare Slope RT (%)	0.7
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
			No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
			No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
			No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.5
			No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.5
PROW/ADA:		Not Found, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3	N/A	Shared Landing?	No			
			Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.8
			Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	2.8
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	Yes
				X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	58.5
				X Walk 1 Slope (%)	1.9		X Walk 2 Slope (%)	5.3
				X Walk 1 X Slope (%)	2.6		X Walk 2 X Slope (%)	1.9
			N/A	Ramp inside XWalk1?	N/A	Yes	Ramp inside XWalk2?	Yes
				Road Slope (%)	3.9	N/A	Clear Space?	Yes
				Road X Slope (%)	4.0	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
				Obstruction Type			Storm Grate/Utility Type	
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good

Street 1 Name	LITTLE ROCK RD
Stop Condition-Street 2	None
Street 2 Name	ENTRANCE
Stop Condition-Street 1	None

