

## Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 13197 Main Street: S\_MCDOWELL\_ST Cross Street: E\_4TH\_ST Location: S

ADA ID: 08EF2C0E0738 Ramp Type: Perp Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 37.5

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

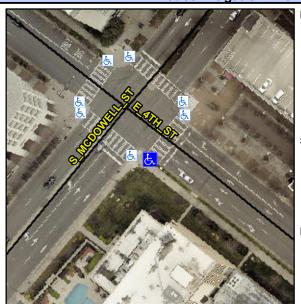

	The state of the s
Street 1 Name	E 4TH ST
Stop Condition-Street 2	Signal
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Possible Solutions:

Remove & Replace Entire Ramp.

N/A

N/A

Surveyor Notes:

N/A

N/A

N/A

PROW/ADA:

R304.2.2, R304.5.3

N/A

N/A

Total Cost:	\$	1850.00

Field Measurements/Component Compnance							
Compliance Description Data			Comp	oliance Description	Data		
N/A	Ramp Length (in)	60.0	No	Ramp Slope (%)	9.0		
Yes	Ramp Width (in)	49.0	No	Ramp XSlope (%)	10.6		
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A		
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A		
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A		
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A		
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
N/A	Shared Landing?	N/A					
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A		
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A		
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A		
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A		
N/A	X Walk 1 Width (in)	181.0	N/A	X Walk 2 Width (in)	N/A		
	X Walk 1 Slope (%)	4.5		X Walk 2 Slope (%)	N/A		
	X Walk 1 X Slope (%)	1.1		X Walk 2 X Slope (%)	N/A		
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A		
	Road Slope (%)	N/A	N/A	Clear Space?	N/A		
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A		
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A		
	Obstruction Type		Į.	Storm Grate/Utility Type			
		N/A			N/A		
			Yes	Surface Condition? (G/P)	Good		



