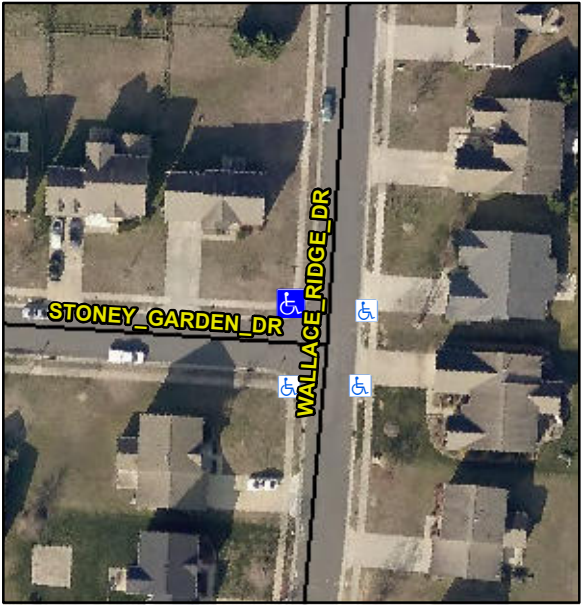


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 29157	Main Street: STONEY_GARDEN_DR	Cross Street: WALLACE_RIDGE_DR	Location: NW
ADA ID: 09050487E94B	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 33.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:		Compliance		Description		Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A		Ramp Length (in)		50.0	Yes	Ramp Slope (%)	7.1
<p>Surveyor Notes:</p> <p>N/A</p>			No		Ramp Width (in)		46.0	No	Ramp XSlope (%)	7.8
			N/A		Flare Type LT		N/A	N/A	Flare Type RT	N/A
<p>PROW/ADA:</p> <p>R304.5.1, R304.5.3</p>			N/A		Flare Slope LT (%)		N/A	N/A	Flare Slope RT (%)	N/A
			N/A		Flare Traversable LT?		N/A	N/A	Flare Traversable RT?	N/A
<p>Total Cost:</p> <p>\$ 3200.00</p>			N/A		Landing Length (in)		N/A	N/A	DWS Provided?	N/A
			N/A		Landing Width (in)		N/A	N/A	DWS Contrast?	N/A
			N/A		Landing Slope (%)		N/A	N/A	DWS Length (in)	N/A
			N/A		Landing X Slope (%)		N/A	N/A	DWS Full Width?	N/A
			N/A		Landing Curb? (Y/N)		N/A	N/A	DWS Offset (in)	N/A
			N/A		Shared Landing?		N/A			
			N/A		Gutter Ponding?		N/A	N/A	Gutter Slope (%)	N/A
			N/A		Gutter Lip Ht (in)		N/A	N/A	Gutter X Slope (%)	N/A
			N/A		Painted X Walk1?		No	N/A	Painted X Walk2?	No
					X Walk 1 Direction		To S		X Walk 2 Direction	To E
			N/A		X Walk 1 Width (in)		N/A	N/A	X Walk 2 Width (in)	N/A
					X Walk 1 Slope (%)		1.8		X Walk 2 Slope (%)	1.6
					X Walk 1 X Slope (%)		0.6		X Walk 2 X Slope (%)	2.7
			N/A		Ramp inside XWalk1?		N/A	N/A	Ramp inside XWalk2?	N/A
					Road Slope (%)		4.3	N/A	Clear Space?	N/A
					Road X Slope (%)		2.2	N/A	Clear Space to XWalk (in)	N/A
			N/A		Any Obstructions?		N/A	N/A	Storm Grate/Utility Hazard?	N/A
					Obstruction Type				Storm Grate/Utility Type	
								N/A		N/A
								Yes	Surface Condition? (G/P)	Good

