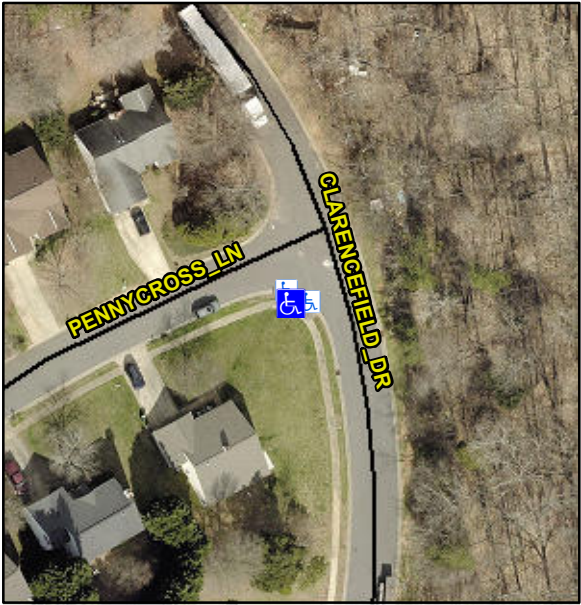



# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 5025	Main Street: CLARENCEFIELD_DR	Cross Street: PENNYCROSS_LN	Location: SW
ADA ID: 0971869227CC	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance			
	Possible Solutions:			<b>Compliance</b>	<b>Description</b>	<b>Data</b>	
	<b>Remove &amp; Replace Entire Ramp.</b>			N/A	Ramp Length LT (in)	20.0	N/A
				No	Ramp Width LT (in)	46.0	No
				Yes	Ramp Slope LT (%)	5.6	Yes
				No	Ramp XSlope LT (%)	3.8	No
				N/A	Ramp Length (in)	54.0	Yes
				Yes	Ramp Width (in)	48.0	No
				N/A	Flare Type LT	N/A	N/A
				N/A	Flare Slope LT (%)	N/A	N/A
				N/A	Flare Traversable LT?	N/A	N/A
<p>Surveyor Notes:</p> <p><b>RP &lt; 5%</b></p> <p>PROW/ADA:</p> <p><b>Not Found, R304.5.1, R304.5.3</b></p>				N/A	Ramp Length RT (in)	64.0	N/A
				No	Ramp Width RT (in)	47.5	No
				Yes	Ramp Slope RT (%)	6.4	Yes
				No	Ramp XSlope RT (%)	2.8	No
				Yes	Ramp Slope (%)	3.5	No
				No	Ramp XSlope (%)	6.6	N/A
				N/A	Flare Type RT	N/A	N/A
				N/A	Flare Slope RT (%)	N/A	N/A
				N/A	Flare Traversable RT?	N/A	N/A
				N/A	DWS Provided?	N/A	N/A
<p>Street 1 Name</p> <p>Stop Condition-Street 1</p> <p>Street 2 Name</p> <p>Stop Condition-Street 2</p>				N/A	DWS Contrast?	N/A	N/A
				N/A	DWS Length (in)	N/A	N/A
				N/A	DWS Full Width?	N/A	N/A
				N/A	DWS Offset (in)	N/A	N/A
				N/A	Gutter Slope (%)	N/A	N/A
				N/A	Gutter Lip Ht (in)	N/A	N/A
				N/A	Gutter X Slope (%)	N/A	N/A
				N/A	Painted X Walk1?	No	N/A
				N/A	Painted X Walk2?	N/A	N/A
				N/A	X Walk 1 Direction	To N	N/A
<p>Total Cost:</p> <p><b>\$ 1800.00</b></p>				N/A	X Walk 2 Direction	N/A	N/A
				N/A	X Walk 1 Width (in)	N/A	N/A
				N/A	X Walk 2 Width (in)	N/A	N/A
				N/A	X Walk 1 Slope (%)	0.1	N/A
				N/A	X Walk 2 Slope (%)	N/A	N/A
				N/A	X Walk 1 X Slope (%)	4.3	N/A
				N/A	X Walk 2 X Slope (%)	N/A	N/A
				N/A	Ramp inside XWalk1?	N/A	N/A
				N/A	Ramp inside XWalk2?	N/A	N/A
				N/A	Road Slope (%)	4.3	N/A
				N/A	Road X Slope (%)	0.1	N/A
				N/A	Clear Space?	N/A	N/A
				N/A	Clear Space to XWalk (in)	N/A	N/A
				N/A	Any Obstruction?	N/A	N/A
				N/A	Obstruction Type	N/A	N/A
				N/A	Storm Grate/Utility Hazard?	N/A	N/A
				N/A	Storm Grate/Utility Type	N/A	N/A
				N/A	Surface Condition? (G/P)	Yes	Good
				N/A	Curb Slope (%)	8.6	N/A
				N/A			