


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 29149	Main Street: STONEY_GARDEN_DR	Cross Street: CREEK_BREEZE_RD	Location: NE
ADA ID: 097F1A8691D0	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 25.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

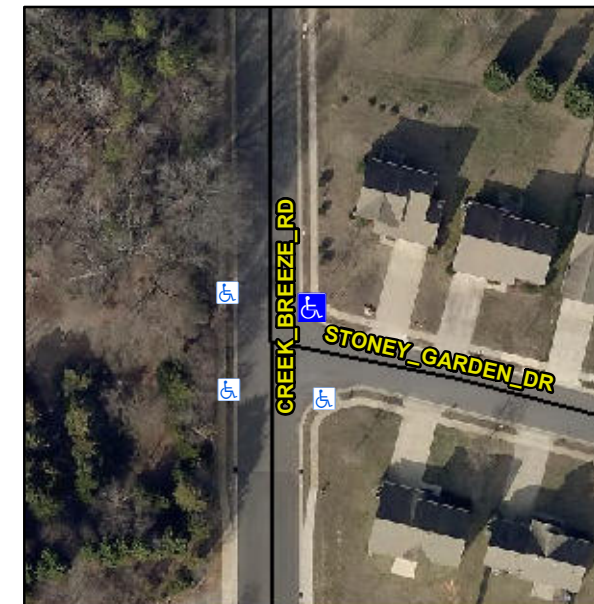

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

CRACK RT FL

PROW/ADA:

R304.5.1, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305.2, R302.7.2, R304.5.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	52.0	Yes	BlendTrans Slope (%)	3.2
No	Ramp Width (in)	40.5	Yes	BlendTrans XSlope (%)	1.9
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
Yes	Flare Slope LT (%)	3.5	Yes	Flare Slope RT (%)	0.5
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	43.5	Yes	DWS Provided?	Yes
No	Landing Width (in)	34.5	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	4.2	Yes	DWS Length (in)	25.5
No	Landing X Slope (%)	2.5	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	10.8
No	Gutter Lip Ht (in)	1.0	No	Gutter X Slope (%)	3.8
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To W		X Walk 2 Direction	To S
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.9		X Walk 2 Slope (%)	3.5
	X Walk 1 X Slope (%)	3.0		X Walk 2 X Slope (%)	3.6
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.9		Clear Space?	Yes
	Road X Slope (%)	4.9	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	3.7

