


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 2848	Main Street: DOWNFIELD_WOOD_DR	Cross Street: TUPELO_LN	Location: NW
ADA ID: 09939264A37A	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 31.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

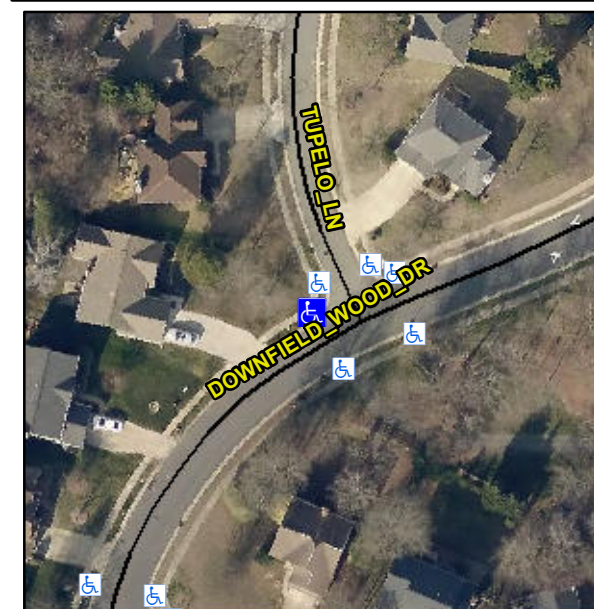

Possible Solutions:

**Remove & Replace Entire Ramp.
Grind Gutter Lip.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.2, R304.2.1, R304.2.2-Perp,
R304.3.2-Para, R305, R302.7.2**

Total Cost: \$ 2050.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	No	Ramp Slope (%)	8.6
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	2.6
N/A	Flare Type LT	None	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
No	Landing Length (in)	47.0	No	DWS Provided?	No
No	Landing Width (in)	27.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	4.5	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	2.4	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.9
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	2.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To S		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.5		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.0		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

