

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 31549	Main Street: CROSS_ST	Cross Street: RED_SHED_LN	Location: NE
ADA ID: 09B29CE698A6	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

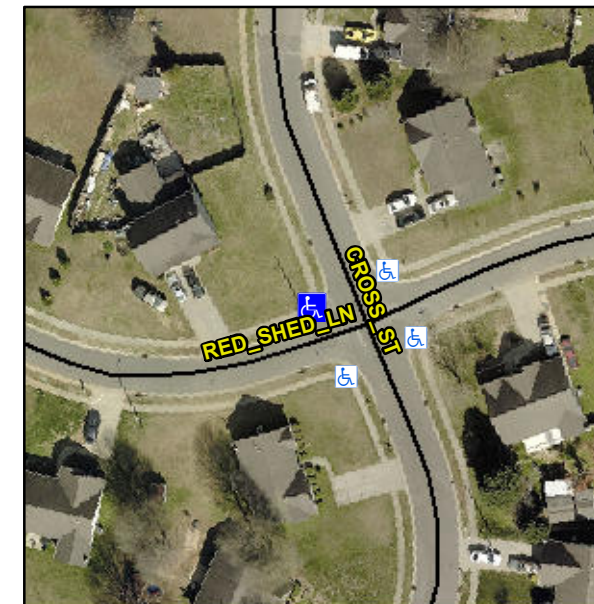

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.2-Perp, R304.3.2-Para, R305.2, R302.7.2, R304.5.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	42.5	Yes	Ramp Slope (%)	7.1
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	2.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	12.4	N/A	Flare Slope RT (%)	8.4
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	50.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	5.8	Yes	DWS Length (in)	25.5
Yes	Landing X Slope (%)	1.6	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	10.0
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	1.3
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To S		X Walk 2 Direction	To E
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.9		X Walk 2 Slope (%)	1.1
	X Walk 1 X Slope (%)	3.1		X Walk 2 X Slope (%)	0.8
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.2	N/A	Clear Space?	Yes
	Road X Slope (%)	0.1	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
		Yes		Surface Condition? (G/P)	Good

Street 1 Name RED SHED LN
 Stop Condition-Street 2 StopSign
 Street 2 Name CROSS ST
 Stop Condition-Street 1 None

