


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 43363	Main Street: PROSPERITY_VIEW_DR	Cross Street: RIDGEVIEW_COMMONS_DR	Location:	N
ADA ID: 09B3B7AB025C	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 19

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

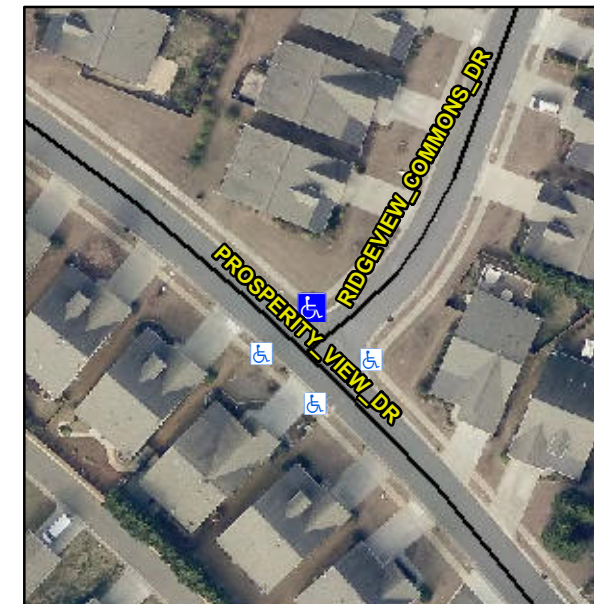

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.2, R302.7.2

Total Cost: \$ 3400.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	49.5	Yes	BlendTrans Slope (%)	3.6
Yes	Ramp Width (in)	51.0	Yes	BlendTrans XSlope (%)	0.8
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	5.2	N/A	Flare Slope RT (%)	5.5
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	37.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	46.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.7	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.9	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	2.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.4
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	0.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To SW
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.1		X Walk 2 Slope (%)	1.4
	X Walk 1 X Slope (%)	0.2		X Walk 2 X Slope (%)	0.7
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.5		Clear Space?	Yes
	Road X Slope (%)	0.4	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	0.4

Street 1 Name PRSPERITY COMMONS DR
Stop Condition-Street 1 None
Street 2 Name RIDGEVIEW COMMONS DR
Stop Condition-Street 2 StopSign

