


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 32292	Main Street: OLD_ARDREY_KELL_RD	Cross Street: HONEYNUT_DR	Location: SE
ADA ID: 0A62B71E4266	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 21.25			

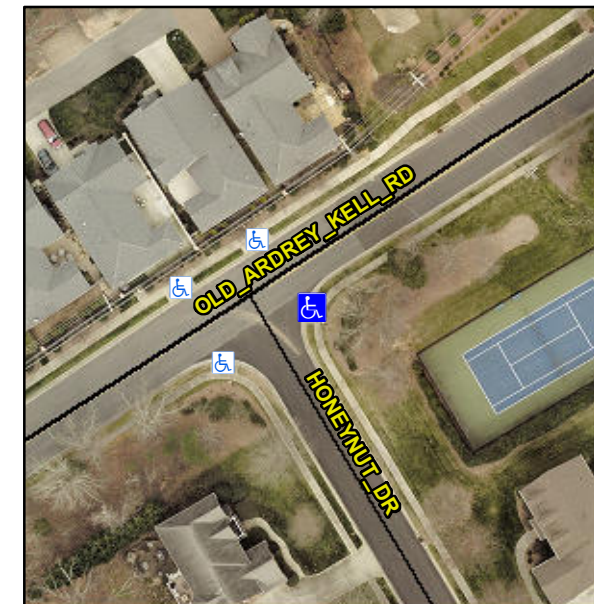

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.1, R304.3.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	44.5	N/A	Ramp Length RT (in)	49.0
No	Ramp Width LT (in)	45.0	No	Ramp Width RT (in)	45.5
No	Ramp Slope LT (%)	10.5	Yes	Ramp Slope RT (%)	5.5
Yes	Ramp XSlope LT (%)	0.9	Yes	Ramp XSlope RT (%)	0.7
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	9.7		X Walk 2 Slope (%)	0.2
	X Walk 1 X Slope (%)	0.3		X Walk 2 X Slope (%)	9.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	6.4	N/A	Clear Space?	N/A
	Road X Slope (%)	2.9	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	7.6

